



12 S..DR/DT/DV


12.1 S, SF, SAF, SHF, SA, SH, ST, SAZ, SHZ..DR/DT/DV

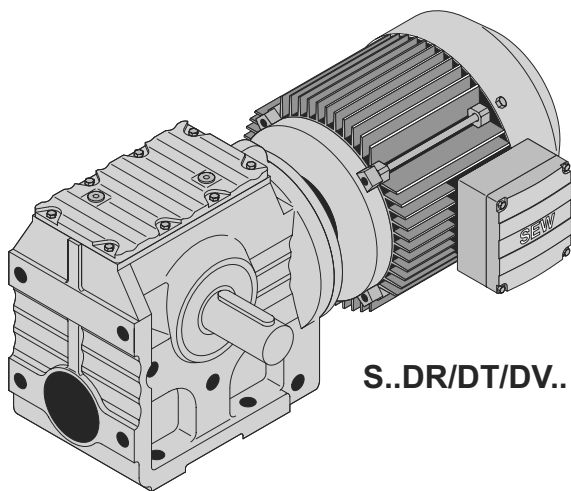


S..DR/DT/DV..

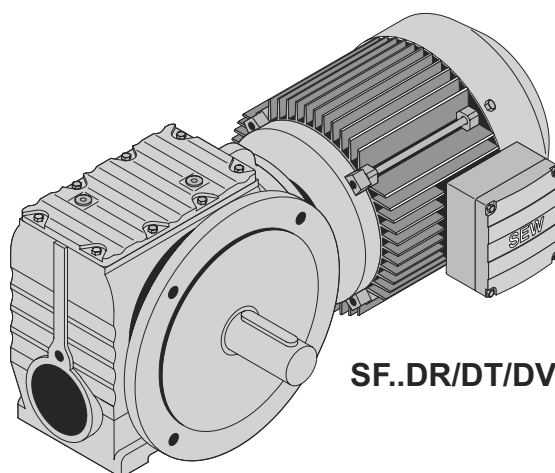

SF..DR/DT/DV..

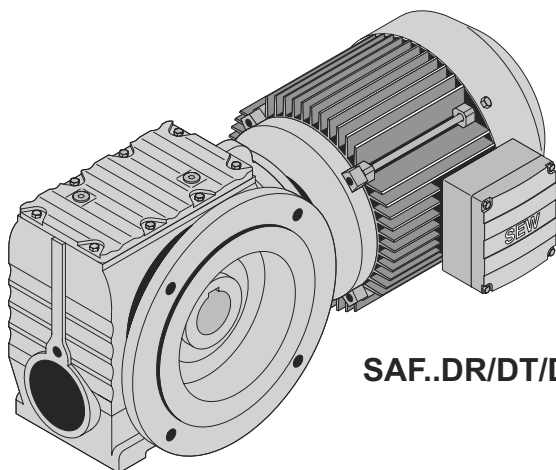


SAF..DR/DT/DV..




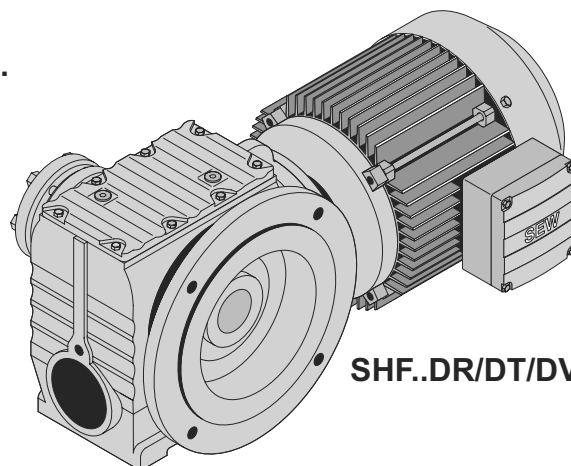


SHF..DR/DT/DV..


04459AXX

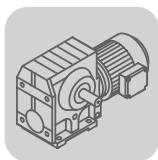**S..DR/DT/DV**

S, SF, SAF, SHF, SA, SH, ST, SAZ, SHZ..DR/DT/DV

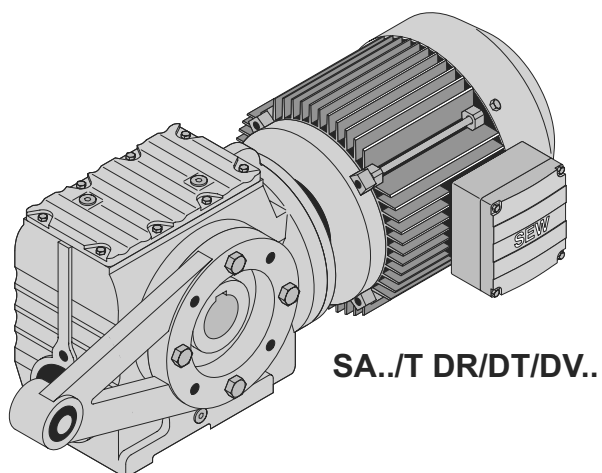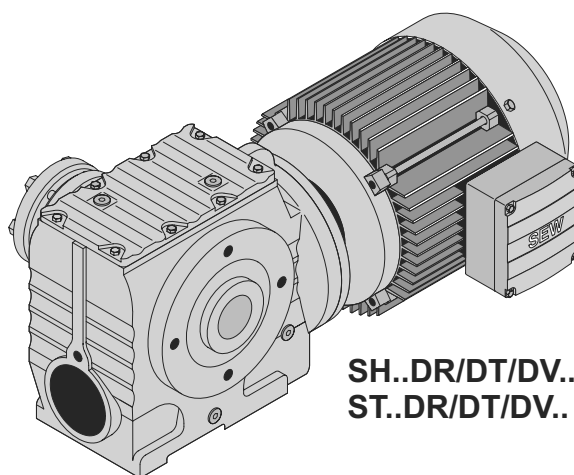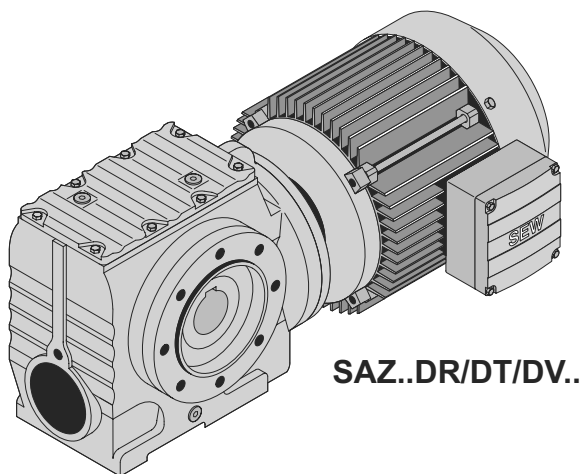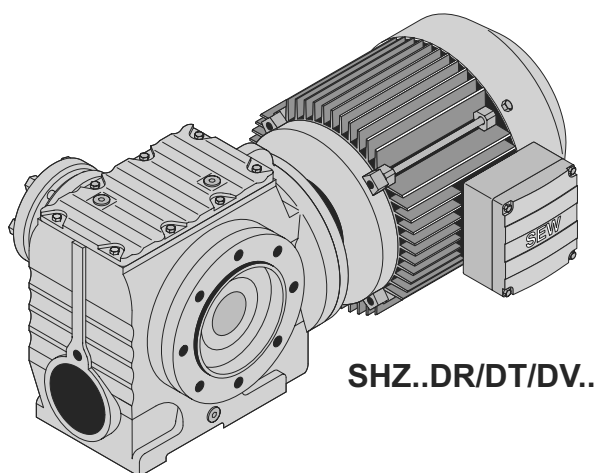

**SA..T DR/DT/DV..****SH..DR/DT/DV..
ST..DR/DT/DV..****SAZ..DR/DT/DV..****SHZ..DR/DT/DV..**

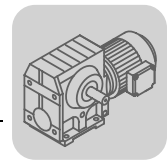
04460AXX





12.2 S.. → DR/DT/DV


S37, $n_e = 1400$ 1/min					92 Nm		
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90
8.9	92	3000	-	157.43			
9.7	92	3000	-	144.40*			
11	91	3000	-	122.94			
13	88	3000	-	106.00*			
14	87	3000	-	98.80*			
16	86	3000	-	86.36			
17	85	3000	-	80.96			
20	84	3000	-	71.44*			
22	82	3000	-	63.33			
25	81	3000	-	55.93			
26	80	3000	-	53.83			
27	81	3000	-	51.30*			
32	81	3000	-	43.68			
37	79	3000	-	37.66			
40	78	3000	-	35.10*			
46	76	2870	-	30.68			
49	75	2800	-	28.76			
55	74	2660	-	25.38*			
62	73	2530	-	22.50*			
70	52	2470	-	19.89			
73	71	2380	-	19.13*			
77	52	2380	-	18.24*			
90	50	2240	-	15.53			
105	49	2110	-	13.39			
112	48	2060	-	12.48*			
128	48	1940	-	10.91			
137	47	1900	-	10.23			
155	46	1810	-	9.02*			
175	45	1730	-	8.00*			
206	43	1630	-	6.80*			

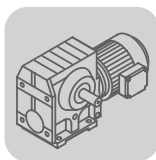S37R17, $n_e = 1400$ 1/min					92 Nm		
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	
 2  3							
0.14	92	3000	-	10037			
0.16	92	3000	-	8654			
0.17	92	3000	-	8066			
0.20	92	3000	-	7051			
0.23	92	3000	-	6079			
0.26	92	3000	-	5431			
0.29	92	3000	-	4747			
0.34	92	3000	-	4155			
0.39	92	3000	-	3632			
0.49	92	3000	-	2866			
0.57	92	3000	-	2471			
0.65	92	3000	-	2160			
0.74	92	3000	-	1887			
0.84	92	3000	-	1665			
0.96	92	3000	-	1456			
1.1	92	3000	-	1271			
1.2	92	3000	-	1121			
1.4	92	3000	-	994			
1.6	92	3000	-	869			






S..DR/DT/DV
 S.. → DR/DT/DV

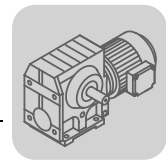S37R17, $n_e = 1400$ 1/min					92 Nm	
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80
 2  2						
1.8	92	3000	-	774		
2.1	92	3000	-	666		
2.3	92	3000	-	596		
2.7	92	3000	-	521		
3.1	92	3000	-	456		
3.5	92	3000	-	398		
4.0	92	3000	-	351		
4.6	92	3000	-	303		
5.3	92	3000	-	265		
6.0	92	3000	-	232		
6.9	92	3000	-	202		
7.8	92	3000	-	179		
8.9	92	3000	-	158		
9.7	92	3000	-	144		
12	92	3000	-	118		
13	92	3000	-	110		

S47, $n_e = 1400$ 1/min					170 Nm			
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100
7.0	170	5340	-	201.00*				
7.6	170	5340	-	184.80*				
8.9	170	5340	-	158.12				
10	168	5350	-	137.05				
11	168	5350	-	128.10*				
13	168	5350	-	110.73				
15	168	5350	-	94.08*				
17	167	5360	-	84.00*				
20	167	5360	-	71.75*				
20	155	5370	-	69.39				
21	167	5360	-	67.20*				
22	155	5370	-	63.80*				
25	165	5320	-	56.61				
26	155	5150	-	54.59				
30	155	4850	-	47.32				
32	155	4710	-	44.22*				
37	155	4430	-	38.23				
43	155	4120	-	32.48*				
48	155	3920	-	29.00*				
57	155	3650	-	24.77				
60	152	3570	-	23.20*				
69	110	3370	-	20.33				
72	144	3370	-	19.54				
79	110	3160	-	17.62				
85	110	3060	-	16.47*				
98	110	2850	-	14.24				
116	109	2650	-	12.10*				
130	109	2500	-	10.80*				
152	109	2310	-	9.23*				
162	109	2230	-	8.64*				
192	103	2110	-	7.28				




S47R17, n_e = 1400 1/min 170 Nm

n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80
 2  3						
0.11	185	5250	-	12909		
0.13	185	5250	-	11189		
0.13	185	5250	-	10374		
0.16	185	5250	-	8992		
0.18	185	5250	-	7860		
0.20	185	5250	-	6887		
0.23	185	5250	-	6055		
0.26	185	5250	-	5292		
0.30	185	5250	-	4637		
0.34	185	5250	-	4092		
0.39	185	5200	-	3582		
0.45	185	5200	-	3131		
0.52	185	5200	-	2714		
0.58	185	5200	-	2412		
0.66	185	5200	-	2131		
0.75	185	5200	-	1863		
0.84	185	5200	-	1663		
0.98	185	5200	-	1435		
1.1	185	5200	-	1254		
1.2	185	5200	-	1120		
1.3	185	5200	-	1083		
1.5	183	5210	-	956		
 2  2						
1.5	185	5200	-	965		
1.6	185	5200	-	865		
1.9	185	5200	-	750		
2.1	185	5200	-	655		
2.4	185	5200	-	574		
2.8	185	5200	-	506		
3.2	185	5200	-	438		
3.6	185	5200	-	388		
4.2	185	5200	-	336		
4.8	185	5200	-	294		
5.4	185	5260	-	257		
6.1	185	5200	-	229		
7.0	185	5200	-	200		
7.5	185	5200	-	187		
8.5	185	5200	-	165		
9.5	185	5200	-	148		
11	185	5200	-	131		



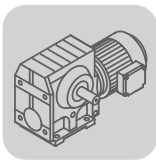

S57, n_e = 1400 1/min 295 Nm


n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100
7.0	295	7130	-	201.00*				
7.6	295	7130	-	184.80*				
8.9	295	7130	-	158.12				
10	295	7130	-	137.05				
11	295	7130	-	128.10*				
13	295	7130	-	110.73				
15	295	7130	-	94.08*				
17	295	7130	-	84.00*				
20	290	7170	-	71.75*				
20	245	7520	-	69.39				
21	285	7220	-	67.20*				
22	245	7520	-	63.80*				



S..DR/DT/DV
S.. → DR/DT/DV

S57, n_e = 1400 1/min					295 Nm			
n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100
25	265	7370	-	56.61				
26	245	7520	-	54.59				
30	245	7520	-	47.32				
32	245	7520	-	44.22*				
37	245	7320	-	38.23				
43	245	6840	-	32.48*				
48	245	6520	-	29.00*				
57	245	6100	-	24.77				
60	245	5930	-	23.20*				
69	168	5690	-	20.33				
72	215	5720	-	19.54				
79	168	5350	-	17.62				
85	168	5200	-	16.47*				
98	169	4860	-	14.24				
116	169	4520	-	12.10*				
130	169	4290	-	10.80*				
152	169	3990	-	9.23*				
162	166	3900	-	8.64*				
192	146	3790	-	7.28				


S57R17, n_e = 1400 1/min					295 Nm			
n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80		
 2  3								
0.11	330	6800	-	12909				
0.13	330	6800	-	11189				
0.13	330	6800	-	10374				
0.16	330	6800	-	8992				
0.18	330	6800	-	7860				
0.20	330	6800	-	6887				
0.23	330	6800	-	6055				
0.26	330	6800	-	5292				
0.30	330	6800	-	4637				
0.34	330	6800	-	4092				
0.39	330	6800	-	3628				
0.45	300	7090	-	3131				
0.52	300	7090	-	2714				
0.58	300	7090	-	2412				
0.66	300	7090	-	2131				
0.75	300	7090	-	1863				
0.84	300	7090	-	1663				
0.98	300	7090	-	1435				
1.1	300	7090	-	1254				
1.3	300	7090	-	1083				
 2  2								
1.5	300	7090	-	965				
1.6	300	7090	-	865				
1.9	300	7090	-	750				
2.1	300	7090	-	655				
2.4	300	7090	-	574				
2.8	300	7090	-	506				
3.2	300	7090	-	438				
3.6	300	7090	-	388				
4.2	300	7090	-	336				
4.8	300	7090	-	294				
5.2	300	7090	-	269				
6.1	300	7090	-	229				

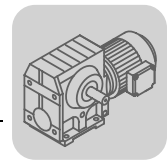

S57R17, $n_e = 1400$ 1/min					295 Nm	
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80
6.9	300	7090	-	204		
7.5	300	7090	-	187		
8.5	300	7090	-	165		
11	300	7090	-	131		

S67, $n_e = 1400$ 1/min					520 Nm					
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100	DV112	DV132S DV132M
6.4	520	8680	-	217.41						
7.4	520	8680	-	190.11						
7.8	520	8680	-	180.60*						
8.8	520	8680	-	158.45						
10	520	8680	-	134.40*						
12	520	8680	-	121.33						
13	520	8680	-	106.75*						
14	520	8680	-	100.80*						
16	520	8680	-	85.83						
18	520	8680	-	78.00*						
19	480	9020	-	75.06						
21	520	8680	-	67.57						
21	480	9020	-	65.63						
22	480	9020	-	62.35*						
24	500	8850	-	58.80*						
26	480	8670	-	54.70						
30	480	8060	-	46.40*						
33	480	7690	-	41.89						
38	480	7250	-	36.85						
40	480	7060	-	34.80*						
47	480	6540	-	29.63						
52	480	6240	-	26.93						
57	340	6040	-	24.44						
60	480	5810	-	23.33						
60	340	5890	-	23.22*						
69	340	5520	-	20.37						
69	425	5760	-	20.30*						
81	340	5080	-	17.28*						
90	340	4820	-	15.60*						
102	340	4510	-	13.73*						
108	340	4310	-	12.96*						
127	340	3660	-	11.03						
140	340	3290	-	10.03						
161	335	2860	-	8.69						
185	295	3220	-	7.56*						


S67R37, $n_e = 1400$ 1/min					520 Nm			
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100
2 3								
0.07	570	8190	-	21362				
0.07	570	8190	-	19594				
0.08	570	8190	-	18120				
0.08	570	8190	-	16682				
0.10	570	8190	-	14383				
0.11	570	8190	-	12774				
0.13	570	8190	-	11013				
0.14	570	8190	-	9694				
0.16	570	8190	-	8529				
0.19	570	8190	-	7455				

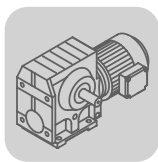

S..DR/DT/DV
S.. → DR/DT/DV


S67R37, n_e = 1400 1/min					520 Nm			
n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100
0.21	570	8190	-	6531				
0.24	570	8190	-	5759				
0.28	570	8190	-	4965				
0.32	570	8190	-	4410				
0.36	570	8190	-	3880				
0.41	570	8190	-	3432				
0.48	570	8190	-	2944				
0.53	570	8190	-	2630				
0.61	570	8190	-	2279				
0.70	570	8190	-	2014				
0.79	570	8190	-	1772				
0.90	570	8190	-	1559				
1.0	570	8190	-	1363				
1.2	570	8190	-	1194				
1.3	570	8190	-	1045				
1.5	570	8190	-	914				
1.7	570	8190	-	809				
2.0	570	8190	-	712				
2.3	570	8190	-	615				
2.6	570	8190	-	543				
3.0	570	8190	-	469				
3.3	570	8190	-	424				
3.8	570	8190	-	365				
4.4	570	8190	-	319				
5.0	570	8190	-	281				
5.7	570	8190	-	246				
6.3	570	8190	-	221				
7.1	570	8190	-	198				
8.3	570	8190	-	168				
9.0	570	8190	-	156				

S77, n_e = 1400 1/min					1270 Nm						
n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100	DV112	DV132S DV132M	DV132ML DV160M
5.5	1270	11700	-	256.47							
6.2	1270	11700	-	225.26							
6.5	1270	11700	-	214.00*							
7.4	1270	11700	-	189.09							
8.7	1260	11800	-	161.60*							
9.4	1240	12000	-	148.15							
11	1210	12200	-	130.00*							
11	1200	12300	-	123.20*							
13	1170	12600	-	107.83							
14	1140	12800	-	97.14							
16	1100	13100	-	85.22							
19	1070	12800	-	75.20*							
19	1100	11900	-	75.09							
20	1100	11600	-	71.33							
21	1040	12300	-	66.67							
22	1100	10900	-	63.03							
25	990	11600	-	56.92							
26	1100	10100	-	53.87							
28	1100	9650	-	49.38							
32	1100	9010	-	43.33							
34	1100	8750	-	41.07							
39	1100	8140	-	35.94							
43	1090	7730	-	32.38							

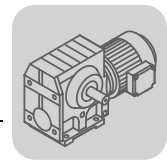


S77, $n_e = 1400$ 1/min					1270 Nm						
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100	DV112	DV132S DV132M	DV132ML DV160M
49	1050	7370	-	28.41							
56	1020	7010	-	25.07							
61	705	5970	-	22.89							
63	980	6740	-	22.22							
67	705	5390	-	20.99							
74	930	6390	-	18.97							
76	705	4550	-	18.42							
80	710	4130	-	17.45							
92	710	3320	-	15.28							
102	710	2710	-	13.76							
116	720	1800	-	12.07							
131	720	1130	-	10.65							
148	725	420	-	9.44							
174	680	445	-	8.06							

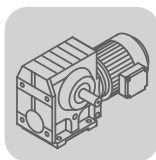

S77R37, $n_e = 1400$ 1/min					1270 Nm			
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100
2 3								
0.05	1270	11700	-	25493				
0.06	1270	11700	-	21787				
0.07	1270	11700	-	19907				
0.08	1270	11700	-	17013				
0.10	1270	11700	-	14668				
0.11	1270	11700	-	13110				
0.12	1270	11700	-	11569				
0.14	1270	11700	-	9887				
0.16	1270	11700	-	8817				
0.18	1270	11700	-	7735				
0.21	1270	11700	-	6735				
0.24	1270	11700	-	5943				
0.27	1270	11700	-	5214				
0.30	1270	11700	-	4618				
0.35	1270	11700	-	3992				
0.40	1270	11700	-	3540				
0.45	1270	11700	-	3098				
0.51	1240	12000	-	2753				
0.59	1240	12000	-	2374				
0.67	1240	12000	-	2083				
0.77	1240	12000	-	1813				
0.80	1240	12000	-	1745				
0.88	1240	12000	-	1600				
1.0	1240	12000	-	1404				
1.1	1240	12000	-	1245				
2 2								
1.3	1240	12000	-	1100				
1.5	1240	12000	-	954				
1.7	1240	12000	-	837				
2.0	1240	12000	-	714				
2.2	1240	12000	-	637				
2.4	1240	12000	-	574				
2.8	1240	12000	-	499				
3.2	1240	12000	-	438				
3.6	1240	12000	-	389				
4.3	1240	12000	-	327				
4.8	1240	12000	-	289				
5.6	1240	12000	-	250				
6.4	1240	12000	-	219				




S87, n_e = 1400 1/min					2280 Nm						
n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DT80	DT90	DV100	DV112	DV132S DV132M	DV132ML DV160M DV160L	DV180
4.9	2280	27900	-	288.00*							
5.4	2280	27900	-	258.18							
6.3	2280	27900	-	222.40*							
6.9	2260	28000	-	202.96							
7.8	2210	28100	-	180.00*							
9.3	2150	28200	-	151.30							
10	2100	28300	-	139.05							
11	2060	28300	-	123.48							
13	2000	28400	-	110.40*							
14	1960	28500	-	99.26							
15	1510	29100	-	91.20*							
16	1880	28600	-	86.15							
17	1600	29000	-	81.76							
18	1820	28700	-	77.14							
20	1600	29000	-	70.43							
22	1600	29000	-	64.27							
22	1700	28900	-	64.00*							
25	1600	29000	-	57.00*							
29	1600	29000	-	47.91							
32	1600	29000	-	44.03							
36	1600	28200	-	39.10							
40	1600	27100	-	34.96*							
45	1600	26000	-	31.43							
51	1600	24700	-	27.28							
55	1240	23400	-	25.50*							
57	1600	23700	-	24.43							
65	1240	21800	-	21.43							
69	1600	22100	-	20.27							
71	1240	21100	-	19.70							
80	1240	20200	-	17.49							
90	1240	19300	-	15.64*							
100	1240	18500	-	14.06							
115	1240	17400	-	12.21							
128	1240	16600	-	10.93							
154	1140	15900	-	9.07							
178	1010	15700	-	7.88							

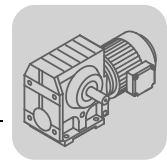S87R57, n_e = 1400 1/min					2280 Nm						
n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100	DV112	DV132S DV132M	
2 3											
0.05	2500	27500	-	25987							
0.06	2500	27500	-	23940							
0.07	2500	27500	-	20568							
0.08	2500	27500	-	18265							
0.08	2500	27500	-	16774							
0.09	2500	27500	-	14820							
0.11	2500	27500	-	13160							
0.12	2500	27500	-	11200							
0.14	2500	27500	-	9904							
0.16	2500	27500	-	8549							
0.18	2500	27500	-	7643							
0.21	2500	27500	-	6706							
0.24	2500	27500	-	5875							
0.27	2500	27500	-	5187							
0.30	2500	27500	-	4606							
0.36	2500	27500	-	3872							





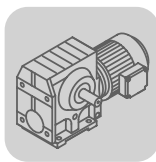


S87R57, $n_e = 1400$ 1/min					2280 Nm					
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100	DV112	DV132S DV132M
 2  2										
0.40	2500	27500	-	3475						
0.48	2500	27500	-	2905						
0.54	2500	27500	-	2586						
0.60	2500	27500	-	2335						
0.68	2500	27500	-	2054						
0.77	2500	27500	-	1824						
0.86	2500	27500	-	1631						
1.1	2500	27500	-	1332						
1.2	2500	27500	-	1191						
1.4	2500	27500	-	1032						
1.5	2500	27500	-	930						
1.7	2500	27500	-	831						
1.9	2500	27500	-	719						
2.2	2500	27500	-	624						
2.5	2500	27500	-	558						
2.9	2500	27500	-	485						
3.2	2450	27600	-	435						
3.7	2450	27600	-	378						
4.3	2400	27700	-	323						
5.0	2400	27700	-	281						
5.5	1980	28400	-	255						
6.3	1980	28400	-	222						
6.8	1980	28400	-	205						

S97, $n_e = 1400$ 1/min					4000 Nm							
n_a [1/min]	M_{amax} [Nm]	F_{Ra} [N]	φ (/R) [']	i	DT80	DT90	DV100	DV112	DV132S DV132M	DV132ML DV160M DV160L	DV180	DV200
4.9	4000	33200	-	286.40*								
5.3	4000	33200	-	262.22								
6.0	4000	33200	-	231.67								
7.1	4000	33200	-	196.52								
7.7	3920	33400	-	180.95								
8.7	3840	33500	-	161.74								
9.6	3730	33700	-	145.60*								
11	3650	33900	-	131.85								
12	3510	34100	-	116.92								
13	3440	34300	-	105.71								
16	3240	34600	-	89.60*								
17	3230	34600	-	80.85								
18	3080	34800	-	78.26								
20	3300	34500	-	71.43								
21	2900	35100	-	65.45								
23	3300	34500	-	60.59								
25	3300	34500	-	55.79								
28	3300	34500	-	49.87								
31	3300	34100	-	44.89								
34	3300	32800	-	40.65								
39	3300	31300	-	36.05								
43	3200	30400	-	32.60								
51	3010	29000	-	27.63								
53	2600	26100	-	26.39								
58	2870	28000	-	24.13								
59	2600	24900	-	23.59								
66	2600	23700	-	21.23								
73	2600	22700	-	19.23								
82	2570	21100	-	17.05								





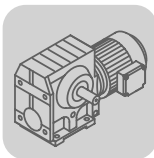
S97, n_e = 1400 1/min					4000 Nm							
n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DT80	DT90	DV100	DV112	DV132S DV132M	DV132ML DV160M DV160L	DV180	DV200
91	2470	20800	-	15.42								
107	2330	20100	-	13.07								
123	2210	19500	-	11.41								
147	2040	18800	-	9.55								
169	1770	18800	-	8.26								



S97R57, n_e = 1400 1/min					4000 Nm					
n _a [1/min]	M _{amax} [Nm]	F _{Ra} [N]	φ (/R) [']	i	DR63 DT71	DT80	DT90	DV100	DV112	DV132S DV132M
 2  3										
0.04	4200	32800	-	33818						
0.04	4200	32800	-	31154						
0.05	4200	32800	-	27847						
0.06	4200	32800	-	24641						
0.07	4200	32800	-	21537						
0.07	4200	32800	-	18749						
0.09	4200	32800	-	16233						
0.10	4200	32800	-	14576						
0.11	4200	32800	-	12752						
0.12	4200	32800	-	11267						
0.14	4200	32800	-	10078						
0.16	4200	32800	-	8608						
0.19	4200	32800	-	7554						
0.21	4200	31300	-	6640						
0.24	4200	31300	-	5780						
0.28	4200	31300	-	4937						
0.32	4200	31300	-	4444						
0.35	4200	31300	-	4017						
0.41	4200	31300	-	3453						
0.45	4200	31300	-	3108						
0.53	4200	31300	-	2654						
0.60	4200	31300	-	2329						
0.67	4200	31300	-	2081						
0.75	4200	31300	-	1860						
0.89	4200	31300	-	1574						
 2  2										
1.0	4200	31300	-	1394						
1.1	4200	31300	-	1223						
1.3	4200	31300	-	1070						
1.5	4200	31300	-	928						
1.7	4200	31300	-	824						
2.0	4200	32800	-	714						
2.2	4200	31300	-	626						
2.6	4200	31300	-	538						
2.9	4200	31400	-	484						
3.3	4200	31400	-	420						
3.7	4200	31400	-	376						
4.3	4200	31500	-	327						
4.9	4200	31500	-	287						
5.6	4200	31500	-	252						
6.4	4200	31600	-	219						
6.8	4200	31600	-	205						

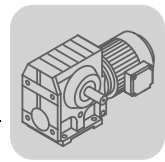




12.3 S..D.. [kW]


P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]	
0.12	0.12	4750	11267	25100	0.90	S 97 R57 DR 63S4	170	579
	0.14	4340	10078	32500	0.95	SF 97 R57 DR 63S4	200	579
	0.16	3600	8608	34000	1.15	SA 97 R57 DR 63S4	165	579
	0.18	3180	7554	34700	1.30	SAF 97 R57 DR 63S4	190	579
0.21	0.21	2690	6706	27100	0.95	S 87 R57 DR 63S4	110	579
	0.23	2400	5875	27700	1.05	SF 87 R57 DR 63S4	130	579
	0.27	1990	5187	28500	1.25	SA 87 R57 DR 63S4	105	579
	0.30	1770	4606	28800	1.40	SAF 87 R57 DR 63S4	120	579
	0.36	1470	3872	29200	1.70			
	0.39	1370	3540	7240	0.90			
0.45	0.45	1200	3098	12300	1.05			
	0.58	1330	2374	10600	0.95	S 77 R37 DR 63S4	59	579
	0.66	1170	2083	12600	1.05	SF 77 R37 DR 63S4	68	579
	0.76	990	1813	13900	1.25	SA 77 R37 DR 63S4	58	579
	0.79	940	1745	14200	1.30	SAF 77 R37 DR 63S4	65	579
	0.86	860	1600	14600	1.45			
	0.98	755	1404	15100	1.65			
	1.1	660	1245	15500	1.90			
	1.2	590	1194	7990	0.95	S 67 R37 DR 63S4	39	579
	1.3	530	1045	8560	1.05	SF 67 R37 DR 63S4	46	579
1.5	460	914	9180	1.25	SA 67 R37 DR 63S4	40	579	
SAF 67 R37	DR 63S4	45	579					
1.7	1.7	420	809	9460	1.35			
	1.9	370	712	9780	1.55			
	2.2	305	615	10100	1.85	S 67 R37 DR 63S4	39	579
	2.5	275	543	10200	2.1	SF 67 R37 DR 63S4	46	579
	2.9	225	469	10400	2.5	SA 67 R37 DR 63S4	40	579
	3.3	205	424	10500	2.8	SAF 67 R37 DR 63S4	45	579
	3.8	187	365	10500	3.0			
	2.1	330	655	6800	0.90			
2.4	2.4	285	574	7200	1.05			
	2.7	250	506	7480	1.20	S 57 R17 DR 63S4	20	579
	3.1	215	438	7700	1.40	SF 57 R17 DR 63S4	24	579
	3.6	189	388	7850	1.60	SA 57 R17 DR 63S4	20	579
	4.1	169	336	7950	1.80	SAF 57 R17 DR 63S4	23	579
	4.7	145	294	8050	2.1			
	5.1	139	269	8070	2.2			
	3.1	215	438	5010	0.85			
3.6	3.6	189	388	5170	1.00			
	4.1	169	336	5290	1.10	S 47 R17 DR 63S4	17	579
	4.7	143	294	5420	1.30	SF 47 R17 DR 63S4	20	579
	5.4	98	257	5670	1.90	SA 47 R17 DR 63S4	18	579
	6.0	118	229	5550	1.55	SAF 47 R17 DR 63S4	19	579
	6.9	102	200	5610	1.80			
	7.4	96	187	5640	1.95			
	6.8	103	202	3000	0.90			
7.7	7.7	91	179	3000	1.00	S 37 R17 DR 63S4	14	579
	8.7	82	158	3000	1.15	SF 37 R17 DR 63S4	15	579
	9.6	75	144	3000	1.20	SA 37 R17 DR 63S4	13	579
	12	61	118	3000	1.50	SAF 37 R17 DR 63S4	15	579
	13	57	110	3000	1.60			
	4.5	143	201.00*	8050	2.1	S 57 DR 63M6	17	554
	4.9	133	184.80*	8090	2.3	SF 57 DR 63M6	21	555
	5.7	116	158.12	8150	2.5	SA 57 DR 63M6	17	556
6.6	103	137.05	8180	2.9	SAF 57 DR 63M6	20	555	
4.5	4.5	138	201.00*	5490	1.30			
	4.9	129	184.80*	5540	1.40	S 47 DR 63M6	14	549
	5.7	112	158.12	5610	1.55	SF 47 DR 63M6	17	550
	6.6	99	137.05	5660	1.75	SA 47 DR 63M6	15	551
	7.0	93	128.10*	5680	1.85	SAF 47 DR 63M6	16	550




S..DR/DT/DV
S..D.. [kW]

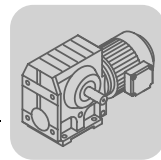
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]			
0.12	6.9	95	201.00*	5680	1.80					
	7.5	89	184.80*	5700	1.90	S	47	DR 63S4	14	549
	8.7	77	158.12	5740	2.2	SF	47	DR 63S4	17	550
	10	68	137.05	5780	2.5	SA	47	DR 63S4	15	551
	11	64	128.10*	5790	2.6	SAF	47	DR 63S4	16	550
	12	57	110.73	5810	3.0					
	5.7	107	157.43	3000	0.85					
	6.2	99	144.40*	3000	0.95	S	37	DR 63M6	11	545
	7.3	86	122.94	3000	1.05	SF	37	DR 63M6	12	546
	8.5	76	106.00*	3000	1.20	SA	37	DR 63M6	10	547
	9.1	71	98.80*	3000	1.30	SAF	37	DR 63M6	12	546
	10	64	86.36	3000	1.45					
	8.8	74	157.43	3000	1.25					
	9.6	68	144.40*	3000	1.35	S	37	DR 63S4	11	545
	11	60	122.94	3000	1.55	SF	37	DR 63S4	12	546
	13	52	106.00*	3000	1.70	SA	37	DR 63S4	10	547
	14	49	98.80*	3000	1.75	SAF	37	DR 63S4	12	546
	16	44	86.36	3000	1.95					
	17	41	80.96	3000	2.1					
	19	37	71.44*	3000	2.3					
	22	33	63.33	3000	2.5					
	25	35	55.93	3000	2.3					
	27	33	51.30*	3000	2.5					
	32	28	43.68	3000	2.9					
	37	25	37.66	3000	3.2	S	37	DR 63S4	11	545
	39	23	35.10*	3000	3.4	SF	37	DR 63S4	12	546
	45	20	30.68	3000	3.7	SA	37	DR 63S4	10	547
	48	19	28.76	3000	3.9	SAF	37	DR 63S4	12	546
	54	17	25.38*	3000	4.4					
	61	15	22.50*	3000	4.8					
	69	14	19.89	3000	3.6					
	76	13	18.24*	3000	3.9					
89	11	15.53	2870	4.4						
0.18	0.29	3010	4606	19200	0.85	S	87 R57	DR 63M4	110	579
	0.34	2520	3872	27500	1.00	SF	87 R57	DR 63M4	130	579
						SA	87 R57	DR 63M4	105	579
						SAF	87 R57	DR 63M4	120	579
	0.38	2430	3475	27700	1.05					
	0.45	2030	2905	28400	1.25	S	87 R57	DR 63M4	105	579
	0.51	1760	2586	28800	1.40	SF	87 R57	DR 63M4	130	579
	0.57	1570	2335	29100	1.60	SA	87 R57	DR 63M4	105	579
	0.64	1360	2054	29300	1.85	SAF	87 R57	DR 63M4	120	579
	0.72	1210	1824	29500	2.1					
	0.81	1080	1631	29600	2.3					
	0.94	1250	1404	11900	1.00	S	77 R37	DR 63M4	59	579
	1.1	1100	1245	13200	1.15	SF	77 R37	DR 63M4	68	579
						SA	77 R37	DR 63M4	58	579
						SAF	77 R37	DR 63M4	65	579
	1.2	1020	1100	13700	1.20					
	1.4	880	954	14500	1.40	S	77 R37	DR 63M4	58	579
	1.6	770	837	15000	1.60	SF	77 R37	DR 63M4	68	579
	1.9	640	714	15600	1.95	SA	77 R37	DR 63M4	58	579
	2.1	570	637	15800	2.2	SAF	77 R37	DR 63M4	65	579
	2.3	515	574	16000	2.4					
	1.9	600	712	7860	0.95					
	2.1	505	615	8800	1.15	S	67 R37	DR 63M4	39	579
	2.4	450	543	9230	1.25	SF	67 R37	DR 63M4	46	579
	2.8	380	469	9720	1.50	SA	67 R37	DR 63M4	40	579
	3.1	340	424	9930	1.65	SAF	67 R37	DR 63M4	45	579
3.6	305	365	10100	1.85						




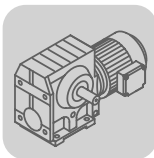
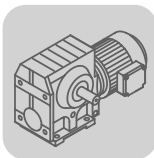
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]	
0.18	3.0	355	438	6520	0.85						
	3.4	315	388	6970	0.95						
	3.9	275	336	7290	1.10	S	57 R17	DR	63M4	20	579
	4.5	240	294	7560	1.25	SF	57 R17	DR	63M4	24	579
	4.9	225	269	7650	1.35	SA	57 R17	DR	63M4	20	579
	5.8	193	229	7830	1.55	SAF	57 R17	DR	63M4	23	579
	6.5	174	204	7930	1.75						
	7.0	159	187	7990	1.90						
	4.5	235	294	4480	0.80						
	5.1	162	257	5380	1.15						
5.8	190	229	5170	0.95	S	47 R17	DR	63M4	17	579	
6.6	167	200	5300	1.10	SF	47 R17	DR	63M4	20	579	
7.0	156	187	5360	1.20	SA	47 R17	DR	63M4	18	579	
8.0	138	165	5450	1.35	SAF	47 R17	DR	63M4	19	579	
9.0	124	148	5520	1.50							
10	110	131	5580	1.70							
4.0	255	217.41	10300	2.2	S	67	DR	63L6	29	559	
4.6	225	190.11	10400	2.5	SF	67	DR	63L6	35	560	
4.8	215	180.60*	10400	2.6	SA	67	DR	63L6	30	561	
					SAF	67	DR	63L6	34	560	
4.3	220	201.00*	7670	1.35	S	57	DR	63L6	18	554	
4.7	205	184.80*	7760	1.45	SF	57	DR	63L6	22	555	
5.5	180	158.12	7900	1.65	SA	57	DR	63L6	18	556	
6.4	159	137.05	7990	1.85	SAF	57	DR	63L6	21	555	
6.6	154	201.00*	8010	1.90	S	57	DR	63M4	17	554	
7.1	143	184.80*	8050	2.1	SF	57	DR	63M4	21	555	
8.3	125	158.12	8120	2.4	SA	57	DR	63M4	17	556	
9.6	110	137.05	8160	2.7	SAF	57	DR	63M4	20	555	
4.3	215	201.00*	5090	0.85	S	47	DR	63L6	14	549	
4.7	199	184.80*	5180	0.90	SF	47	DR	63L6	18	550	
5.5	173	158.12	5320	1.00	SA	47	DR	63L6	15	551	
6.4	153	137.05	5420	1.10	SAF	47	DR	63L6	17	550	
6.8	144	128.10*	5470	1.20							
6.6	149	201.00*	5440	1.15							
7.1	138	184.80*	5490	1.25							
8.3	121	158.12	5570	1.40							
9.6	107	137.05	5630	1.60	S	47	DR	63M4	14	549	
10	100	128.10*	5660	1.65	SF	47	DR	63M4	17	550	
12	88	110.73	5700	1.90	SA	47	DR	63M4	15	551	
14	77	94.08*	5750	2.2	SAF	47	DR	63M4	16	550	
16	69	84.00*	5770	2.4							
18	60	71.75*	5800	2.8							
19	69	69.39	5750	2.2							
8.4	115	157.43	3000	0.80							
9.1	107	144.40*	3000	0.85	S	37	DR	63M4	11	545	
11	93	122.94	3000	1.00	SF	37	DR	63M4	12	546	
12	82	106.00*	3000	1.10	SA	37	DR	63M4	10	547	
13	77	98.80*	3000	1.15	SAF	37	DR	63M4	12	546	
15	68	86.36	3000	1.25							
16	64	80.96	3000	1.30							
18	58	71.44*	3000	1.45							
21	52	63.33	3000	1.60							
24	55	55.93	3000	1.45							
26	51	51.30*	3000	1.60							
30	44	43.68	3000	1.85							
35	38	37.66	3000	2.1							
38	36	35.10*	3000	2.2							
43	32	30.68	3000	2.4	S	37	DR	63M4	11	545	
46	30	28.76	3000	2.5	SF	37	DR	63M4	12	546	
52	27	25.38*	3000	2.8	SA	37	DR	63M4	10	547	
59	24	22.50*	3000	3.1	SAF	37	DR	63M4	12	546	
66	22	19.89	3000	2.3							
72	21	18.24*	2940	2.5							
85	18	15.53	2810	2.8							
99	15	13.39	2700	3.2							
106	14	12.48*	2650	3.4							
121	13	10.91	2550	3.8							
129	12	10.23	2500	4.0							


S..DR/DT/DV
S..D.. [kW]


P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]				
0.25	0.45	2930	2905	22200	0.85						
	0.50	2560	2586	27400	1.00						
	0.56	2300	2335	27900	1.10						
	0.63	2000	2054	28400	1.25						
	0.71	1770	1824	28800	1.40						
	0.80	1590	1631	29100	1.60						
	1.4	930	930	29700	2.7						
	1.4	1260	954	11800	1.00						
	1.6	1110	837	13100	1.10						
	1.8	930	714	14200	1.35						
	2.0	820	637	14800	1.50						
	2.3	745	574	15200	1.65						
	2.6	640	499	15600	1.95						
	2.4	650	543	6280	0.85						
	2.8	550	469	8390	1.05						
	3.1	495	424	8880	1.15						
	3.6	440	365	9320	1.30						
	4.1	380	319	9700	1.50						
	4.6	335	281	9960	1.70						
	4.4	345	294	6640	0.85						
	4.8	320	269	6870	0.95						
	5.7	275	229	7280	1.10						
	6.4	250	204	7490	1.20						
	6.9	230	187	7630	1.30						
7.9	200	165	7780	1.50							
9.9	162	131	7980	1.85							
3.1	435	217.41	9350	1.30							
3.6	390	190.11	9670	1.45							
3.8	370	180.60*	9770	1.50							
4.3	330	158.45	9980	1.70							
4.0	350	217.41	9890	1.60							
4.6	310	190.11	10100	1.80							
4.9	295	180.60*	10100	1.90							
5.5	265	158.45	10300	2.1							
6.0	245	217.41	10300	2.1							
6.8	220	190.11	10400	2.4							
7.2	210	180.60*	10500	2.5							
8.2	187	158.45	10500	2.8							
9.7	161	134.40*	10600	3.2							
11	147	121.33	10600	3.5							
12	131	106.75*	10700	4.0							
4.4	305	201.00*	7050	1.00							
4.8	285	184.80*	7230	1.05							
5.6	245	158.12	7510	1.20							
6.4	220	137.05	7690	1.35							
6.9	205	128.10*	7760	1.45							
6.5	215	201.00*	7700	1.35							
7.0	200	184.80*	7790	1.45							
8.2	176	158.12	7920	1.70							
9.5	155	137.05	8010	1.90							
10	146	128.10*	8040	2.0							
12	129	110.73	8110	2.3							
14	111	94.08*	8160	2.7							
15	101	84.00*	8190	2.9							
						S	87 R57	DR	63L4	110	579
						SF	87 R57	DR	63L4	130	579
						SA	87 R57	DR	63L4	105	579
						SAF	87 R57	DR	63L4	120	579
						S	77 R37	DR	63L4	59	579
						SF	77 R37	DR	63L4	69	579
						SA	77 R37	DR	63L4	59	579
						SAF	77 R37	DR	63L4	65	579
						S	67 R37	DR	63L4	40	579
						SF	67 R37	DR	63L4	46	579
						SA	67 R37	DR	63L4	41	579
						SAF	67 R37	DR	63L4	45	579
						S	57 R17	DR	63L4	21	579
						SF	57 R17	DR	63L4	25	579
						SA	57 R17	DR	63L4	21	579
						SAF	57 R17	DR	63L4	24	579
						S	67	DT	80N8	33	559
						SF	67	DT	80N8	40	560
						SA	67	DT	80N8	34	561
						SAF	67	DT	80N8	39	560
						S	67	DT	71D6	30	559
						SF	67	DT	71D6	37	560
						SA	67	DT	71D6	31	561
						SAF	67	DT	71D6	36	560
						S	67	DR	63L4	29	559
						SF	67	DR	63L4	35	560
						SA	67	DR	63L4	30	561
						SAF	67	DR	63L4	34	560
						S	57	DT	71D6	19	554
						SF	57	DT	71D6	23	555
						SA	57	DT	71D6	19	556
						SAF	57	DT	71D6	22	555
						S	57	DR	63L4	18	554
						SF	57	DR	63L4	22	555
						SA	57	DR	63L4	18	556
						SAF	57	DR	63L4	21	555

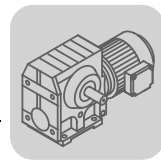



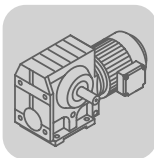
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]		
0.25	6.5	210	201.00*	5120	0.80				
	7.0	195	184.80*	5210	0.85				
	8.2	170	158.12	5340	1.00				
	9.5	150	137.05	5440	1.10				
	10	141	128.10*	5480	1.20				
	12	124	110.73	5560	1.35	S 47	DR 63L4	14	549
	14	108	94.08*	5630	1.55	SF 47	DR 63L4	18	550
	15	98	84.00*	5670	1.70	SA 47	DR 63L4	15	551
	18	85	71.75*	5720	1.95	SAF 47	DR 63L4	17	550
	19	97	69.39	5640	1.60				
	19	80	67.20*	5740	2.1				
	20	90	63.80*	5670	1.70				
	24	78	54.59	5720	2.0				
	27	68	47.32	5760	2.3				
	13	108	98.80*	3000	0.80				
	15	96	86.36	3000	0.90				
	16	91	80.96	3000	0.95				
	18	81	71.44*	3000	1.05				
	21	73	63.33	3000	1.10				
	23	78	55.93	3000	1.05				
	25	72	51.30*	3000	1.15				
	30	62	43.68	3000	1.30				
	35	54	37.66	3000	1.45				
	37	51	35.10*	3000	1.55				
	42	45	30.68	3000	1.70	S 37	DR 63L4	11	545
	45	42	28.76	3000	1.80	SF 37	DR 63L4	13	546
	51	37	25.38*	3000	2.0	SA 37	DR 63L4	11	547
	58	33	22.50*	3000	2.2	SAF 37	DR 63L4	13	546
	65	32	19.89	2870	1.65				
	71	29	18.24*	2820	1.80				
84	25	15.53	2710	2.0					
97	22	13.39	2620	2.3					
104	20	12.48*	2570	2.4					
119	18	10.91	2480	2.7					
127	17	10.23	2440	2.8					
144	15	9.02*	2360	3.1					
163	13	8.00*	2290	3.4					
191	11	6.80*	2180	3.8					
92	21	28.76	2740	3.0					
105	19	25.38*	2650	3.3					
118	17	22.50*	2560	3.4	S 37	DR 63M2	11	545	
134	16	19.89	2410	2.8	SF 37	DR 63M2	12	546	
146	15	18.24*	2350	3.0	SA 37	DR 63M2	10	547	
171	13	15.53	2250	3.4	SAF 37	DR 63M2	12	546	
199	11	13.39	2160	3.8					
213	10	12.48*	2120	4.0					
0.37	0.67	2860	2054	24500	0.90	S 87 R57	DT 71D4	110	579
	0.76	2540	1824	27400	1.00	SF 87 R57	DT 71D4	130	579
	0.85	2270	1631	28000	1.10	SA 87 R57	DT 71D4	105	579
	1.5	1340	930	29400	1.85	SAF 87 R57	DT 71D4	125	579
	1.7	1210	831	29500	2.1				
	1.9	1310	714	11300	0.95				
	2.2	1170	637	12600	1.05	S 77 R37	DT 71D4	60	579
	2.4	1060	574	13400	1.15	SF 77 R37	DT 71D4	70	579
	2.8	910	499	14300	1.35	SA 77 R37	DT 71D4	59	579
	3.1	800	438	14900	1.55	SAF 77 R37	DT 71D4	66	579
	3.6	710	389	15300	1.75				
	3.8	625	365	7560	0.90	S 67 R37	DT 71D4	41	579
	4.3	545	319	8450	1.05	SF 67 R37	DT 71D4	47	579
	4.9	480	281	9030	1.20	SA 67 R37	DT 71D4	42	579
	5.6	430	246	9380	1.30	SAF 67 R37	DT 71D4	46	579
	2.4	980	288.00*	29700	2.5	S 87	DT 90S8	95	569
	2.6	890	258.18	29800	2.8	SF 87	DT 90S8	115	570
	3.1	775	222.40*	29900	3.2	SA 87	DT 90S8	93	571
						SAF 87	DT 90S8	110	570


S..DR/DT/DV
S..D.. [kW]


P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]		
0.37	3.0	735	225.26	15200	1.75	S	77	DT	90S8	59	564	
	3.2	700	214.00*	15300	1.80	SF	77	DT	90S8	69	565	
	3.6	630	189.09	15600	2.0	SA	77	DT	90S8	59	566	
	4.2	545	161.60*	15900	2.3	SAF	77	DT	90S8	66	565	
	3.5	645	256.47	15600	2.0	S	77	DT	80K6	52	564	
	4.0	575	225.26	15800	2.2	SF	77	DT	80K6	62	565	
	4.2	545	214.00*	15900	2.3	SA	77	DT	80K6	52	566	
							SAF	77	DT	80K6	59	565
	4.1	505	217.41	8810	1.10	S	67	DT	80K6	32	559	
	4.7	450	190.11	9260	1.25	SF	67	DT	80K6	39	560	
	5.0	430	180.60*	9400	1.30	SA	67	DT	80K6	33	561	
	5.7	380	158.45	9700	1.45	SAF	67	DT	80K6	38	560	
	6.4	345	217.41	9900	1.50							
	7.3	310	190.11	10100	1.70	S	67	DT	71D4	30	559	
	7.6	295	180.60*	10200	1.75	SF	67	DT	71D4	37	560	
	8.7	260	158.45	10300	2.0	SA	67	DT	71D4	31	561	
	10	225	134.40*	10400	2.3	SAF	67	DT	71D4	36	560	
	11	205	121.33	10500	2.5							
	5.7	360	158.12	6490	0.80							
	6.6	315	137.05	6930	0.95	S	57	DT	80K6	21	554	
	7.0	300	128.10*	7100	1.00	SF	57	DT	80K6	25	555	
	8.1	265	110.73	7390	1.10	SA	57	DT	80K6	21	556	
	9.6	230	94.08*	7630	1.30	SAF	57	DT	80K6	24	555	
	11	205	84.00*	7760	1.45							
	6.9	305	201.00*	7050	0.95							
	7.5	285	184.80*	7230	1.05							
	8.7	245	158.12	7510	1.20							
	10	220	137.05	7690	1.35							
	11	205	128.10*	7770	1.45	S	57	DT	71D4	19	554	
	12	180	110.73	7900	1.65	SF	57	DT	71D4	23	555	
	15	156	94.08*	8000	1.90	SA	57	DT	71D4	19	556	
	16	141	84.00*	8060	2.1	SAF	57	DT	71D4	22	555	
	19	122	71.75*	8130	2.4							
	20	139	69.39	8070	1.75							
	21	115	67.20*	8150	2.5							
	22	128	63.80*	8110	1.90							
	10	210	137.05	5110	0.80							
	11	199	128.10*	5190	0.85							
	12	175	110.73	5320	0.95							
	15	151	94.08*	5430	1.10							
	16	137	84.00*	5500	1.20							
	19	119	71.75*	5580	1.40							
	20	136	69.39	5460	1.15							
	21	112	67.20*	5610	1.50							
22	126	63.80*	5510	1.25	S	47	DT	71D4	15	549		
25	109	54.59	5590	1.40	SF	47	DT	71D4	19	550		
29	96	47.32	5410	1.60	SA	47	DT	71D4	16	551		
31	90	44.22*	5330	1.75	SAF	47	DT	71D4	18	550		
36	78	38.23	5140	2.0								
42	67	32.48*	4930	2.3								
48	60	29.00*	4790	2.6								
56	52	24.77	4590	3.0								
59	49	23.20*	4510	3.1								
68	46	20.33	4180	2.4								
78	40	17.62	4030	2.8								
84	37	16.47*	3960	3.0								

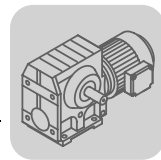



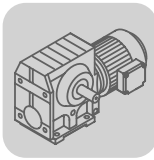
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]		
0.37	22	103	63.33	3000	0.80				
	27	101	51.30*	3000	0.80				
	32	87	43.68	3000	0.95				
	37	76	37.66	3000	1.05				
	39	71	35.10*	3000	1.10				
	45	63	30.68	3000	1.20				
	48	59	28.76	3000	1.30				
	54	52	25.38*	2940	1.40				
	61	47	22.50*	2870	1.55	S 37	DT 71D4	12	545
	69	44	19.89	2610	1.20	SF 37	DT 71D4	14	546
	76	41	18.24*	2570	1.30	SA 37	DT 71D4	12	547
	89	35	15.53	2500	1.45	SAF 37	DT 71D4	13	546
	103	30	13.39	2420	1.60				
	111	28	12.48*	2390	1.70				
	127	25	10.91	2320	1.95				
	135	23	10.23	2280	2.0				
	153	21	9.02*	2220	2.2				
	173	18	8.00*	2150	2.5				
	203	16	6.80*	2070	2.7				
	104	28	25.38*	2540	2.2				
	118	25	22.50*	2460	2.3				
	133	24	19.89	2290	1.85				
	145	22	18.24*	2250	2.0	S 37	DR 63L2	11	545
	171	19	15.53	2160	2.3	SF 37	DR 63L2	13	546
	198	16	13.39	2080	2.6	SA 37	DR 63L2	11	547
	212	15	12.48*	2040	2.7	SAF 37	DR 63L2	13	546
243	13	10.91	1970	3.0					
259	12	10.23	1940	3.1					
294	11	9.02*	1870	3.3					
0.55	1.0	2850	1332	24800	0.90				
	1.1	2570	1191	27300	0.95				
	1.3	2240	1032	28000	1.10				
	1.5	2070	930	28300	1.20	S 87 R57	DT 80K4	110	579
	1.6	1870	831	28700	1.35	SF 87 R57	DT 80K4	135	579
	1.9	1620	719	29000	1.55	SA 87 R57	DT 80K4	110	579
	2.2	1420	624	29300	1.75	SAF 87 R57	DT 80K4	125	579
	2.4	1280	558	29400	1.95				
	3.1	1020	435	29700	2.4				
	3.1	1230	438	12100	1.00	S 77 R37	DT 80K4	62	579
	3.5	1090	389	13200	1.15	SF 77 R37	DT 80K4	72	579
	4.2	920	327	14300	1.35	SA 77 R37	DT 80K4	61	579
	4.7	830	289	14800	1.50	SAF 77 R37	DT 80K4	68	579
	5.4	720	250	15300	1.70				
	5.5	660	246	5530	0.85	S 67 R37	DT 80K4	43	579
	6.2	590	221	7990	0.95	SF 67 R37	DT 80K4	49	579
	6.9	535	198	8520	1.05	SA 67 R37	DT 80K4	44	579
	8.1	460	168	9180	1.25	SAF 67 R37	DT 80K4	48	579
	2.4	1450	288.00*	29200	1.70	S 87	DT 90L8	96	569
	2.6	1320	258.18	29400	1.85	SF 87	DT 90L8	120	570
	3.1	1150	222.40*	29600	2.1	SA 87	DT 90L8	94	571
						SAF 87	DT 90L8	110	570
	3.1	1130	288.00*	29600	2.2	S 87	DT 80N6	90	569
	3.5	1020	258.18	29700	2.4	SF 87	DT 80N6	110	570
	4.0	900	222.40*	29800	2.7	SA 87	DT 80N6	88	571
	4.4	820	202.96	29800	2.9	SAF 87	DT 80N6	105	570
	3.0	1090	225.26	13200	1.15	S 77	DT 90L8	60	564
	3.2	1040	214.00*	13500	1.20	SF 77	DT 90L8	70	565
	3.6	930	189.09	14200	1.35	SA 77	DT 90L8	60	566
	4.2	810	161.60*	14900	1.55	SAF 77	DT 90L8	67	565
	3.5	960	256.47	14100	1.35	S 77	DT 80N6	54	564
	4.0	850	225.26	14700	1.50	SF 77	DT 80N6	64	565
	4.2	810	214.00*	14800	1.55	SA 77	DT 80N6	54	566
	4.8	730	189.09	15200	1.75	SAF 77	DT 80N6	61	565
	5.6	635	161.60*	15600	2.0				




S..DR/DT/DV
S..D.. [kW]

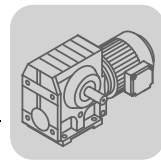
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]	
0.55	5.3	660	256.47	15500	1.90	S	77	DT	80K4	52	564
	6.0	590	225.26	15800	2.2	SF	77	DT	80K4	62	565
	6.4	560	214.00*	15800	2.3	SA	77	DT	80K4	52	566
	7.2	505	189.09	16000	2.5	SAF	77	DT	80K4	59	565
	6.3	520	217.41	8660	1.00						
	7.2	465	190.11	9150	1.10						
	7.5	445	180.60*	9300	1.15						
	8.6	395	158.45	9620	1.30	S	67	DT	80K4	32	559
	10	340	134.40*	9930	1.55	SF	67	DT	80K4	39	560
	11	310	121.33	10100	1.65	SA	67	DT	80K4	33	561
13	275	106.75*	10200	1.85	SAF	67	DT	80K4	38	560	
13	265	100.80*	10300	1.95							
16	230	85.83	10400	2.3							
18	230	75.06	10400	2.1							
21	205	65.63	10500	2.4							
9.6	340	94.08*	6710	0.85							
11	305	84.00*	7030	0.95							
13	265	71.75*	7360	1.10	S	57	DT	80N6	22	554	
13	250	67.20*	7470	1.15	SF	57	DT	80N6	26	555	
16	245	54.59	7520	1.10	SA	57	DT	80N6	22	556	
19	215	47.32	7710	1.25	SAF	57	DT	80N6	25	555	
20	200	44.22*	7790	1.35							
24	176	38.23	7920	1.55							
8.6	370	158.12	6330	0.80							
9.9	330	137.05	6820	0.90							
11	310	128.10*	7010	0.95							
12	270	110.73	7320	1.10							
14	235	94.08*	7590	1.25							
16	210	84.00*	7730	1.40							
19	184	71.75*	7880	1.55	S	57	DT	80K4	21	554	
20	174	67.20*	7930	1.65	SF	57	DT	80K4	25	555	
25	167	54.59	7960	1.45	SA	57	DT	80K4	21	556	
29	146	47.32	8040	1.70	SAF	57	DT	80K4	24	555	
31	137	44.22*	8080	1.80							
36	120	38.23	8130	2.1							
42	103	32.48*	7970	2.4							
47	92	29.00*	7730	2.7							
55	79	24.77	7390	3.1							
59	75	23.20*	7250	3.3							
67	69	20.33	6760	2.4							
16	205	84.00*	5140	0.80							
19	179	71.75*	5290	0.95							
20	169	67.20*	5350	1.00							
25	165	54.59	5130	0.95							
29	144	47.32	5010	1.10							
31	135	44.22*	4950	1.15							
36	118	38.23	4810	1.30							
42	101	32.48*	4650	1.55	S	47	DT	80K4	17	549	
47	91	29.00*	4540	1.70	SF	47	DT	80K4	21	550	
55	78	24.77	4380	2.0	SA	47	DT	80K4	18	551	
59	74	23.20*	4310	2.1	SAF	47	DT	80K4	20	550	
67	69	20.33	3920	1.60							
77	60	17.62	3810	1.85							
83	56	16.47*	3750	1.95							
96	49	14.24	3630	2.3							
112	42	12.10*	3500	2.6							
126	37	10.80*	3400	2.9							
147	32	9.23*	3270	3.4							





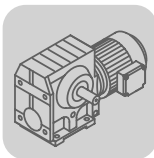
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]				
0.55	44	94	30.68	2680	0.80						
	47	89	28.76	2670	0.85						
	54	79	25.38*	2630	0.95						
	60	70	22.50*	2600	1.05						
	71	60	19.13*	2540	1.20						
	88	53	15.53	2230	0.95	S	37	DT	80K4	14	545
	102	46	13.39	2200	1.10	SF	37	DT	80K4	16	546
	109	43	12.48*	2180	1.15	SA	37	DT	80K4	14	547
	125	37	10.91	2130	1.30	SAF	37	DT	80K4	15	546
	133	35	10.23	2110	1.35						
	151	31	9.02*	2070	1.50						
	170	28	8.00*	2020	1.60						
	200	24	6.80*	1950	1.80						
	94	46	28.76	2420	1.40						
	106	41	25.38*	2360	1.50						
	120	37	22.50*	2310	1.55						
	136	34	19.89	2100	1.30						
	148	32	18.24*	2070	1.40	S	37	DT	71D2	12	545
	174	27	15.53	2010	1.55	SF	37	DT	71D2	14	546
	202	24	13.39	1950	1.75	SA	37	DT	71D2	12	547
216	22	12.48*	1920	1.85	SAF	37	DT	71D2	13	546	
248	19	10.91	1870	2.0							
264	18	10.23	1840	2.1							
299	16	9.02*	1780	2.3							
338	14	8.00*	1730	2.5							
397	12	6.80*	1660	2.4							
0.75	1.1	4910	1223	18400	0.85						
	1.3	4300	1070	29800	1.00						
	1.5	3710	928	33800	1.15	S	97 R57	DT	80N4	170	579
	1.7	3270	824	34500	1.30	SF	97 R57	DT	80N4	205	579
	1.9	2330	714	35800	1.80	SA	97 R57	DT	80N4	165	579
	2.2	2480	626	35600	1.70	SAF	97 R57	DT	80N4	195	579
	2.6	2130	538	36000	1.95						
	2.9	1930	484	36200	2.2						
	1.3	3060	1032	17400	0.80						
	1.5	2820	930	25300	0.90						
	1.7	2540	831	27400	1.00	S	87 R57	DT	80N4	110	579
	1.9	2220	719	28100	1.15	SF	87 R57	DT	80N4	135	579
	2.2	1940	624	28500	1.30	SA	87 R57	DT	80N4	110	579
	2.5	1750	558	28800	1.45	SAF	87 R57	DT	80N4	125	579
	3.2	1400	435	29300	1.75						
	4.3	1070	323	29600	2.2						
	4.2	1250	327	11900	1.00	S	77 R37	DT	80N4	63	579
	4.8	1120	289	12900	1.10	SF	77 R37	DT	80N4	73	579
	5.5	970	250	14000	1.25	SA	77 R37	DT	80N4	62	579
	6.3	860	219	14600	1.45	SAF	77 R37	DT	80N4	69	579
	2.4	2040	286.40*	36100	2.1	S	97	DV	100M8	160	574
	2.6	1890	262.22	36300	2.2	SF	97	DV	100M8	195	575
	3.0	1690	231.67	36400	2.5	SA	97	DV	100M8	155	576
						SAF	97	DV	100M8	185	575
	3.1	1540	288.00*	29100	1.60	S	87	DT	90S6	95	569
	3.5	1400	258.18	29300	1.75	SF	87	DT	90S6	115	570
	4.0	1220	222.40*	29500	1.95	SA	87	DT	90S6	93	571
	4.4	1120	202.96	29600	2.1	SAF	87	DT	90S6	110	570
	4.8	1050	288.00*	29600	2.2	S	87	DT	80N4	90	569
	5.4	950	258.18	29700	2.4	SF	87	DT	80N4	110	570
	6.2	830	222.40*	29800	2.8	SA	87	DT	80N4	88	571
	6.8	765	202.96	29900	3.0	SAF	87	DT	80N4	105	570
4.0	1160	225.26	12700	1.10	S	77	DT	90S6	59	564	
4.2	1110	214.00*	13100	1.15	SF	77	DT	90S6	69	565	
4.8	990	189.09	13900	1.30	SA	77	DT	90S6	59	566	
5.6	860	161.60*	14600	1.45	SAF	77	DT	90S6	66	565	


S..DR/DT/DV
S..D.. [kW]


P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]	
0.75	5.4	890	256.47	14500	1.45						
	6.1	790	225.26	14900	1.60						
	6.5	755	214.00*	15100	1.70						
	7.3	675	189.09	15400	1.90	S	77	DT	80N4	54	564
	8.5	585	161.60*	15800	2.2	SF	77	DT	80N4	64	565
	9.3	545	148.15	15900	2.3	SA	77	DT	80N4	54	566
	11	480	130.00*	16000	2.5	SAF	77	DT	80N4	61	565
	11	460	123.20*	16000	2.6						
	13	405	107.83	16000	2.9						
	7.3	625	190.11	7570	0.85						
	7.6	595	180.60*	7900	0.85						
	8.7	530	158.45	8570	1.00						
	10	460	134.40*	9180	1.15						
	11	420	121.33	9470	1.25	S	67	DT	80N4	33	559
	13	375	106.75*	9750	1.40	SF	67	DT	80N4	40	560
	14	355	100.80*	9860	1.45	SA	67	DT	80N4	34	561
	16	305	85.83	10100	1.70	SAF	67	DT	80N4	39	560
	18	310	75.06	10100	1.55						
	21	275	65.63	10200	1.75						
	22	260	62.35*	10300	1.85						
25	230	54.70	10300	2.1							
30	198	46.40*	9840	2.4							
13	365	71.75*	6430	0.80	S	57	DT	90S6	27	554	
13	345	67.20*	6660	0.85	SF	57	DT	90S6	31	555	
16	295	56.61	7140	1.00	SA	57	DT	90S6	27	556	
19	295	47.32	7150	0.90	SAF	57	DT	90S6	30	555	
20	275	44.22*	7300	1.00							
12	365	110.73	6400	0.80							
15	315	94.08*	6930	0.95							
16	285	84.00*	7210	1.05							
19	250	71.75*	7500	1.15							
21	235	67.20*	7590	1.20							
25	225	54.59	7650	1.10							
29	197	47.32	7810	1.25	S	57	DT	80N4	22	554	
31	185	44.22*	7870	1.35	SF	57	DT	80N4	26	555	
36	161	38.23	7980	1.50	SA	57	DT	80N4	22	556	
42	138	32.48*	7670	1.80	SAF	57	DT	80N4	25	555	
48	124	29.00*	7450	2.0							
56	107	24.77	7150	2.3							
59	100	23.20*	7030	2.5							
68	93	20.33	6490	1.80							
78	81	17.62	6260	2.1							
84	76	16.47*	6160	2.2							
97	66	14.24	5930	2.6							
29	194	47.32	4530	0.80	S	47	DT	80N4	18	549	
31	182	44.22*	4500	0.85	SF	47	DT	80N4	22	550	
36	159	38.23	4420	1.00	SA	47	DT	80N4	19	551	
42	136	32.48*	4310	1.15	SAF	47	DT	80N4	21	550	
48	122	29.00*	4230	1.25							
56	106	24.77	4110	1.45							
59	99	23.20*	4060	1.55							
68	93	20.33	3610	1.20							
78	81	17.62	3530	1.35	S	47	DT	80N4	18	549	
84	76	16.47*	3490	1.45	SF	47	DT	80N4	22	550	
97	66	14.24	3410	1.65	SA	47	DT	80N4	19	551	
114	56	12.10*	3300	1.95	SAF	47	DT	80N4	21	550	
128	50	10.80*	3230	2.2							
150	43	9.23*	3120	2.5							
160	41	8.64*	3070	2.7							
190	34	7.28	2950	3.0							
72	81	19.13*	2270	0.85							
111	57	12.48*	1930	0.85	S	37	DT	80N4	15	545	
127	50	10.91	1920	0.95	SF	37	DT	80N4	17	546	
135	47	10.23	1910	1.00	SA	37	DT	80N4	15	547	
153	42	9.02*	1890	1.10	SAF	37	DT	80N4	16	546	
173	37	8.00*	1860	1.20							
203	32	6.80*	1820	1.35							

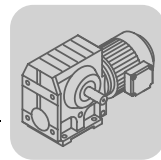


P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]		
0.75	141	43	19.13*	2090	1.05				
	174	37	15.53	1860	1.15				
	202	32	13.39	1820	1.30				
	216	30	12.48*	1800	1.35	S 37	DT 80K2	14	545
	248	26	10.91	1760	1.50	SF 37	DT 80K2	16	546
	264	25	10.23	1740	1.55	SA 37	DT 80K2	14	547
	299	22	9.02*	1690	1.65	SAF 37	DT 80K2	15	546
	338	19	8.00*	1650	1.80				
397	17	6.80*	1590	1.75					
1.1	1.7	4780	824	22300	0.90				
	2.0	3410	714	34300	1.25	S 97 R57	DT 90S4	175	579
	2.2	3630	626	33900	1.15	SF 97 R57	DT 90S4	210	579
	2.6	3120	538	34800	1.35	SA 97 R57	DT 90S4	170	579
	2.9	2820	484	35200	1.50	SAF 97 R57	DT 90S4	200	579
	3.3	2450	420	35700	1.70				
	2.2	2840	624	24800	0.90				
	2.5	2570	558	27300	0.95				
	2.9	2260	485	28000	1.10				
	3.2	2060	435	28300	1.20	S 87 R57	DT 90S4	115	579
	3.7	1810	378	28700	1.35	SF 87 R57	DT 90S4	140	579
	4.3	1570	323	29100	1.55	SA 87 R57	DT 90S4	115	579
	5.0	1380	281	29300	1.75	SAF 87 R57	DT 90S4	130	579
	5.5	1480	255	29200	1.35				
	6.3	1300	222	29400	1.55				
	6.8	1210	205	29500	1.65				
	6.4	1250	219	11800	1.00	S 77 R37	DT 90S4	68	579
						SF 77 R37	DT 90S4	78	579
						SA 77 R37	DT 90S4	68	579
						SAF 77 R37	DT 90S4	74	579
	2.3	3080	286.40*	34800	1.35	S 97	DV 100L8	165	574
	2.6	2840	262.22	35200	1.50	SF 97	DV 100L8	200	575
	2.9	2540	231.67	35600	1.65	SA 97	DV 100L8	160	576
	3.4	2190	196.52	36000	1.90	SAF 97	DV 100L8	185	575
	3.2	2310	286.40*	35900	1.80	S 97	DT 90L6	155	574
	3.5	2130	262.22	36000	1.95	SF 97	DT 90L6	185	575
	4.0	1900	231.67	36300	2.2	SA 97	DT 90L6	150	576
						SAF 97	DT 90L6	175	575
	3.2	2220	288.00*	28100	1.10	S 87	DT 90L6	96	569
	3.6	2010	258.18	28400	1.20	SF 87	DT 90L6	120	570
	4.1	1760	222.40*	28800	1.35	SA 87	DT 90L6	94	571
	4.5	1620	202.96	29000	1.45	SAF 87	DT 90L6	110	570
	4.9	1520	288.00*	29100	1.50				
	5.4	1370	258.18	29300	1.65	S 87	DT 90S4	95	569
	6.3	1200	222.40*	29500	1.90	SF 87	DT 90S4	115	570
	6.9	1100	202.96	29600	2.1	SA 87	DT 90S4	93	571
	7.8	990	180.00*	29700	2.2	SAF 87	DT 90S4	110	570
	9.2	840	151.30	29800	2.6				
	6.2	1150	225.26	12800	1.10				
	6.5	1100	214.00*	13200	1.15				
	7.4	980	189.09	13900	1.30				
	8.7	850	161.60*	14700	1.50	S 77	DT 90S4	59	564
9.5	785	148.15	15000	1.60	SF 77	DT 90S4	69	565	
11	695	130.00*	15400	1.75	SA 77	DT 90S4	59	566	
11	665	123.20*	15500	1.80	SAF 77	DT 90S4	66	565	
13	585	107.83	15800	2.0					
14	535	97.14	15900	2.1					
16	470	85.22	16000	2.3					




S..DR/DT/DV
S..D.. [kW]

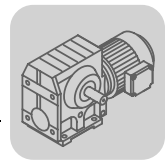
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]	
1.1	12	605	121.33	7790	0.85						
	13	540	106.75*	8490	0.95						
	14	515	100.80*	8740	1.00						
	16	445	85.83	9300	1.15						
	18	405	78.00*	9550	1.30						
	21	400	65.63	9610	1.20	S	67	DT	90S4	39	559
	22	380	62.35*	9720	1.25	SF	67	DT	90S4	45	560
	26	335	54.70	9560	1.45	SA	67	DT	90S4	40	561
	30	285	46.40*	9240	1.65	SAF	67	DT	90S4	44	560
	33	260	41.89	9040	1.85						
	38	230	36.85	8780	2.1						
	40	220	34.80*	8660	2.2						
	47	187	29.63	8330	2.6						
	20	360	71.75*	6480	0.80	S	57	DT	90S4	27	554
	21	340	67.20*	6710	0.85	SF	57	DT	90S4	31	555
	25	290	56.61	7180	0.90	SA	57	DT	90S4	27	556
	30	285	47.32	7220	0.85	SAF	57	DT	90S4	30	555
	32	265	44.22*	7360	0.90						
	37	235	38.23	7410	1.05						
	43	200	32.48*	7170	1.25						
	48	179	29.00*	7000	1.35						
	57	154	24.77	6760	1.60	S	57	DT	90S4	27	554
	60	145	23.20*	6660	1.70	SF	57	DT	90S4	31	555
	72	123	19.54	6390	1.75	SA	57	DT	90S4	27	556
	79	117	17.62	5870	1.45	SAF	57	DT	90S4	30	555
	85	110	16.47*	5780	1.55						
	98	95	14.24	5610	1.75						
	116	82	12.10*	5400	2.1						
	130	73	10.80*	5260	2.3						
	152	63	9.23*	5050	2.7						
	48	177	29.00*	3720	0.90						
	57	153	24.77	3670	1.00	S	47	DT	90S4	24	549
	60	143	23.20*	3640	1.05	SF	47	DT	90S4	27	550
	72	122	19.54	3560	1.20	SA	47	DT	90S4	25	551
	79	117	17.62	3070	0.95	SAF	47	DT	90S4	26	550
	85	109	16.47*	3060	1.00						
	98	95	14.24	3030	1.15						
	116	81	12.10*	2980	1.35	S	47	DT	90S4	24	549
	130	73	10.80*	2940	1.50	SF	47	DT	90S4	27	550
	152	63	9.23*	2870	1.75	SA	47	DT	90S4	25	551
	162	59	8.64*	2840	1.85	SAF	47	DT	90S4	26	550
	192	50	7.28	2750	2.1						
	175	54	8.00*	1570	0.85	S	37	DT	90S4	20	545
	206	46	6.80*	1580	0.95	SF	37	DT	90S4	22	546
						SA	37	DT	90S4	20	547
						SAF	37	DT	90S4	22	546
	202	47	13.39	1590	0.85						
216	44	12.48*	1580	0.90	S	37	DT	80N2	15	545	
248	39	10.91	1570	1.00	SF	37	DT	80N2	17	546	
264	36	10.23	1560	1.05	SA	37	DT	80N2	15	547	
299	32	9.02*	1540	1.10	SAF	37	DT	80N2	16	546	
338	28	8.00*	1510	1.25							
397	24	6.80*	1470	1.20							
1.5	2.0	4640	714	28400	0.90						
	2.2	4950	626	16200	0.85	S	97 R57	DT	90L4	180	579
	2.6	4260	538	30500	1.00	SF	97 R57	DT	90L4	210	579
	2.9	3850	484	33500	1.10	SA	97 R57	DT	90L4	175	579
	3.4	3350	420	34400	1.25	SAF	97 R57	DT	90L4	200	579
	3.8	3030	376	34900	1.40						
	4.3	2660	327	35400	1.60						
	2.9	3090	485	15900	0.80						
	3.2	2810	435	25500	0.85						
	3.7	2470	378	27600	1.00	S	87 R57	DT	90L4	120	579
	4.4	2150	323	28200	1.10	SF	87 R57	DT	90L4	140	579
	5.0	1890	281	28600	1.25	SA	87 R57	DT	90L4	115	579
	5.5	2020	255	28400	1.00	SAF	87 R57	DT	90L4	135	579
	6.4	1770	222	28800	1.10						
	6.9	1650	205	28900	1.20						

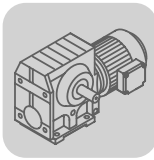



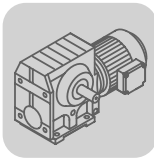
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]	
1.5	2.4	4030	286.40*	33100	1.05	S	97	DV	112M8	175	574
	2.7	3720	262.22	33700	1.15	SF	97	DV	112M8	205	575
	3.0	3330	231.67	34400	1.25	SA	97	DV	112M8	170	576
	3.6	2870	196.52	35200	1.45	SAF	97	DV	112M8	195	575
	3.2	3150	286.40*	34700	1.35	S	97	DV	100M6	160	574
	3.5	2910	262.22	35100	1.45	SF	97	DV	100M6	195	575
	4.0	2600	231.67	35500	1.60	SA	97	DV	100M6	155	576
	4.7	2230	196.52	35900	1.90	SAF	97	DV	100M6	185	575
	4.9	2130	286.40*	36000	1.90	S	97	DT	90L4	155	574
	5.4	1970	262.22	36200	2.0	SF	97	DT	90L4	185	575
	6.1	1760	231.67	36400	2.3	SA	97	DT	90L4	150	576
	7.2	1510	196.52	36600	2.7	SAF	97	DT	90L4	175	575
	3.6	2740	258.18	26600	0.90	S	87	DV	100M6	105	569
	4.1	2390	222.40*	27700	1.00	SF	87	DV	100M6	125	570
	4.5	2200	202.96	28100	1.10	SA	87	DV	100M6	100	571
	5.1	1980	180.00*	28500	1.20	SAF	87	DV	100M6	120	570
	4.9	2060	288.00*	28300	1.10						
	5.5	1860	258.18	28700	1.20						
	6.3	1630	222.40*	29000	1.40						
	7.0	1500	202.96	29200	1.50	S	87	DT	90L4	96	569
	7.8	1340	180.00*	29400	1.65	SF	87	DT	90L4	120	570
	9.3	1140	151.30	29600	1.90	SA	87	DT	90L4	94	571
	10	1060	139.05	29600	2.0	SAF	87	DT	90L4	110	570
	11	950	123.48	29700	2.2						
	13	850	110.40*	29800	2.4						
	14	770	99.26	29900	2.5						
	7.5	1330	189.09	10600	0.95						
	8.7	1150	161.60*	12700	1.10						
	9.5	1060	148.15	13400	1.15						
	11	940	130.00*	14100	1.30						
	11	900	123.20*	14400	1.35						
	13	795	107.83	14900	1.45						
	15	725	97.14	15300	1.60	S	77	DT	90L4	60	564
	17	640	85.22	15400	1.70	SF	77	DT	90L4	70	565
	19	650	75.09	14100	1.70	SA	77	DT	90L4	60	566
	20	620	71.33	14000	1.80	SAF	77	DT	90L4	67	565
	21	510	66.67	14600	2.0						
	22	550	63.03	13700	2.0						
	25	440	56.92	14000	2.3						
	26	470	53.87	13200	2.3						
	29	435	49.38	13000	2.5						
	33	385	43.33	12600	2.9						
	16	600	85.83	7850	0.85	S	67	DT	90L4	41	559
	18	550	78.00*	8390	0.95	SF	67	DT	90L4	47	560
	21	540	65.63	8510	0.90	SA	67	DT	90L4	42	561
						SAF	67	DT	90L4	46	560
	23	515	62.35*	8740	0.95						
	26	455	54.70	8810	1.05						
30	390	46.40*	8590	1.25							
34	355	41.89	8450	1.35							
38	310	36.85	8250	1.55							
41	295	34.80*	8160	1.60	S	67	DT	90L4	41	559	
48	255	29.63	7900	1.90	SF	67	DT	90L4	47	560	
52	230	26.93	7740	2.1	SA	67	DT	90L4	42	561	
58	220	24.44	7000	1.55	SAF	67	DT	90L4	46	560	
61	210	23.22*	6950	1.60							
69	186	20.37	6790	1.85							
82	159	17.28*	6580	2.1							
90	144	15.60*	6440	2.4							
103	127	13.73*	6260	2.7							




S..DR/DT/DV
S..D.. [kW]

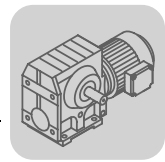
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]	
1.5	43	270	32.48*	6630	0.90						
	49	245	29.00*	6520	1.00						
	57	210	24.77	6340	1.15						
	61	196	23.20*	6270	1.25	S	57	DT	90L4	29	554
	72	167	19.54	6060	1.30	SF	57	DT	90L4	32	555
	80	159	17.62	5430	1.05	SA	57	DT	90L4	28	556
	86	149	16.47*	5380	1.15	SAF	57	DT	90L4	31	555
	99	129	14.24	5250	1.30						
	117	110	12.10*	5100	1.55						
	131	99	10.80*	4980	1.70						
	153	85	9.23*	4820	2.0						
	99	129	14.24	2610	0.85	S	47	DT	90L4	25	549
	117	110	12.10*	2620	1.00	SF	47	DT	90L4	28	550
	131	99	10.80*	2620	1.10	SA	47	DT	90L4	26	551
						SAF	47	DT	90L4	28	550
	153	85	9.23*	2590	1.30	S	47	DT	90L4	25	549
	163	79	8.64*	2580	1.35	SF	47	DT	90L4	28	550
	194	67	7.28	2530	1.55	SA	47	DT	90L4	26	551
						SAF	47	DT	90L4	28	550
	310	42	9.02*	1350	0.85	S	37	DT	90S2	20	545
350	37	8.00*	1350	0.95	SF	37	DT	90S2	22	546	
412	32	6.80*	1330	0.90	SA	37	DT	90S2	20	547	
					SAF	37	DT	90S2	22	546	
2.2	3.4	4950	420	16300	0.85	S	97 R57	DV	100M4	185	579
	3.8	4460	376	27600	0.95	SF	97 R57	DV	100M4	220	579
	4.3	3910	327	33400	1.05	SA	97 R57	DV	100M4	180	579
	4.9	3460	287	34200	1.20	SAF	97 R57	DV	100M4	205	579
	5.6	3030	252	34900	1.40						
	3.3	4530	286.40*	30200	0.95	S	97	DV	112M6	175	574
	3.6	4180	262.22	32800	1.00	SF	97	DV	112M6	205	575
	4.1	3730	231.67	33700	1.15	SA	97	DV	112M6	170	576
	4.8	3210	196.52	34600	1.30	SAF	97	DV	112M6	195	575
	4.9	3130	286.40*	34800	1.30						
	5.4	2890	262.22	35100	1.40						
	6.1	2570	231.67	35500	1.55						
	7.2	2210	196.52	36000	1.80	S	97	DV	100M4	160	574
	7.8	2050	180.95	36100	1.90	SF	97	DV	100M4	195	575
	8.7	1840	161.74	36300	2.1	SA	97	DV	100M4	155	576
	9.7	1670	145.60*	36500	2.2	SAF	97	DV	100M4	185	575
	11	1520	131.85	36600	2.4						
	12	1360	116.92	36700	2.6						
	13	1240	105.71	36800	2.8						
	16	1060	89.60*	36900	3.1						
	5.5	2730	258.18	26800	0.85						
	6.3	2380	222.40*	27700	0.95						
	7.0	2190	202.96	28100	1.05						
	7.8	1970	180.00*	28500	1.10						
	9.3	1680	151.30	28900	1.30						
	10	1550	139.05	29100	1.35	S	87	DV	100M4	105	569
	11	1390	123.48	29300	1.50	SF	87	DV	100M4	125	570
	13	1250	110.40*	29500	1.60	SA	87	DV	100M4	100	571
	14	1130	99.26	29600	1.75	SAF	87	DV	100M4	120	570
	16	990	86.15	29700	1.90						
17	1060	81.76	29600	1.50							
18	890	77.14	29800	2.0							
20	920	70.43	29700	1.75							
22	840	64.27	29800	1.90							
25	750	57.00*	29900	2.1							





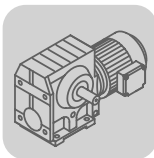
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]		
2.2	11	1390	130.00*	6140	0.85				
	11	1320	123.20*	11100	0.90				
	13	1170	107.83	12600	1.00				
	15	1060	97.14	13400	1.10				
	17	940	85.22	14100	1.15				
	19	840	75.20*	13800	1.30				
	21	745	66.67	13500	1.40				
	22	810	63.03	12400	1.35				
	25	645	56.92	13100	1.55	S 77	DV 100M4	67	564
	26	695	53.87	12100	1.60	SF 77	DV 100M4	77	565
	29	635	49.38	11900	1.75	SA 77	DV 100M4	67	566
	33	560	43.33	11700	1.95	SAF 77	DV 100M4	74	565
	34	535	41.07	11600	2.1				
	39	470	35.94	11300	2.3				
	44	425	32.38	11000	2.6				
	50	375	28.41	10700	2.8				
	56	330	25.07	10400	3.1				
	62	310	22.89	9490	2.3				
	67	285	20.99	9340	2.5				
	30	570	46.40*	7480	0.85				
	34	515	41.89	7440	0.95				
	38	460	36.85	7360	1.05				
	41	435	34.80*	7320	1.10				
	48	370	29.63	7180	1.30				
	52	340	26.93	7080	1.40				
	60	295	23.33	6920	1.60	S 67	DV 100M4	48	559
	69	275	20.37	6060	1.25	SF 67	DV 100M4	54	560
	82	235	17.28*	5960	1.45	SA 67	DV 100M4	49	561
	90	210	15.60*	5880	1.60	SAF 67	DV 100M4	53	560
	103	186	13.73*	5770	1.85				
	109	176	12.96*	5710	1.95				
	128	151	11.03	5550	2.3				
	141	137	10.03	5450	2.5				
162	119	8.69	5300	2.8					
99	190	14.24	4640	0.90					
117	162	12.10*	4580	1.05	S 57	DV 100M4	35	554	
131	145	10.80*	4520	1.15	SF 57	DV 100M4	39	555	
153	124	9.23*	4420	1.35	SA 57	DV 100M4	35	556	
163	117	8.64*	4380	1.40	SAF 57	DV 100M4	38	555	
194	99	7.28	4250	1.50					
3.0	4.9	4760	287	22900	0.90	S 97 R57	DV 100L4	190	579
	5.6	4180	252	31900	1.00	SF 97 R57	DV 100L4	225	579
	6.4	3650	219	33900	1.15	SA 97 R57	DV 100L4	185	579
	6.8	3440	205	34300	1.20	SAF 97 R57	DV 100L4	210	579
	4.9	4290	286.40*	32600	0.95				
	5.3	3960	262.22	33300	1.00				
	6.0	3530	231.67	34100	1.15				
	7.1	3040	196.52	34900	1.30				
	7.7	2810	180.95	35200	1.40	S 97	DV 100L4	165	574
	8.7	2530	161.74	35600	1.50	SF 97	DV 100L4	200	575
	9.6	2300	145.60*	35900	1.65	SA 97	DV 100L4	160	576
	11	2090	131.85	36100	1.75	SAF 97	DV 100L4	185	575
	12	1870	116.92	36300	1.90				
	13	1700	105.71	36400	2.0				
	16	1450	89.60*	36600	2.2				
	17	1470	80.85	36600	2.2				


S..DR/DT/DV
S..D.. [kW]


P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]				
3.0	7.8	2700	180.00*	27100	0.80						
	9.2	2300	151.30	27900	0.95						
	10	2130	139.05	28200	1.00						
	11	1900	123.48	28600	1.10						
	13	1720	110.40*	28900	1.15						
	14	1550	99.26	29100	1.25						
	16	1360	86.15	29300	1.40	S	87	DV	100L4	110	569
	17	1460	81.76	29200	1.10	SF	87	DV	100L4	130	570
	18	1230	77.14	29500	1.50	SA	87	DV	100L4	105	571
	20	1260	70.43	29400	1.25	SAF	87	DV	100L4	120	570
	22	1160	64.27	29500	1.40						
	25	1030	57.00*	29700	1.55						
	29	870	47.91	29800	1.85						
	32	800	44.03	29800	2.0						
	36	715	39.10	29900	2.2						
	40	640	34.96*	29900	2.5						
	16	1290	85.22	11500	0.85	S	77	DV	100L4	71	564
	19	1150	75.20*	12500	0.95	SF	77	DV	100L4	81	565
	21	1020	66.67	12400	1.00	SA	77	DV	100L4	71	566
	22	1110	63.03	10900	1.00	SAF	77	DV	100L4	78	565
	25	880	56.92	12100	1.10						
	26	950	53.87	10800	1.15						
	28	880	49.38	10800	1.25						
	32	770	43.33	10700	1.40						
	34	735	41.07	10600	1.50						
	39	645	35.94	10400	1.70						
	43	585	32.38	10300	1.85	S	77	DV	100L4	71	564
	49	515	28.41	10100	2.0	SF	77	DV	100L4	81	565
	56	455	25.07	9840	2.2	SA	77	DV	100L4	71	566
	61	430	22.89	8680	1.65	SAF	77	DV	100L4	78	565
	67	395	20.99	8590	1.80						
	76	345	18.42	8450	2.0						
	80	330	17.45	8390	2.2						
	92	290	15.28	8210	2.5						
	102	260	13.76	8060	2.7						
	116	230	12.07	7870	3.1						
	131	205	10.65	7670	3.6						
	40	595	34.80*	6350	0.80	S	67	DV	100L4	52	559
	47	510	29.63	6350	0.95	SF	67	DV	100L4	58	560
	52	465	26.93	6330	1.05	SA	67	DV	100L4	53	561
					SAF	67	DV	100L4	57	560	
60	405	23.33	6270	1.20							
69	375	20.37	5230	0.90							
81	320	17.28*	5250	1.05							
90	290	15.60*	5240	1.15	S	67	DV	100L4	52	559	
102	255	13.73*	5210	1.35	SF	67	DV	100L4	58	560	
108	240	12.96*	5190	1.40	SA	67	DV	100L4	53	561	
127	205	11.03	5100	1.65	SAF	67	DV	100L4	57	560	
140	188	10.03	5050	1.80							
161	164	8.69	4940	2.1							
185	143	7.56*	4830	2.1							
130	199	10.80*	3990	0.85	S	57	DV	100L4	39	554	
152	171	9.23*	3970	1.00	SF	57	DV	100L4	43	555	
162	160	8.64*	3960	1.05	SA	57	DV	100L4	39	556	
192	136	7.28	3900	1.10	SAF	57	DV	100L4	42	555	
4.0	6.5	4820	219	21900	0.85	S	97 R57	DV	112M4	195	579
	6.9	4530	205	26700	0.95	SF	97 R57	DV	112M4	230	579
						SA	97 R57	DV	112M4	190	579
						SAF	97 R57	DV	112M4	220	579

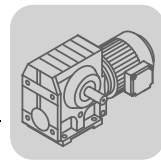



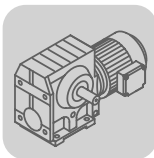
P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B		m [kg]				
4.0	6.1	4650	231.67	28300	0.85						
	7.2	3990	196.52	33200	1.00						
	7.9	3700	180.95	33800	1.05						
	8.8	3330	161.74	34400	1.15						
	9.8	3020	145.60*	34900	1.25						
	11	2750	131.85	35300	1.35	S	97	DV	112M4	175	574
	12	2460	116.92	35700	1.45	SF	97	DV	112M4	205	575
	13	2230	105.71	35900	1.55	SA	97	DV	112M4	170	576
	16	1910	89.60*	36300	1.70	SAF	97	DV	112M4	195	575
	18	1940	80.85	36200	1.65						
	20	1720	71.43	36400	1.90						
	23	1470	60.59	36600	2.3						
	25	1350	55.79	36700	2.4						
	12	2510	123.48	27500	0.80						
	13	2260	110.40*	28000	0.90						
	14	2040	99.26	28400	0.95						
	16	1790	86.15	28800	1.05						
	18	1610	77.14	29000	1.15						
	20	1660	70.43	28900	0.95	S	87	DV	112M4	115	569
	22	1520	64.27	29100	1.05	SF	87	DV	112M4	135	570
	25	1350	57.00*	29300	1.20	SA	87	DV	112M4	110	571
	30	1150	47.91	29500	1.40	SAF	87	DV	112M4	125	570
	32	1060	44.03	29600	1.50						
	36	940	39.10	29700	1.70						
	41	840	34.96*	29800	1.90						
	45	760	31.43	29100	2.1						
	52	665	27.28	28200	2.4						
	56	635	25.50*	26600	1.95						
	25	1160	56.92	10800	0.85	S	77	DV	112M4	77	564
	26	1250	53.87	9250	0.90	SF	77	DV	112M4	87	565
	29	1150	49.38	9320	0.95	SA	77	DV	112M4	77	566
	33	1020	43.33	9370	1.10	SAF	77	DV	112M4	84	565
	35	960	41.07	9370	1.15						
	40	850	35.94	9340	1.30						
	44	765	32.38	9290	1.40						
	50	675	28.41	9190	1.55						
	57	600	25.07	9070	1.70						
	62	565	22.89	7650	1.25	S	77	DV	112M4	77	564
	68	520	20.99	7650	1.35	SF	77	DV	112M4	87	565
	77	455	18.42	7620	1.55	SA	77	DV	112M4	77	566
	81	435	17.45	7590	1.65	SAF	77	DV	112M4	84	565
	93	380	15.28	7510	1.85						
	103	345	13.76	7430	2.1						
	118	300	12.07	7310	2.4						
	133	265	10.65	7170	2.7						
150	235	9.44	7030	3.1							
176	205	8.06	6830	3.4							
82	420	17.28*	3810	0.80							
91	380	15.60*	4180	0.90							
103	335	13.73*	4500	1.00	S	67	DV	112M4	59	559	
110	320	12.96*	4520	1.05	SF	67	DV	112M4	65	560	
129	270	11.03	4530	1.25	SA	67	DV	112M4	60	561	
142	245	10.03	4520	1.35	SAF	67	DV	112M4	64	560	
163	215	8.69	4490	1.55							
188	188	7.56*	4430	1.55							
5.5	8.8	4550	161.74	29900	0.85						
	9.8	4130	145.60*	32900	0.90						
	11	3760	131.85	33700	0.95						
	12	3360	116.92	34400	1.05						
	14	3050	105.71	34900	1.15						
	16	2610	89.60*	35500	1.25	S	97	DV	132S4	180	574
	18	2290	78.26	35900	1.35	SF	97	DV	132S4	210	575
	20	2350	71.43	35800	1.40	SA	97	DV	132S4	175	576
	22	1930	65.45	36200	1.50	SAF	97	DV	132S4	200	575
	24	2000	60.59	36200	1.65						
	26	1850	55.79	36300	1.80						
	29	1660	49.87	36500	2.0						
	32	1500	44.89	36600	2.2						
	35	1360	40.65	36700	2.4						


S..DR/DT/DV
S..D.. [kW]


P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]	
5.5	19	2200	77.14	28100	0.85	S	87	DV	132S4	120	569
	22	1850	64.00*	28700	0.90	SF	87	DV	132S4	140	570
	25	1850	57.00*	28700	0.85	SA	87	DV	132S4	115	571
	30	1560	47.91	29100	1.00	SAF	87	DV	132S4	135	570
	32	1440	44.03	29200	1.10						
	37	1280	39.10	29200	1.25						
	41	1150	34.96*	28600	1.40						
	45	1040	31.43	28000	1.55						
	52	910	27.28	27200	1.75						
	56	870	25.50*	25200	1.45	S	87	DV	132S4	120	569
	67	730	21.43	24500	1.70	SF	87	DV	132S4	140	570
	73	675	19.70	24100	1.85	SA	87	DV	132S4	115	571
	82	600	17.49	23500	2.1	SAF	87	DV	132S4	135	570
	91	535	15.64*	23000	2.3						
	102	485	14.06	22500	2.6						
	117	420	12.21	21800	3.0						
	131	375	10.93	21200	3.3						
	35	1320	41.07	7560	0.85	S	77	DV	132S4	84	564
	40	1160	35.94	7750	0.95	SF	77	DV	132S4	94	565
	44	1050	32.38	7850	1.05	SA	77	DV	132S4	84	566
						SAF	77	DV	132S4	91	565
	50	920	28.41	7920	1.15						
	57	820	25.07	7940	1.25						
	64	725	22.22	7920	1.35						
	78	625	18.42	5920	1.15						
	82	590	17.45	6170	1.20	S	77	DV	132S4	84	564
	94	520	15.28	6490	1.35	SF	77	DV	132S4	94	565
	104	470	13.76	6510	1.50	SA	77	DV	132S4	84	566
	118	410	12.07	6500	1.75	SAF	77	DV	132S4	91	565
	134	365	10.65	6450	2.0						
	151	325	9.44	6390	2.2						
	177	275	8.06	6280	2.5						
	130	370	11.03	2930	0.90	S	67	DV	132S4	64	559
	143	340	10.03	3260	1.00	SF	67	DV	132S4	70	560
165	295	8.69	3670	1.15	SA	67	DV	132S4	65	561	
189	255	7.56*	3850	1.15	SAF	67	DV	132S4	69	560	
7.5	14	4160	105.71	32900	0.85						
	16	3560	89.60*	34100	0.90						
	18	3130	78.26	34800	1.00						
	20	3200	71.43	34600	1.05						
	22	2630	65.45	35500	1.10						
	24	2730	60.59	35300	1.20						
	26	2520	55.79	35600	1.30						
	29	2260	49.87	35900	1.45	S	97	DV	132M4	200	574
	32	2040	44.89	36100	1.60	SF	97	DV	132M4	230	575
	35	1850	40.65	36300	1.80	SA	97	DV	132M4	195	576
	40	1650	36.05	36200	2.0	SAF	97	DV	132M4	220	575
	44	1490	32.60	35500	2.2						
	54	1240	26.39	32000	2.1						
	61	1110	23.59	31400	2.3						
	67	1000	21.23	30700	2.6						
	74	910	19.23	30100	2.9						
	32	1970	44.03	27800	0.80	S	87	DV	132M4	140	569
	37	1750	39.10	27400	0.90	SF	87	DV	132M4	165	570
	41	1570	34.96*	27000	1.00	SA	87	DV	132M4	140	571
						SAF	87	DV	132M4	155	570
	45	1420	31.43	26500	1.15						
	52	1230	27.28	25900	1.30						
	56	1180	25.50*	23500	1.05						
	67	1000	21.43	23000	1.25						
	73	920	19.70	22700	1.35	S	87	DV	132M4	140	569
	82	820	17.49	22300	1.50	SF	87	DV	132M4	165	570
	91	730	15.64*	21900	1.70	SA	87	DV	132M4	140	571
	102	660	14.06	21500	1.90	SAF	87	DV	132M4	155	570
	117	575	12.21	20900	2.2						
	131	515	10.93	20500	2.4						
	158	430	9.07	19700	2.7						
	181	375	7.88	19100	2.7						

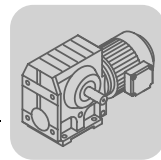



P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]		
7.5	50	1260	28.41	6240	0.85	S	77	DV	132M4	105	564	
	57	1110	25.07	6450	0.90	SF	77	DV	132M4	115	565	
	64	990	22.22	6600	1.00	SA	77	DV	132M4	105	566	
	78	850	18.42	1860	0.85	SAF	77	DV	132M4	110	565	
	82	810	17.45	2290	0.90							
	94	705	15.28	3250	1.00							
	104	640	13.76	3890	1.10	S	77	DV	132M4	105	564	
	118	560	12.07	4570	1.30	SF	77	DV	132M4	115	565	
	134	495	10.65	5110	1.45	SA	77	DV	132M4	105	566	
	151	440	9.44	5540	1.65	SAF	77	DV	132M4	110	565	
	177	380	8.06	5560	1.80							
	9.2	18	3810	78.26	33600	0.80	S	97	DV	132ML4	210	574
		22	3210	65.45	34600	0.90	SF	97	DV	132ML4	240	575
		26	3070	55.79	34800	1.05	SA	97	DV	132ML4	205	576
						SAF	97	DV	132ML4	230	575	
29		2750	49.87	35300	1.20							
32		2480	44.89	35600	1.35							
35		2260	40.65	35700	1.45							
40		2010	36.05	35000	1.65							
44		1820	32.60	34400	1.75							
55		1510	26.39	30700	1.70	S	97	DV	132ML4	210	574	
61		1350	23.59	30200	1.90	SF	97	DV	132ML4	240	575	
68		1220	21.23	29700	2.1	SA	97	DV	132ML4	205	576	
75		1110	19.23	29200	2.4	SAF	97	DV	132ML4	230	575	
84		980	17.05	28500	2.6							
93		890	15.42	28000	2.8							
110		755	13.07	27000	3.1							
126		660	11.41	26200	3.3							
41		1910	34.96*	25600	0.85	S	87	DV	132ML4	150	569	
46		1730	31.43	25300	0.95	SF	87	DV	132ML4	170	570	
53		1500	27.28	24800	1.05	SA	87	DV	132ML4	150	571	
59		1350	24.43	24400	1.20	SAF	87	DV	132ML4	165	570	
71		1120	20.27	23700	1.40							
73		1120	19.70	21600	1.10							
82		1000	17.49	21300	1.25							
92		890	15.64*	21000	1.40	S	87	DV	132ML4	150	569	
102		800	14.06	20700	1.55	SF	87	DV	132ML4	170	570	
118		700	12.21	20200	1.75	SA	87	DV	132ML4	150	571	
132		625	10.93	19800	2.0	SAF	87	DV	132ML4	165	570	
159		520	9.07	19100	2.2							
183		455	7.88	18600	2.2							
76		1040	18.97	5760	0.90							
105		780	13.76	1350	0.90	S	77	DV	132ML4	115	564	
119	685	12.07	2290	1.05	SF	77	DV	132ML4	125	565		
135	605	10.65	3060	1.20	SA	77	DV	132ML4	115	566		
152	535	9.44	3690	1.35	SAF	77	DV	132ML4	120	565		
179	460	8.06	4360	1.50								
11.0	26	3670	55.79	33800	0.90							
	29	3290	49.87	34500	1.00							
	32	2970	44.89	34800	1.10							
	35	2700	40.65	34400	1.20							
	40	2400	36.05	33800	1.40							
	44	2170	32.60	33300	1.45	S	97	DV	160M4	215	574	
	55	1810	26.39	29400	1.45	SF	97	DV	160M4	245	575	
	61	1620	23.59	29000	1.60	SA	97	DV	160M4	210	576	
	68	1460	21.23	28600	1.80	SAF	97	DV	160M4	235	575	
	75	1320	19.23	28200	1.95							
	84	1180	17.05	27600	2.2							
	93	1070	15.42	27200	2.3							
	110	900	13.07	26400	2.6							
	126	790	11.41	25700	2.8							



S..DR/DT/DV
S..D.. [kW]

P_m [kW]	n_a [1/min]	M_a [Nm]	i	$F_{Ra}^{1)}$ [N]	SEW f_B					m [kg]		
11.0	53	1800	27.28	23700	0.90	S	87	DV	160M4	155	569	
	59	1610	24.43	23400	1.00	SF	87	DV	160M4	175	570	
	71	1340	20.27	22800	1.20	SA	87	DV	160M4	150	571	
						SAF	87	DV	160M4	170	570	
	73	1340	19.70	20400	0.95							
	82	1190	17.49	20200	1.05							
	92	1070	15.64*	20000	1.15	S	87	DV	160M4	155	569	
	102	960	14.06	19800	1.30	SF	87	DV	160M4	175	570	
	118	840	12.21	19400	1.50	SA	87	DV	160M4	150	571	
	132	750	10.93	19100	1.65	SAF	87	DV	160M4	170	570	
	159	625	9.07	18600	1.85							
	183	545	7.88	18100	1.85							
	15.0	33	4000	44.89	31400	0.85	S	97	DV	160L4	255	574
		36	3630	40.65	31300	0.90	SF	97	DV	160L4	285	575
41		3230	36.05	31000	1.00	SA	97	DV	160L4	250	576	
						SAF	97	DV	160L4	275	575	
45		2920	32.60	30800	1.10							
55		2430	26.39	26400	1.05							
62		2180	23.59	26300	1.20							
69		1970	21.23	26200	1.30	S	97	DV	160L4	255	574	
76		1780	19.23	26000	1.45	SF	97	DV	160L4	285	575	
86		1580	17.05	25700	1.60	SA	97	DV	160L4	250	576	
95		1430	15.42	25400	1.70	SAF	97	DV	160L4	275	575	
112		1220	13.07	24800	1.90							
128		1060	11.41	24300	2.1							
153		890	9.55	23600	2.3							
177		775	8.26	22900	2.3							
93		1430	15.64*	17900	0.85	S	87	DV	160L4	195	569	
104		1290	14.06	17900	0.95	SF	87	DV	160L4	215	570	
120		1120	12.21	17800	1.10	SA	87	DV	160L4	190	571	
						SAF	87	DV	160L4	205	570	
134		1010	10.93	17600	1.25	S	87	DV	160L4	195	569	
161	840	9.07	17300	1.35	SF	87	DV	160L4	215	570		
185	730	7.88	17000	1.40	SA	87	DV	160L4	190	571		
					SAF	87	DV	160L4	205	570		
18.5	41	3970	36.05	28700	0.85							
	45	3590	32.60	28600	0.90							
	53	3060	27.63	28400	1.00							
	61	2680	24.13	28100	1.05							
	69	2420	21.23	24100	1.10	S	97	DV	180M4	275	574	
	76	2190	19.23	24100	1.20	SF	97	DV	180M4	310	575	
	86	1950	17.05	24000	1.30	SA	97	DV	180M4	270	576	
	95	1760	15.42	23900	1.40	SAF	97	DV	180M4	295	575	
	112	1500	13.07	23500	1.55							
	128	1310	11.41	23200	1.70							
	153	1100	9.55	22600	1.85							
	177	950	8.26	22100	1.85							
	22	53	3630	27.63	26600	0.85	S	97	DV	180L4	290	574
		61	3180	24.13	26500	0.90	SF	97	DV	180L4	320	575
69		2870	21.23	19800	0.90	SA	97	DV	180L4	285	576	
76		2600	19.23	21800	1.00	SAF	97	DV	180L4	310	575	
86		2310	17.05	22300	1.10							
95		2090	15.42	22400	1.20	S	97	DV	180L4	290	574	
112		1780	13.07	22300	1.30	SF	97	DV	180L4	320	575	
128		1560	11.41	22100	1.40	SA	97	DV	180L4	285	576	
153		1300	9.55	21700	1.55	SAF	97	DV	180L4	310	575	
177		1130	8.26	21300	1.55							

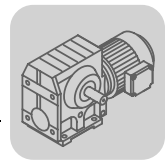




12.4 S..R..D.. [Nm]


$M_{a \max}$ [Nm]	n_a [1/min]	i	$F_{Ra}^{1)}$ [N]				m [kg]		
92	0.14	10037	3000						
	0.16	8654	3000						
	0.17	8066	3000						
	0.20	7051	3000						
	0.23	6079	3000						
	0.25	5431	3000						
	0.29	4747	3000						
	0.33	4155	3000						
	0.38	3632	3000		S	37 R17	DR	63S4	14 579
	0.48	2866	3000		SF	37 R17	DR	63S4	15 579
	0.56	2471	3000		SA	37 R17	DR	63S4	14 579
	0.64	2160	3000		SAF	37 R17	DR	63S4	15 579
	0.73	1887	3000						
	0.83	1665	3000						
	0.95	1456	3000						
	1.1	1271	3000						
	1.2	1121	3000						
	1.4	994	3000						
	1.6	869	3000						
	1.8	774	3000						
	2.1	666	3000						
	2.3	596	3000						
	2.6	521	3000						
	3.0	456	3000		S	37 R17	DR	63S4	14 579
	3.5	398	3000		SF	37 R17	DR	63S4	15 579
	3.9	351	3000		SA	37 R17	DR	63S4	13 579
	4.6	303	3000		SAF	37 R17	DR	63S4	15 579
	5.2	265	3000						
	6.0	232	3000						
	6.8	202	3000						
	7.4	179	3000		S	37 R17	DR	63M4	14 579
	8.3	158	3000		SF	37 R17	DR	63M4	15 579
	9.1	144	3000		SA	37 R17	DR	63M4	13 579
	11	118	3000		SAF	37 R17	DR	63M4	15 579
	12	110	3000		S	37 R17	DR	63L4	14 579
					SF	37 R17	DR	63L4	16 579
				SA	37 R17	DR	63L4	14 579	
				SAF	37 R17	DR	63L4	16 579	
185	0.11	12909	5250						
	0.12	11189	5250						
	0.13	10374	5250						
	0.15	8992	5250						
	0.18	7860	5250						
	0.20	6887	5250						
	0.23	6055	5250						
	0.26	5292	5250						
	0.30	4637	5250						
	0.34	4092	5250						
	0.39	3582	5200						
	0.44	3131	5200						
	0.51	2714	5200						
	0.57	2412	5200						
	0.65	2131	5200						
	0.74	1863	5200						
	0.83	1663	5200						
	0.96	1435	5200						
	1.1	1254	5200						
	1.2	1120	5200						
	1.3	1083	5200						
	1.4	965	5200						
	1.6	865	5200						
	1.8	750	5200		S	47 R17	DR	63S4	17 579
	2.1	655	5200		SF	47 R17	DR	63S4	20 579
	2.4	574	5200		SA	47 R17	DR	63S4	18 579
	2.7	506	5200		SAF	47 R17	DR	63S4	19 579
3.1	438	5200							

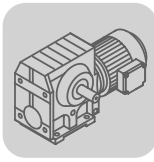
S..DR/DT/DV
S..R..D.. [Nm]


$M_{a \max}$ [Nm]	n_a [1/min]	i	$F_{Ra}^{1)}$ [N]					m [kg]	
185	3.4	388	5200	S	47 R17	DR	63M4	17	579
	3.9	336	5200	SF	47 R17	DR	63M4	20	579
	4.5	294	5200	SA	47 R17	DR	63M4	18	579
				SAF	47 R17	DR	63M4	19	579
	5.0	257	5260	S	47 R17	DR	63L4	17	579
	5.7	229	5200	SF	47 R17	DR	63L4	21	579
	6.5	200	5200	SA	47 R17	DR	63L4	18	579
	6.9	187	5200	SAF	47 R17	DR	63L4	20	579
	7.9	165	5200						
	9.3	148	5200	S	47 R17	DT	71D4	18	579
	11	131	5200	SF	47 R17	DT	71D4	22	579
				SA	47 R17	DT	71D4	19	579
				SAF	47 R17	DT	71D4	21	579
	330	0.11	12909	6800					
0.12		11189	6800						
0.13		10374	6800						
0.15		8992	6800						
0.18		7860	6800	S	57 R17	DR	63S4	21	579
0.20		6887	6800	SF	57 R17	DR	63S4	24	579
0.23		6055	6800	SA	57 R17	DR	63S4	20	579
0.26		5292	6800	SAF	57 R17	DR	63S4	23	579
0.30		4637	6800						
0.34		4092	6800						
0.38		3628	6800						
300	0.44	3131	7090						
	0.51	2714	7090						
	0.57	2412	7090						
	0.65	2131	7090	S	57 R17	DR	63S4	21	579
	0.74	1863	7090	SF	57 R17	DR	63S4	24	579
	0.83	1663	7090	SA	57 R17	DR	63S4	20	579
	0.96	1435	7090	SAF	57 R17	DR	63S4	23	579
	1.1	1254	7090						
	1.3	1083	7090						
	1.4	965	7090	S	57 R17	DR	63S4	20	579
	1.6	865	7090	SF	57 R17	DR	63S4	24	579
	1.8	750	7090	SA	57 R17	DR	63S4	20	579
	2.1	655	7090	SAF	57 R17	DR	63S4	23	579
	2.3	574	7090	S	57 R17	DR	63M4	20	579
	2.6	506	7090	SF	57 R17	DR	63M4	24	579
	3.0	438	7090	SA	57 R17	DR	63M4	20	579
	3.4	388	7090	SAF	57 R17	DR	63M4	23	579
	3.9	336	7090	S	57 R17	DR	63L4	21	579
	4.4	294	7090	SF	57 R17	DR	63L4	25	579
	4.8	269	7090	SA	57 R17	DR	63L4	21	579
				SAF	57 R17	DR	63L4	24	579
	6.0	229	7090	S	57 R17	DT	71D4	22	579
	6.8	204	7090	SF	57 R17	DT	71D4	26	579
	7.4	187	7090	SA	57 R17	DT	71D4	22	579
				SAF	57 R17	DT	71D4	25	579
	8.2	165	7090	S	57 R17	DT	80K4	24	579
	10	131	7090	SF	57 R17	DT	80K4	28	579
			SA	57 R17	DT	80K4	23	579	
			SAF	57 R17	DT	80K4	26	579	

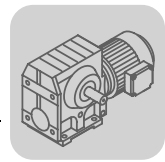


$M_{a \max}$ [Nm]	n_a [1/min]	i	$F_{Ra}^{1)}$ [N]					m [kg]		
570	0.06	21362	8190							
	0.07	19594	8190							
	0.08	18120	8190							
	0.08	16682	8190							
	0.10	14383	8190							
	0.11	12774	8190							
	0.13	11013	8190							
	0.14	9694	8190							
	0.16	8529	8190							
	0.19	7455	8190							
	0.21	6531	8190		S	67 R37	DR	63S4	39	579
	0.24	5759	8190		SF	67 R37	DR	63S4	46	579
	0.28	4965	8190		SA	67 R37	DR	63S4	40	579
	0.31	4410	8190		SAF	67 R37	DR	63S4	45	579
	0.36	3880	8190							
	0.40	3432	8190							
	0.47	2944	8190							
	0.52	2630	8190							
	0.61	2279	8190							
	0.69	2014	8190							
	0.78	1772	8190							
	0.88	1559	8190							
	1.0	1363	8190							
	1.2	1194	8190							
	1.3	1045	8190		S	67 R37	DR	63M4	39	579
	1.4	914	8190		SF	67 R37	DR	63M4	46	579
					SA	67 R37	DR	63M4	40	579
					SAF	67 R37	DR	63M4	45	579
	1.6	809	8190		S	67 R37	DR	63M4	39	579
	1.9	712	8190		SF	67 R37	DR	63M4	46	579
					SA	67 R37	DR	63M4	40	579
					SAF	67 R37	DR	63M4	45	579
	2.1	615	8190		S	67 R37	DR	63L4	40	579
	2.4	543	8190		SF	67 R37	DR	63L4	46	579
					SA	67 R37	DR	63L4	41	579
					SAF	67 R37	DR	63L4	45	579
	2.9	469	8190		S	67 R37	DT	71D4	41	579
	3.3	424	8190		SF	67 R37	DT	71D4	47	579
	3.8	365	8190		SA	67 R37	DT	71D4	42	579
					SAF	67 R37	DT	71D4	46	579
	4.3	319	8190		S	67 R37	DT	80K4	43	579
	4.9	281	8190		SF	67 R37	DT	80K4	49	579
5.5	246	8190		SA	67 R37	DT	80K4	44	579	
6.2	221	8190		SAF	67 R37	DT	80K4	48	579	
7.0	198	8190		S	67 R37	DT	80N4	44	579	
				SF	67 R37	DT	80N4	50	579	
				SA	67 R37	DT	80N4	45	579	
				SAF	67 R37	DT	80N4	49	579	
1270	0.05	25493	11700							
	0.06	21787	11700							
	0.07	19907	11700							
	0.08	17013	11700							
	0.09	14668	11700							
	0.11	13110	11700							
	0.12	11569	11700		S	77 R37	DR	63S4	59	579
	0.14	9887	11700		SF	77 R37	DR	63S4	68	579
	0.16	8817	11700		SA	77 R37	DR	63S4	58	579
	0.18	7735	11700		SAF	77 R37	DR	63S4	65	579
	0.20	6735	11700							
	0.23	5943	11700							
	0.26	5214	11700							
	0.30	4618	11700							
	0.35	3992	11700							
	0.39	3540	11700							
	0.43	3098	11700		S	77 R37	DR	63M4	59	579
					SF	77 R37	DR	63M4	68	579
					SA	77 R37	DR	63M4	58	579
					SAF	77 R37	DR	63M4	65	579

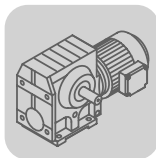
S..DR/DT/DV
S..R..D.. [Nm]


$M_{a \max}$ [Nm]	n_a [1/min]	i	$F_{Ra}^{1)}$ [N]					m [kg]		
1240	0.50	2753	12000	S	77 R37	DR	63S4	59	579	
		2374	12000	SF	77 R37	DR	63S4	68	579	
	0.63	0.73	2083	12000	SA	77 R37	DR	63S4	58	579
					SAF	77 R37	DR	63S4	65	579
					S	77 R37	DR	63M4	59	579
					SF	77 R37	DR	63M4	68	579
	0.76	0.82	1745	12000	SA	77 R37	DR	63M4	58	579
					SAF	77 R37	DR	63M4	65	579
					S	77 R37	DR	63L4	59	579
					SF	77 R37	DR	63L4	69	579
	0.93	1.0	1404	12000	SA	77 R37	DR	63L4	59	579
					SAF	77 R37	DR	63L4	66	579
					S	77 R37	DR	63L4	59	579
					SF	77 R37	DR	63L4	69	579
	1.2		1100	12000	SA	77 R37	DR	63L4	59	579
					SAF	77 R37	DR	63L4	65	579
					S	77 R37	DR	63L4	59	579
					SF	77 R37	DR	63L4	69	579
	1.4	1.7	954	12000	SA	77 R37	DR	63L4	59	579
					SAF	77 R37	DR	63L4	65	579
					S	77 R37	DT	71D4	60	579
					SF	77 R37	DT	71D4	70	579
	1.9		714	12000	SA	77 R37	DT	71D4	59	579
					SAF	77 R37	DT	71D4	66	579
					S	77 R37	DT	80K4	62	579
					SF	77 R37	DT	80K4	72	579
	2.1	2.4	637	12000	SA	77 R37	DT	80K4	61	579
					SAF	77 R37	DT	80K4	68	579
					S	77 R37	DT	80N4	63	579
					SF	77 R37	DT	80N4	73	579
	3.1	3.6	438	12000	SA	77 R37	DT	80N4	62	579
					SAF	77 R37	DT	80N4	69	579
S					77 R37	DT	90S4	68	579	
SF					77 R37	DT	90S4	78	579	
4.3	4.8	327	12000	SA	77 R37	DT	90S4	68	579	
				SAF	77 R37	DT	90S4	74	579	
				S	77 R37	DT	90S4	68	579	
				SF	77 R37	DT	90S4	78	579	
2500	0.05	25987	27500							
		23940	27500							
	0.06	20568	18265	27500						
	0.07	16774	14820	27500	S	87 R57	DR	63S4	110	579
					SF	87 R57	DR	63S4	130	579
	0.08	13160	11200	27500	SA	87 R57	DR	63S4	105	579
					SAF	87 R57	DR	63S4	120	579
	0.08	9904	8549	27500						
	0.09	7643	6706	27500						
	0.10	5875	5187	27500	S	87 R57	DR	63M4	110	579
					SF	87 R57	DR	63M4	130	579
	0.12	4606	3872	27500	SA	87 R57	DR	63M4	105	579
					SAF	87 R57	DR	63M4	120	579
	0.14	3475	2905	27500	S	87 R57	DR	63L4	110	579
					SF	87 R57	DR	63L4	130	579
	0.16	2586	2335	27500	SA	87 R57	DR	63L4	105	579
					SAF	87 R57	DR	63L4	120	579
	0.18	2054		27500	S	87 R57	DT	71D4	110	579
					SF	87 R57	DT	71D4	130	579
	0.21			27500	SA	87 R57	DT	71D4	105	579
					SAF	87 R57	DT	71D4	125	579

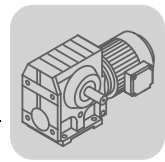

$M_{a \max}$ [Nm]	n_a [1/min]	i	$F_{Ra}^{1)}$ [N]					m [kg]	
2500	0.75	1824	27500	S	87 R57	DT	80K4	110	579
	0.83	1631	27500	SF	87 R57	DT	80K4	135	579
	1.0	1332	27500	SA	87 R57	DT	80K4	110	579
	1.1	1191	27500	SAF	87 R57	DT	80K4	125	579
	1.3	1032	27500	S	87 R57	DT	80N4	110	579
	1.5	930	27500	SF	87 R57	DT	80N4	135	579
	1.7	831	27500	SA	87 R57	DT	80N4	110	579
				SAF	87 R57	DT	80N4	125	579
	1.9	719	27500	S	87 R57	DT	90S4	115	579
	2.2	624	27500	SF	87 R57	DT	90S4	140	579
	2.5	558	27500	SA	87 R57	DT	90S4	115	579
				SAF	87 R57	DT	90S4	130	579
	2.9	485	27500	S	87 R57	DT	90L4	120	579
				SF	87 R57	DT	90L4	140	579
			SA	87 R57	DT	90L4	115	579	
			SAF	87 R57	DT	90L4	135	579	
2450	3.2	435	27600	S	87 R57	DT	90L4	120	579
	3.7	378	27600	SF	87 R57	DT	90L4	140	579
				SA	87 R57	DT	90L4	115	579
				SAF	87 R57	DT	90L4	135	579
2400	4.4	323	27700	S	87 R57	DV	100M4	125	579
	5.0	281	27700	SF	87 R57	DV	100M4	150	579
				SA	87 R57	DV	100M4	125	579
				SAF	87 R57	DV	100M4	140	579
4200	0.04	33818	32800						
	0.04	31154	32800						
	0.05	27847	32800						
	0.06	24641	32800						
	0.06	21537	32800	S	97 R57	DR	63S4	170	579
	0.07	18749	32800	SF	97 R57	DR	63S4	200	579
	0.09	16233	32800	SA	97 R57	DR	63S4	165	579
	0.09	14576	32800	SAF	97 R57	DR	63S4	190	579
	0.11	12752	32800						
	0.12	11267	32800						
	0.14	10078	32800						
	0.15	8608	32800	S	97 R57	DR	63M4	170	579
	0.17	7554	32800	SF	97 R57	DR	63M4	200	579
	0.20	6640	31300	SA	97 R57	DR	63M4	165	579
	0.23	5780	31300	SAF	97 R57	DR	63M4	190	579
	0.27	4937	31300						
	0.29	4444	31300	S	97 R57	DR	63L4	170	579
	0.32	4017	31300	SF	97 R57	DR	63L4	200	579
	0.38	3453	31300	SA	97 R57	DR	63L4	165	579
				SAF	97 R57	DR	63L4	190	579
	0.44	3108	31300	S	97 R57	DT	71D4	170	579
	0.52	2654	31300	SF	97 R57	DT	71D4	205	579
	0.59	2329	31300	SA	97 R57	DT	71D4	165	579
				SAF	97 R57	DT	71D4	190	579
	0.65	2081	31300	S	97 R57	DT	80K4	170	579
	0.73	1860	31300	SF	97 R57	DT	80K4	205	579
	0.86	1574	31300	SA	97 R57	DT	80K4	165	579
				SAF	97 R57	DT	80K4	195	579
	0.99	1394	31300	S	97 R57	DT	80N4	170	579
	1.1	1223	31300	SF	97 R57	DT	80N4	205	579
	1.3	1070	31300	SA	97 R57	DT	80N4	165	579
				SAF	97 R57	DT	80N4	195	579
	1.5	928	31300	S	97 R57	DT	90S4	175	579
	1.7	824	31300	SF	97 R57	DT	90S4	210	579
			SA	97 R57	DT	90S4	170	579	
			SAF	97 R57	DT	90S4	200	579	
2.0	714	32800	S	97 R57	DT	90L4	180	579	
2.2	626	31300	SF	97 R57	DT	90L4	210	579	
2.6	538	31300	SA	97 R57	DT	90L4	175	579	
			SAF	97 R57	DT	90L4	200	579	

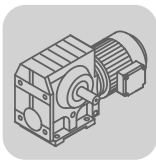
S..DR/DT/DV
S..R..D.. [Nm]





$M_{a \max}$ [Nm]	n_a [1/min]	i	$F_{Ra}^{1)}$ [N]					m [kg]		
4200	2.9	484	31400	S	97 R57	DV	100M4	185	579	
		420	31400	SF	97 R57	DV	100M4	220	579	
		376	31400	SA	97 R57	DV	100M4	180	579	
				SAF	97 R57	DV	100M4	205	579	
	4.3	327	31500	S	97 R57	DV	100L4	190	579	
		4.9	287	31500	SF	97 R57	DV	100L4	225	579
					SA	97 R57	DV	100L4	185	579
					SAF	97 R57	DV	100L4	210	579
	5.6	252	31500	S	97 R57	DV	112M4	195	579	
		6.5	219	31600	SF	97 R57	DV	112M4	230	579
					SA	97 R57	DV	112M4	190	579
					SAF	97 R57	DV	112M4	220	579

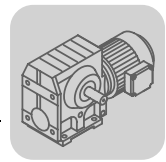


12.5 S.. [mm]

05 007 03 00

S37..

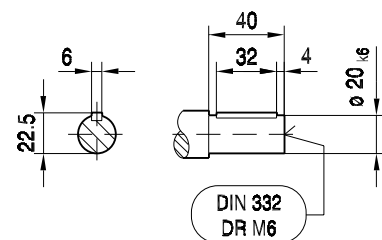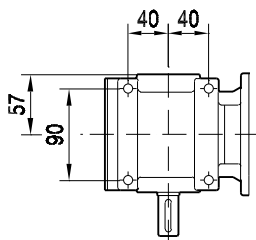
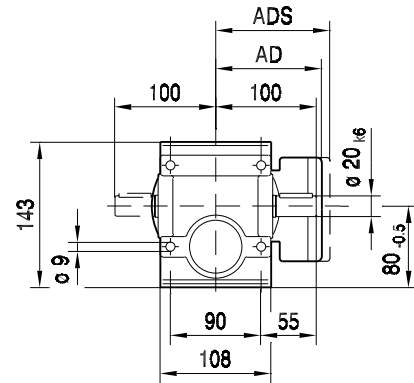
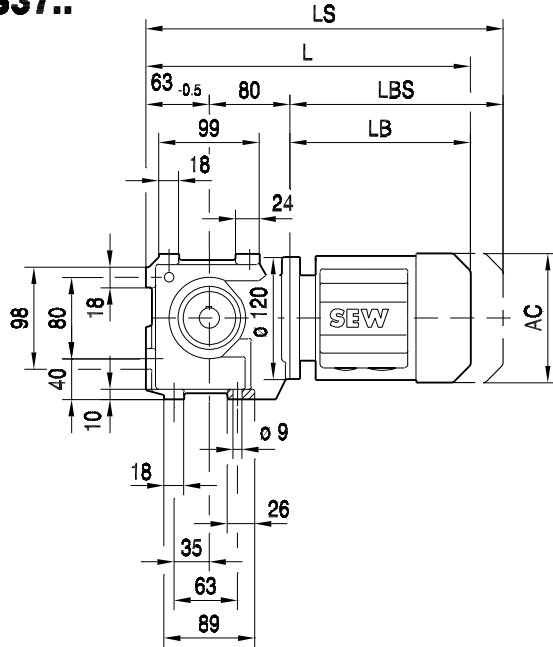


(→ 102)	DR63..	DT71D	DT80..	DT90..						
AC	132	145	145	197						
AD	105	122	122	154						
ADS	105	127	127	161						
L	334	349	399	419						
LS	389	412	462	504						
LB	191	206	256	276						
LBS	246	269	319	361						

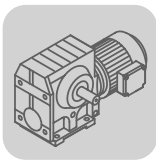


05 014 03 00


SF37..

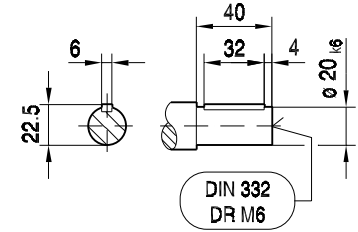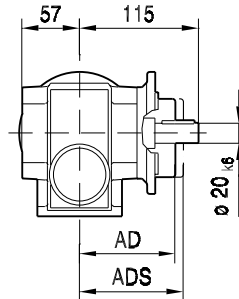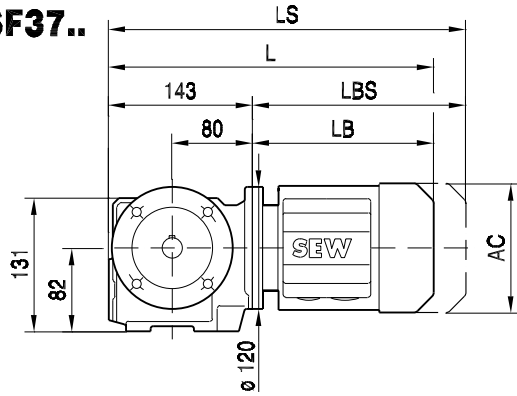


ø 120

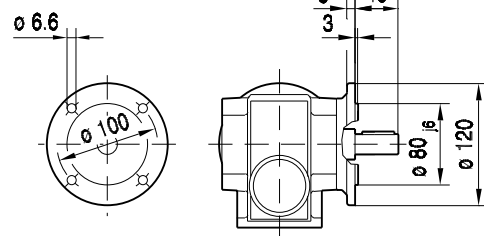




ø 160

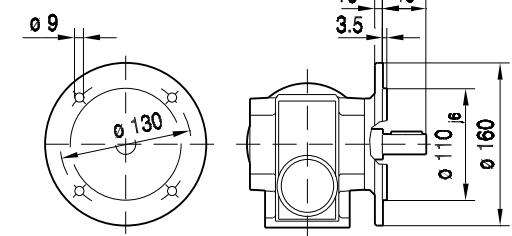


SAF37..

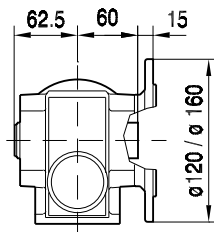

SHF37..



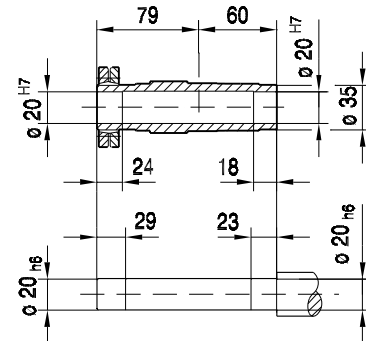
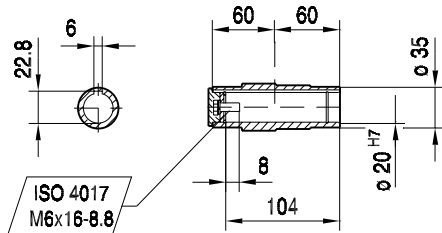
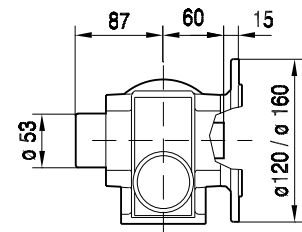


(→ 102)	DR63..	DT71D	DT80..	DT90..						
AC	132	145	145	197						
AD	105	122	122	154						
ADS	105	127	127	161						
L	334	349	399	419						
LS	389	412	462	504						
LB	191	206	256	276						
LBS	246	269	319	361						

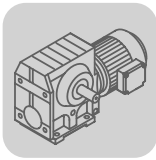


02 005 00 03

ST37..

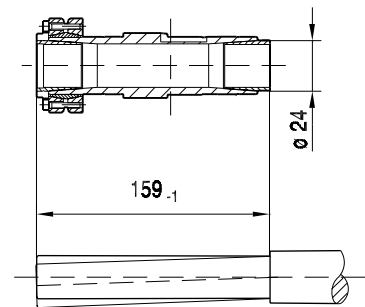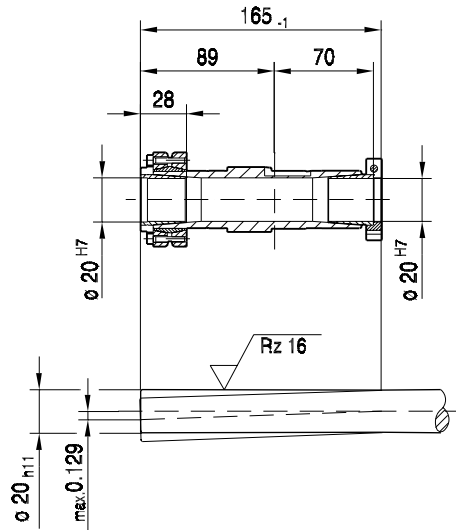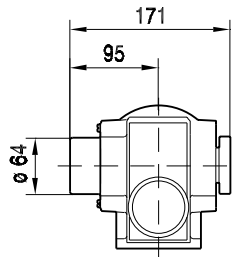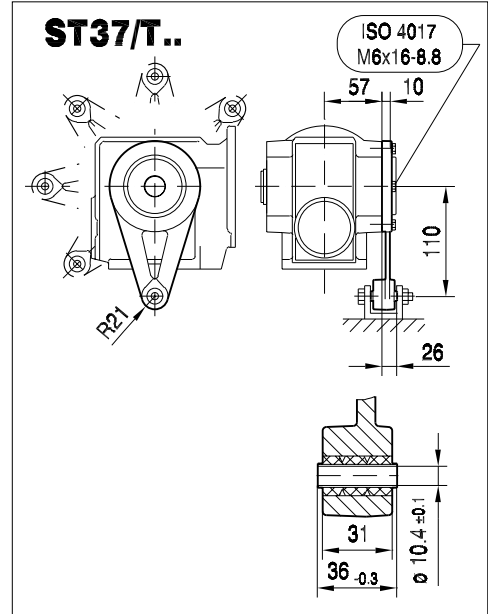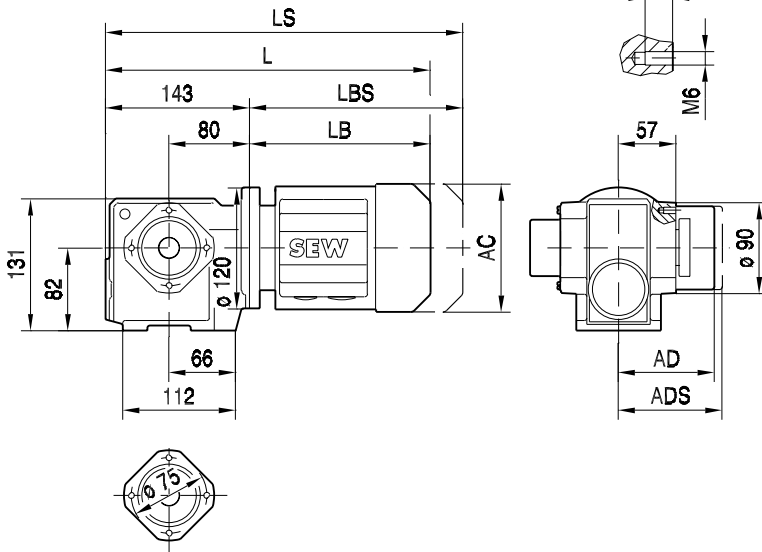


(→ 102)	DR63..	DT71D	DT80..	DT90..						
AC	132	145	145	197						
AD	105	122	122	154						
ADS	105	127	127	161						
L	334	349	399	419						
LS	389	412	462	504						
LB	191	206	256	276						
LBS	246	269	319	361						

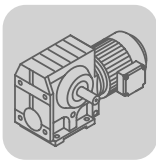


05 015 02 00





SF47..

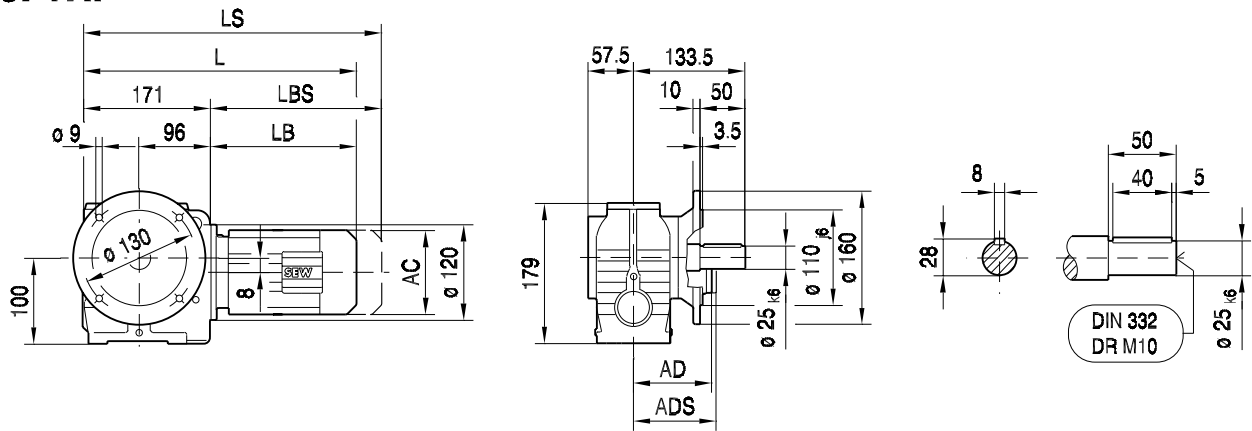


SAF47..

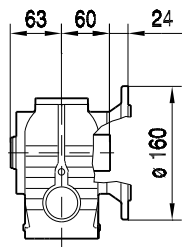

SHF47..

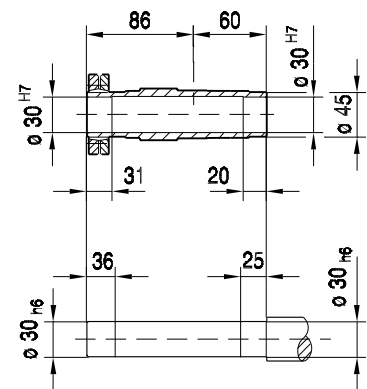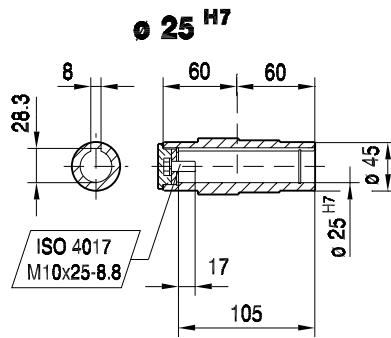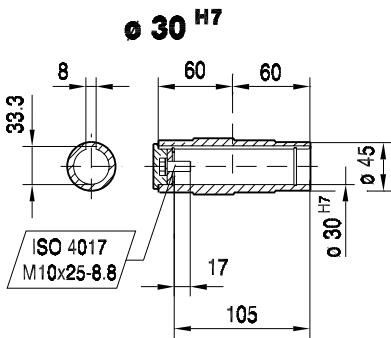
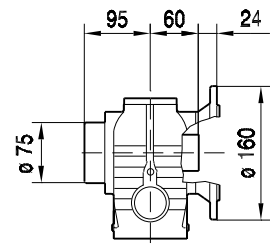


(→ 102)	DR63..	DT71D	DT80..	DT90..						
AC	132	145	145	197						
AD	105	122	122	154						
ADS	105	127	127	161						
L	362	377	427	447						
LS	417	440	490	532						
LB	191	206	256	276						
LBS	246	269	319	361						

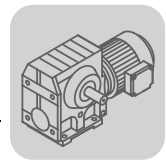


28 002 03 00


SA47..

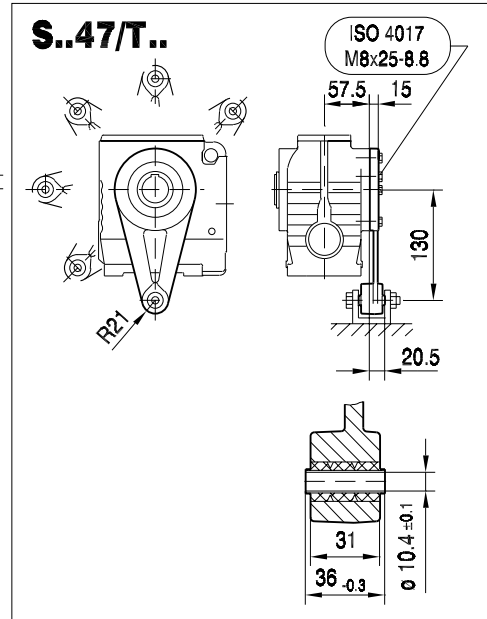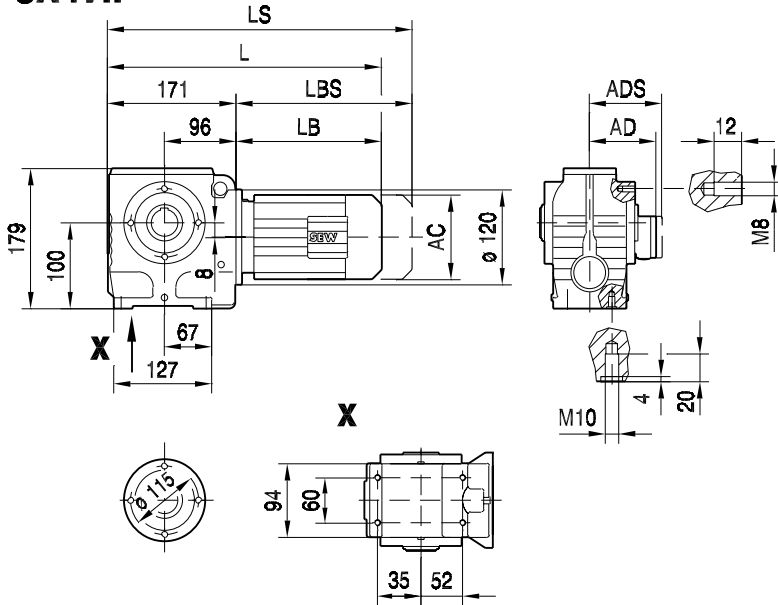


SA47..

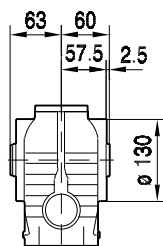



SH47..

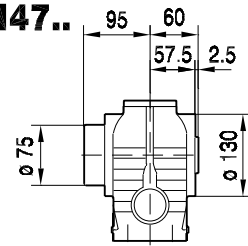


$\varnothing 30$ H7

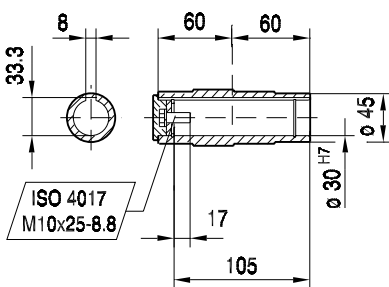

$\varnothing 25$ H7


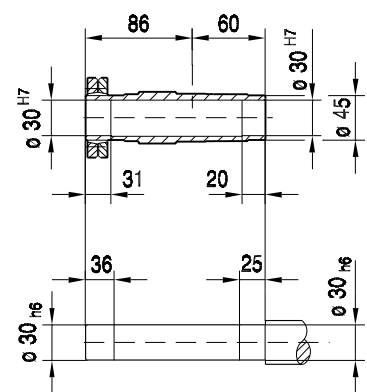
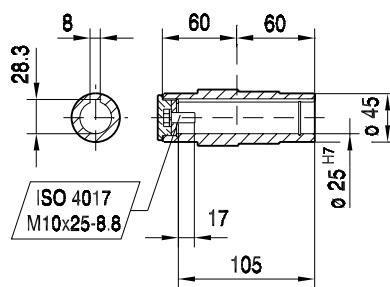


(→ 102)	DR63..	DT71D	DT80..	DT90..						
AC	132	145	145	197						
AD	105	122	122	154						
ADS	105	127	127	161						
L	362	377	427	447						
LS	417	440	490	532						
LB	191	206	256	276						
LBS	246	269	319	361						

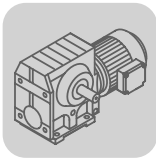


28 008 03 00


SAZ47..

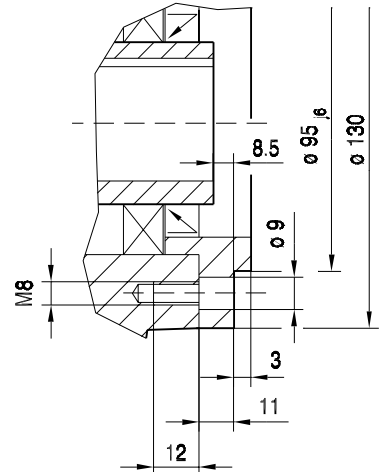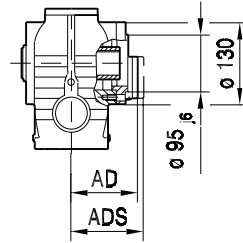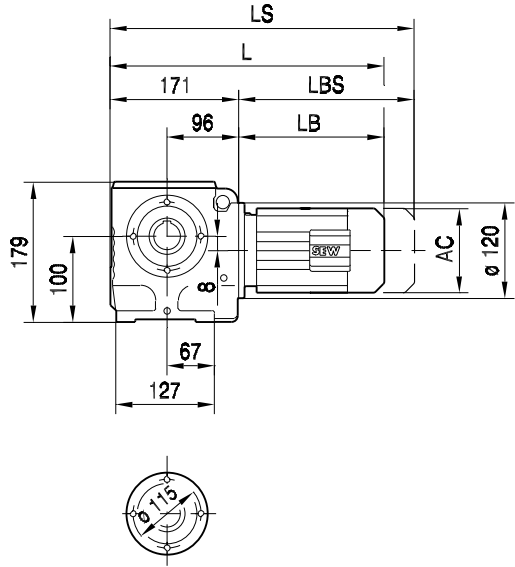


SAZ47..

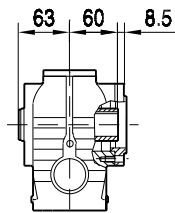



SHZ47..

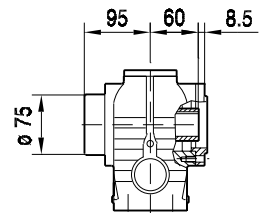


ø 30 H7

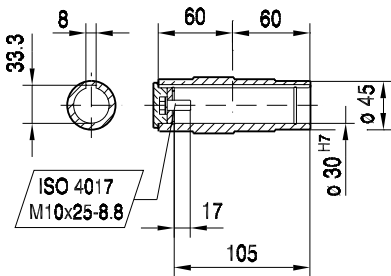

ø 25 H7




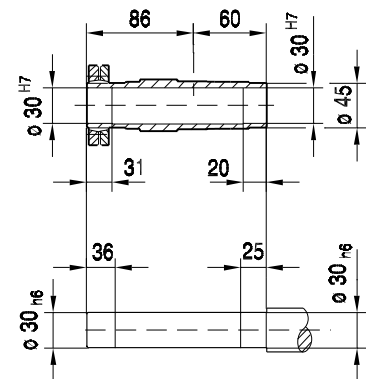
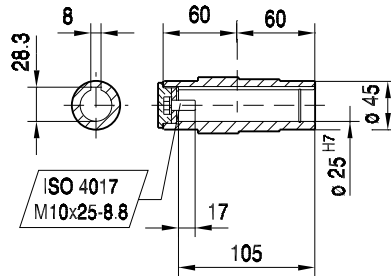


(→ 102)	DR63..	DT71D	DT80..	DT90..						
AC	132	145	145	197						
AD	105	122	122	154						
ADS	105	127	127	161						
L	362	377	427	447						
LS	417	440	490	532						
LB	191	206	256	276						
LBS	246	269	319	361						

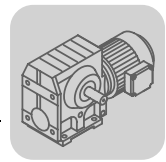


02 006 00 03

ST47..

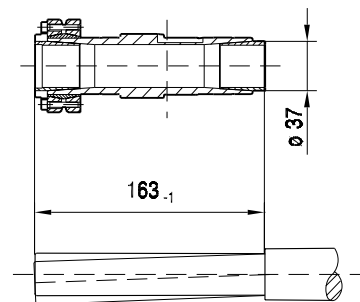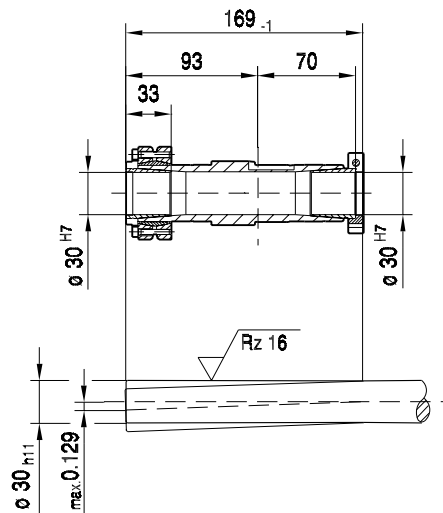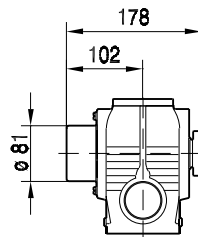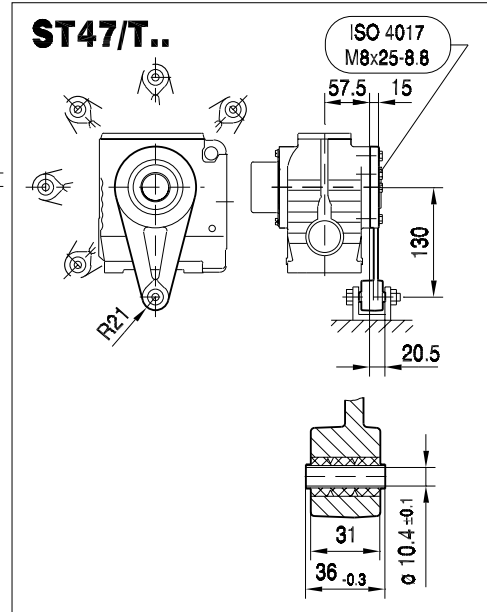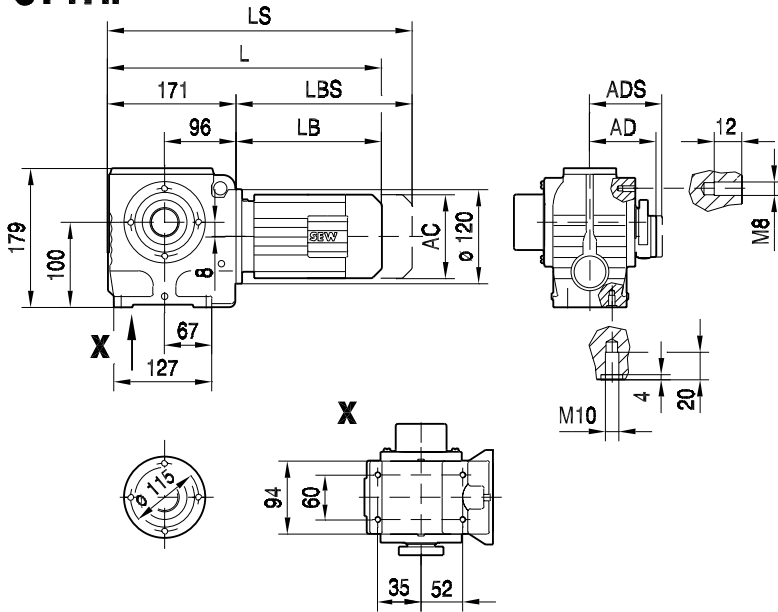




12

(→ 102)	DR63..	DT71D	DT80..	DT90..						
AC	132	145	145	197						
AD	105	122	122	154						
ADS	105	127	127	161						
L	362	377	427	447						
LS	417	440	490	532						
LB	191	206	256	276						
LBS	246	269	319	361						

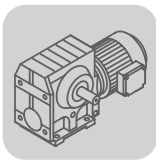


S..DR/DT/DV
S.. [mm]

05 009 03 00

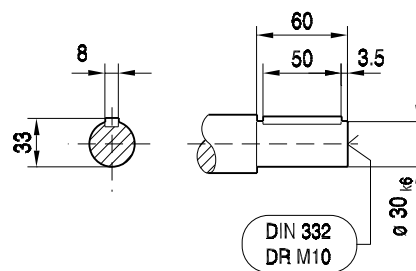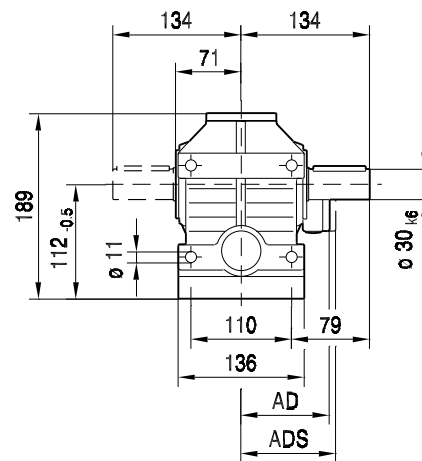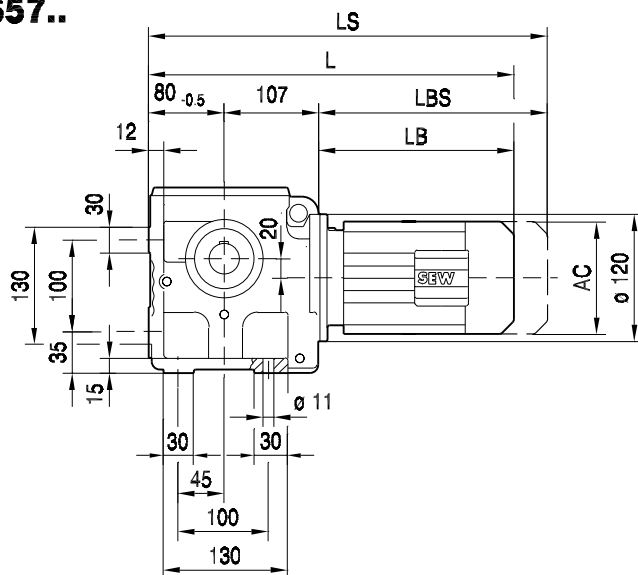
S57..

(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L					
AC	132	145	145	197	197	197					
AD	105	122	122	154	166	166					
ADS	105	127	127	161	166	166					
L	378	393	443	463	515	545					
LS	433	456	506	548	600	630					
LB	191	206	256	276	328	358					
LBS	246	269	319	361	413	443					

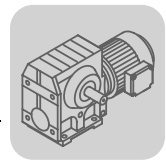


05 016 03 00





SF57..

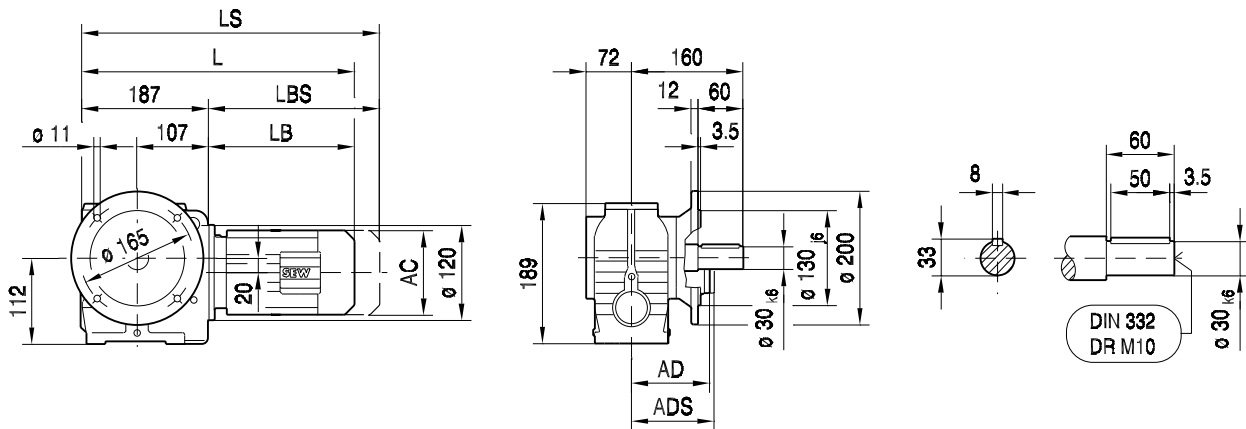


SAF57..

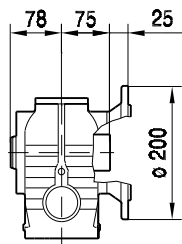

SHF57..

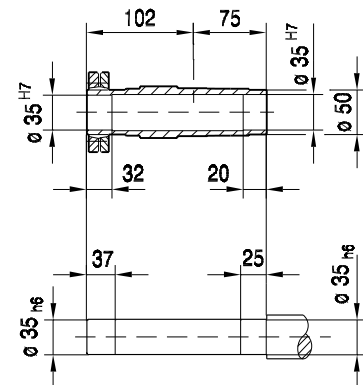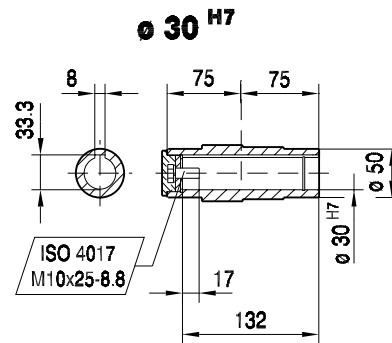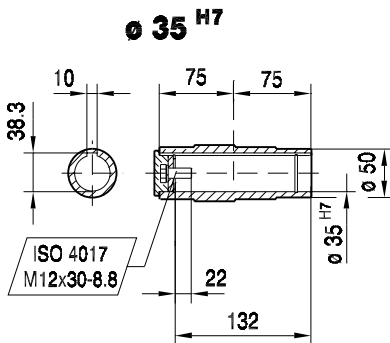
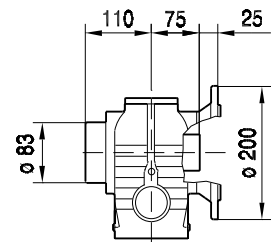


(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L				
AC	132	145	145	197	197	197				
AD	105	122	122	154	166	166				
ADS	105	127	127	161	166	166				
L	378	393	443	463	515	545				
LS	433	456	506	548	600	630				
LB	191	206	256	276	328	358				
LBS	246	269	319	361	413	443				

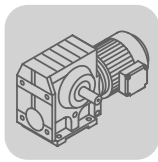


28 003 03 00





SA57..

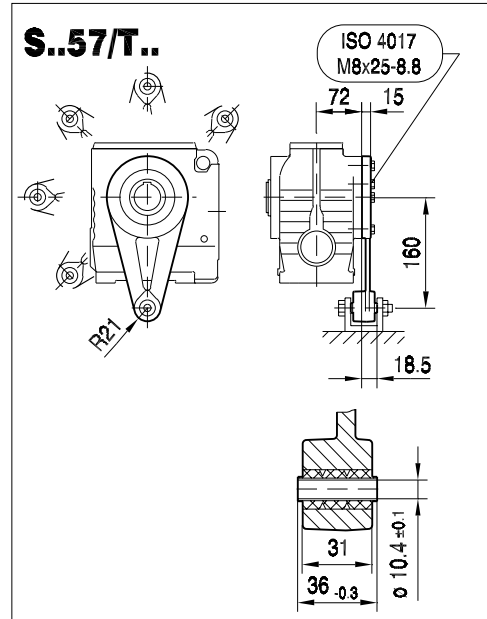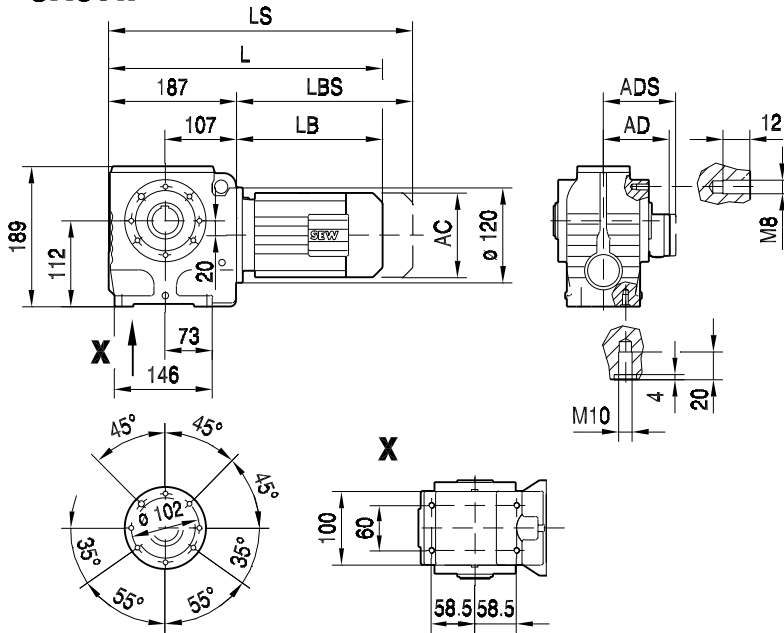


SA57..

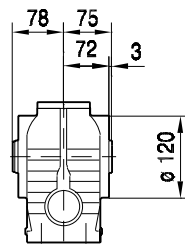

SH57..

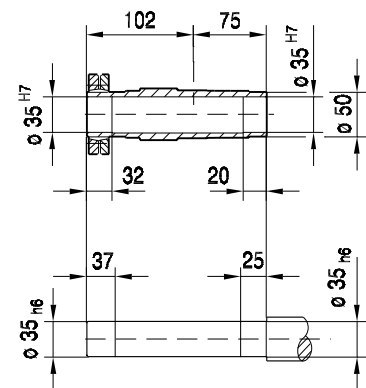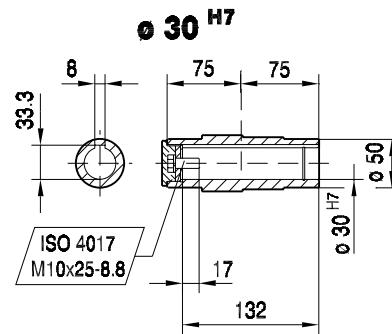
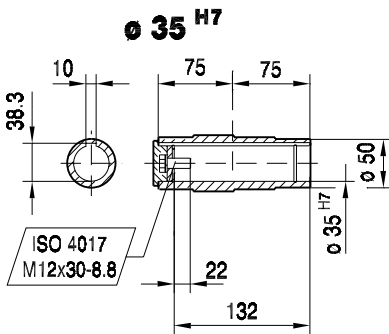
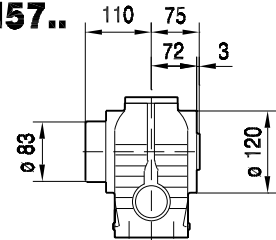


(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L				
AC	132	145	145	197	197	197				
AD	105	122	122	154	166	166				
ADS	105	127	127	161	166	166				
L	378	393	443	463	515	545				
LS	433	456	506	548	600	630				
LB	191	206	256	276	328	358				
LBS	246	269	319	361	413	443				

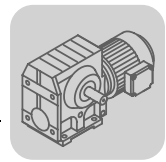


28 009 03 00


SAZ57..

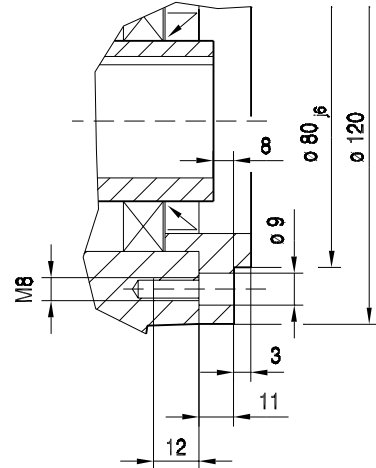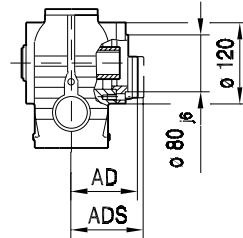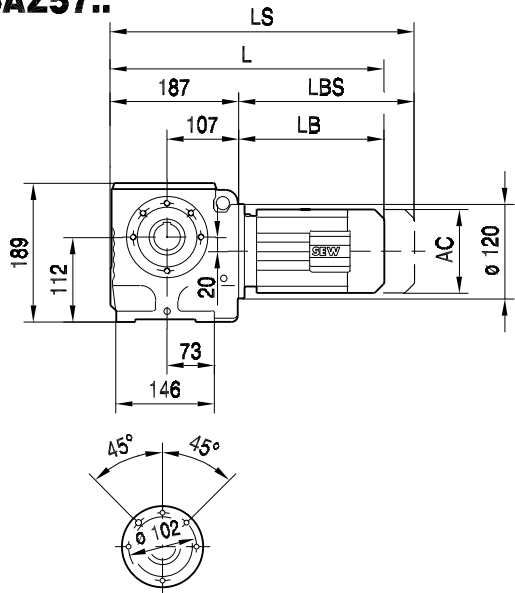


SAZ57..

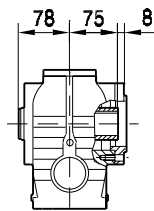



SHZ57..

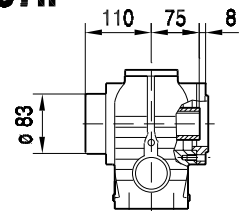

ø 35 H7

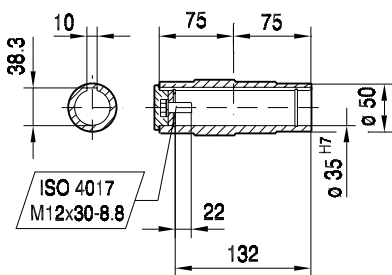


ø 30 H7

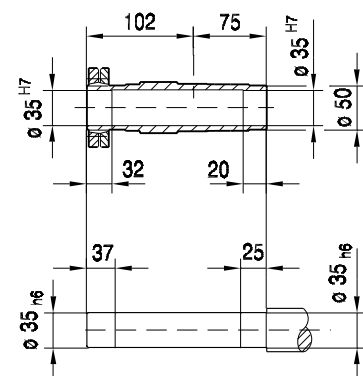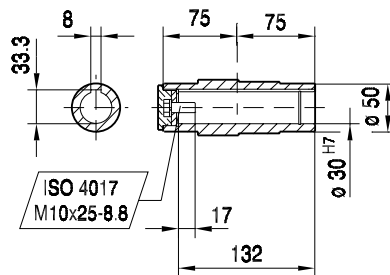






12

(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L				
AC	132	145	145	197	197	197				
AD	105	122	122	154	166	166				
ADS	105	127	127	161	166	166				
L	378	393	443	463	515	545				
LS	433	456	506	548	600	630				
LB	191	206	256	276	328	358				
LBS	246	269	319	361	413	443				

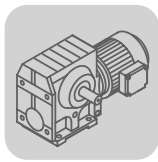


02 007 00 03

ST57..

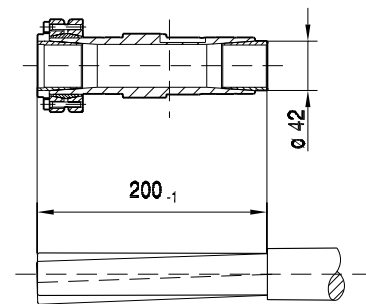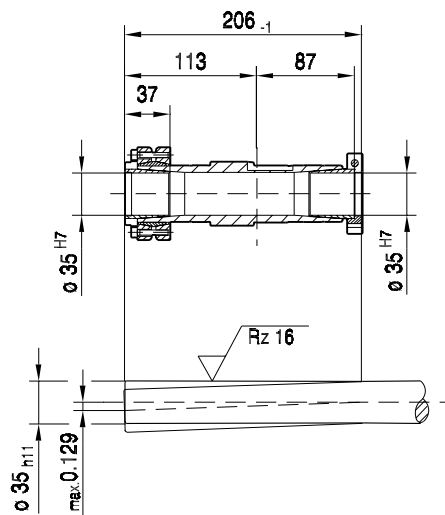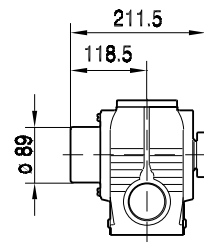
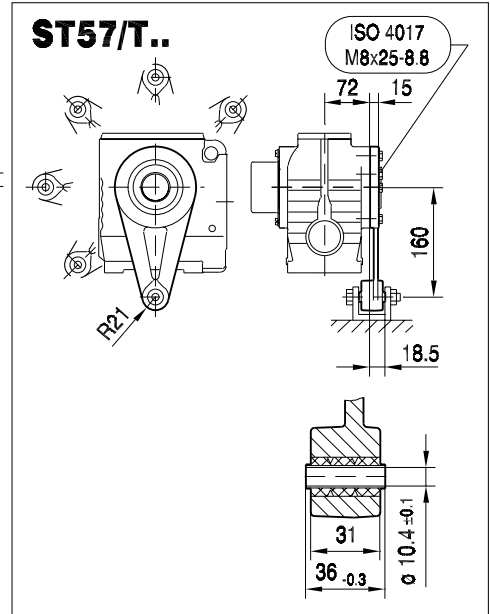
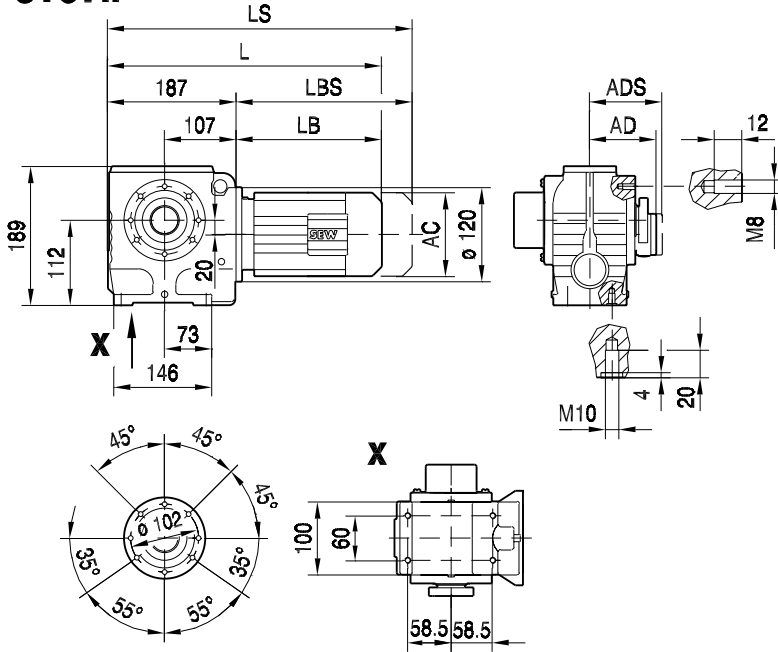


(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L				
AC	132	145	145	197	197	197				
AD	105	122	122	154	166	166				
ADS	105	127	127	161	166	166				
L	378	393	443	463	515	545				
LS	433	456	506	548	600	630				
LB	191	206	256	276	328	358				
LBS	246	269	319	361	413	443				

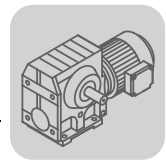


05 010 02 00

S67..

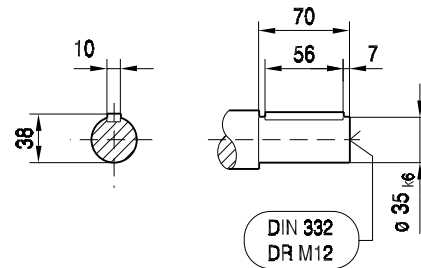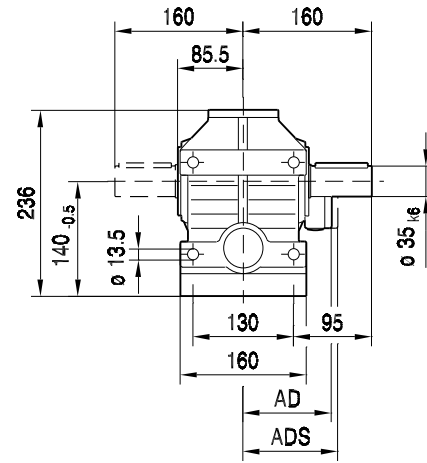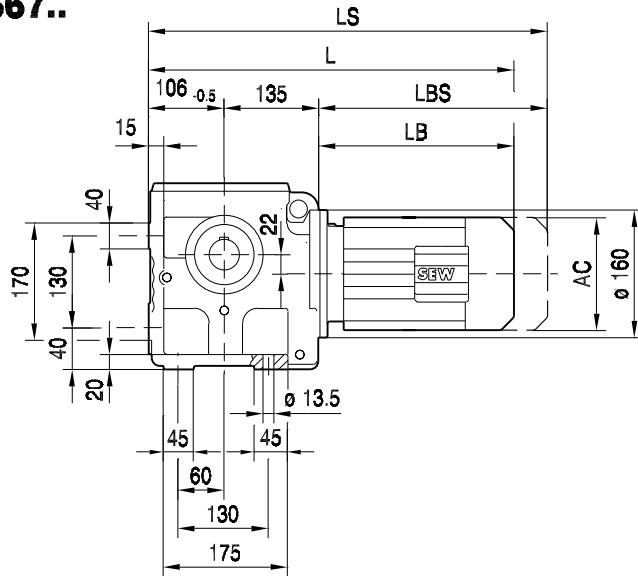


(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S			
AC	132	145	145	197	197	197	221	221			
AD	105	122	122	154	166	166	179	179			
ADS	105	127	127	161	166	166	182	182			
L	426	440	490	510	560	590	595	643			
LS	481	504	554	595	645	675	675	723			
LB	185	199	249	269	319	349	354	402			
LBS	240	263	313	354	404	434	434	482			

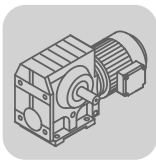


05 017 03 00





SF67..

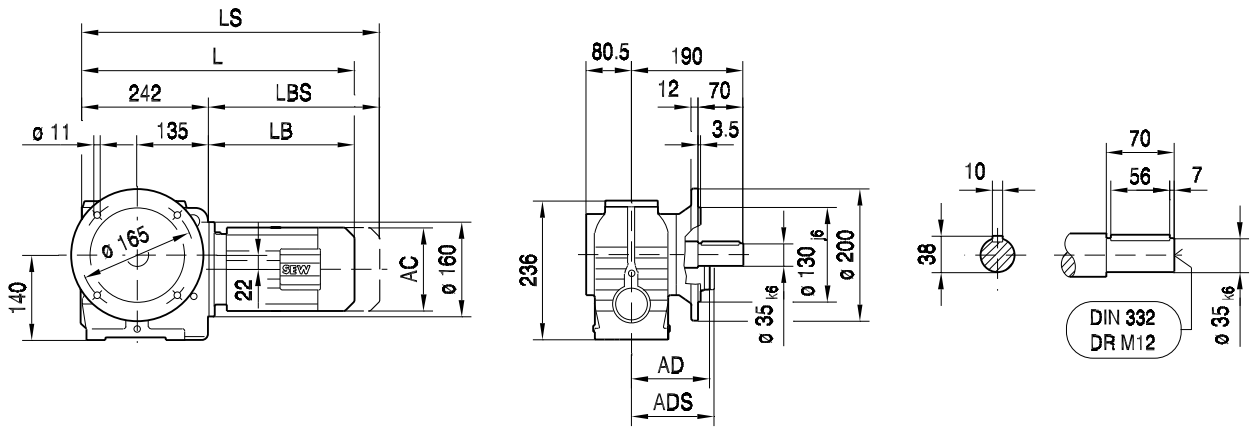


SAF67..

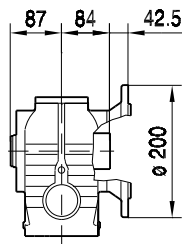

SHF67..

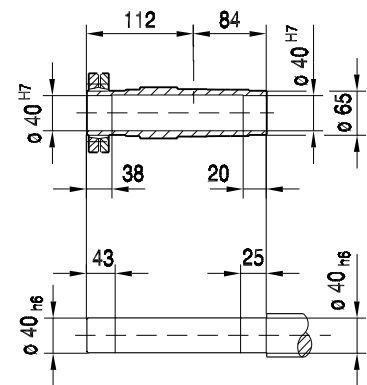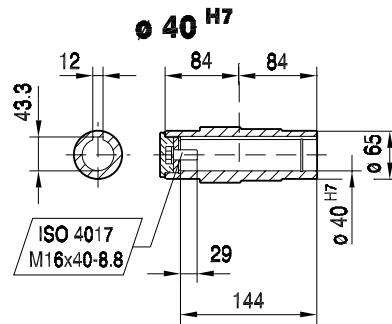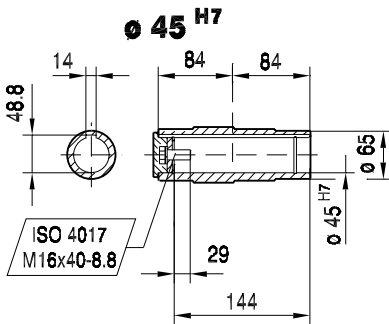
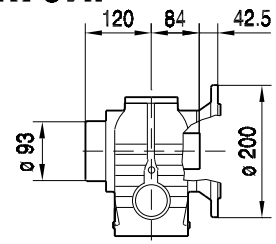


(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S			
AC	132	145	145	197	197	197	221	221			
AD	105	122	122	154	166	166	179	179			
ADS	105	127	127	161	166	166	182	182			
L	427	441	491	511	561	591	596	644			
LS	482	505	555	596	646	676	676	724			
LB	185	199	249	269	319	349	354	402			
LBS	240	263	313	354	404	434	434	482			

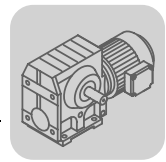


28 004 03 00





SA67..

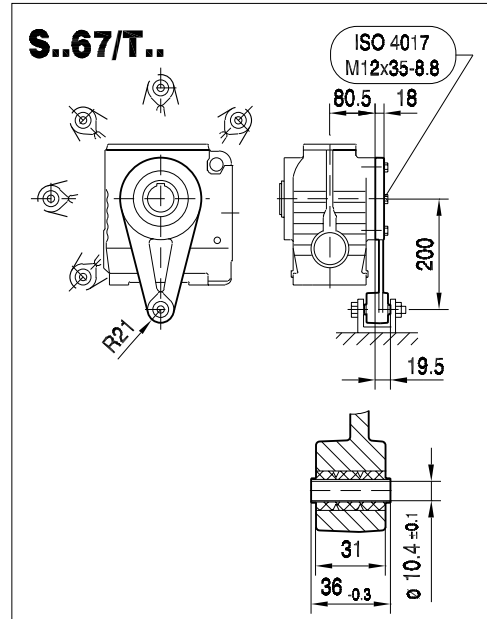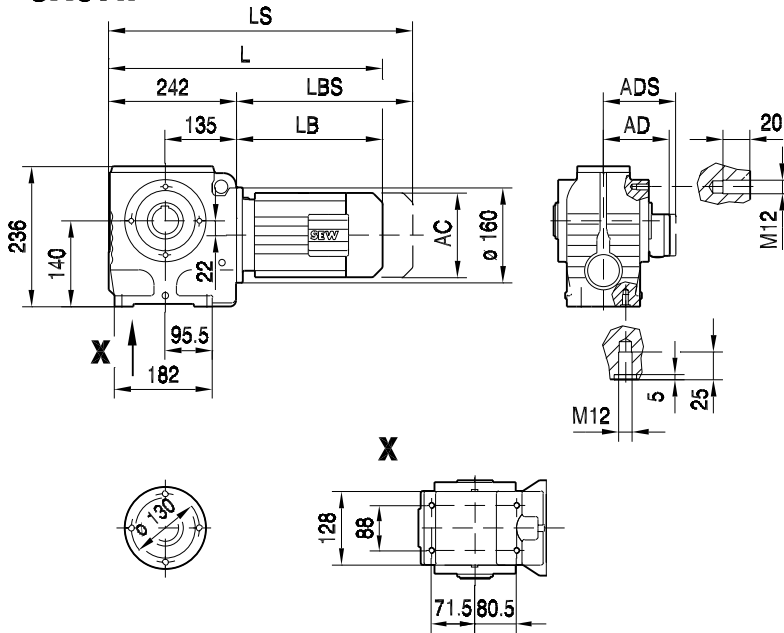


SA67..

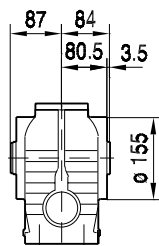

SH67..

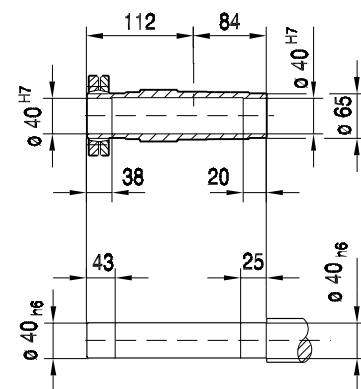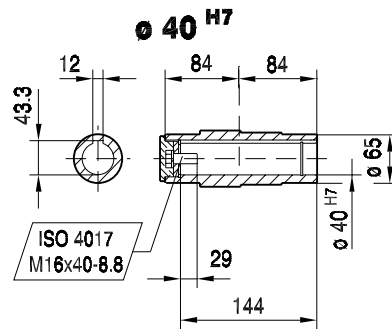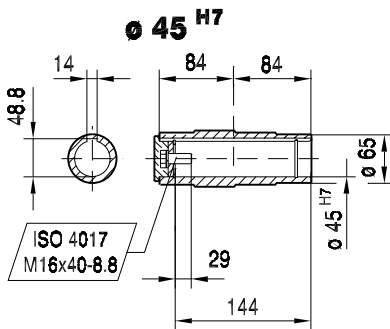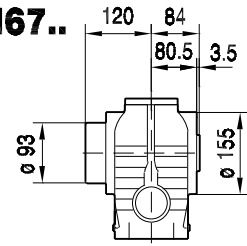




(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S		
AC	132	145	145	197	197	197	221	221		
AD	105	122	122	154	166	166	179	179		
ADS	105	127	127	161	166	166	182	182		
L	427	441	491	511	561	591	596	644		
LS	482	505	555	596	646	676	676	724		
LB	185	199	249	269	319	349	354	402		
LBS	240	263	313	354	404	434	434	482		

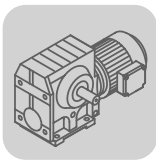


S..DR/DT/DV
S.. [mm]

28 010 03 00


SAZ67..

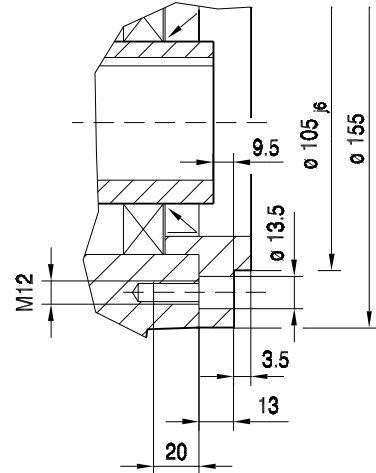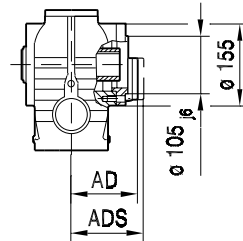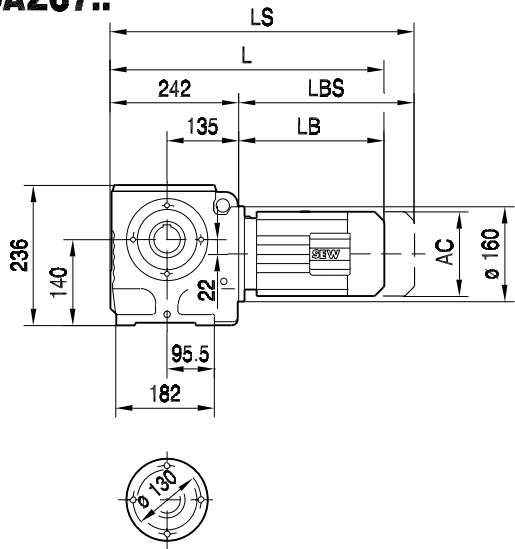


SAZ67..

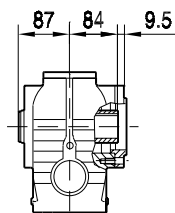



SHZ67..

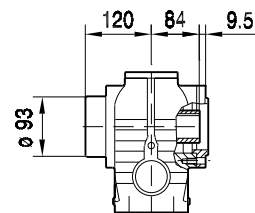


∅ 45 H7

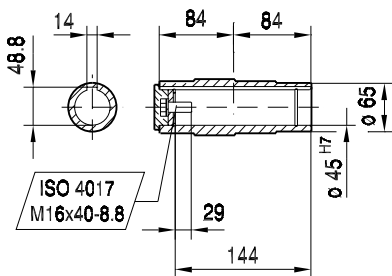

∅ 40 H7




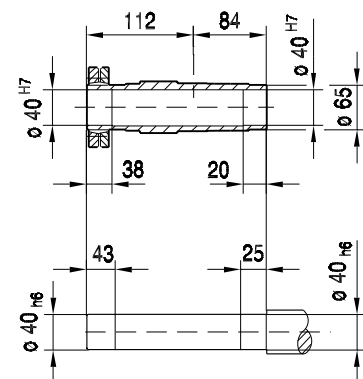
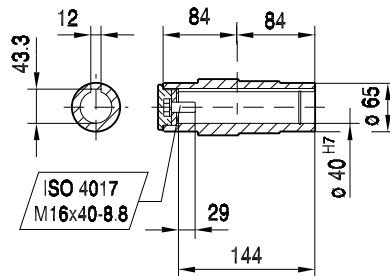


(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S			
AC	132	145	145	197	197	197	221	221			
AD	105	122	122	154	166	166	179	179			
ADS	105	127	127	161	166	166	182	182			
L	427	441	491	511	561	591	596	644			
LS	482	505	555	596	646	676	676	724			
LB	185	199	249	269	319	349	354	402			
LBS	240	263	313	354	404	434	434	482			

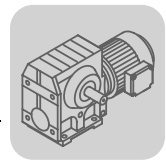


02 008 00 03

ST67..

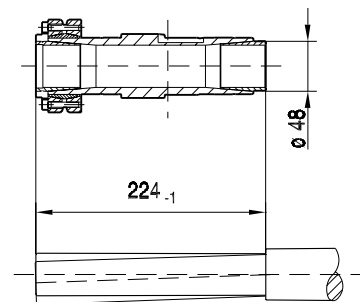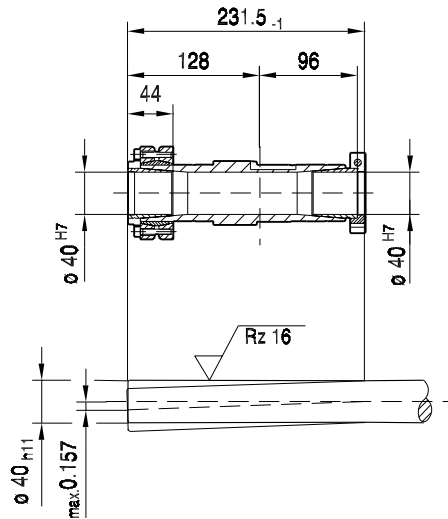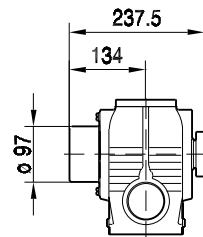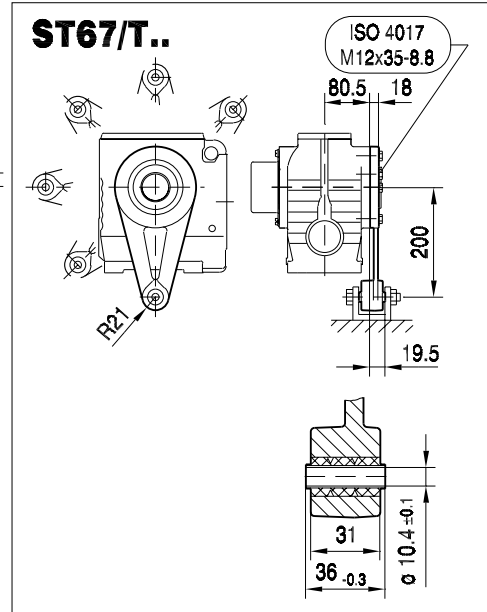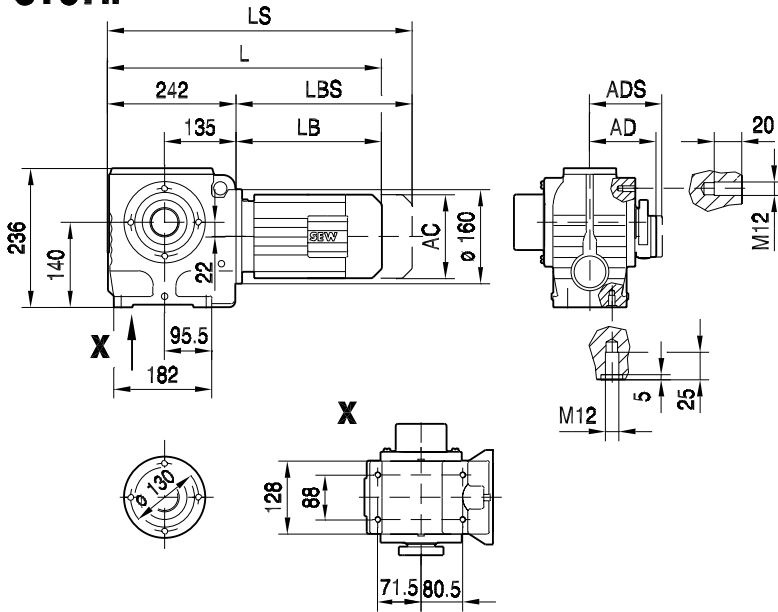




12

(→ 102)	DR63..	DT71D	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S			
AC	132	145	145	197	197	197	221	221			
AD	105	122	122	154	166	166	179	179			
ADS	105	127	127	161	166	166	182	182			
L	427	441	491	511	561	591	596	644			
LS	482	505	555	596	646	676	676	724			
LB	185	199	249	269	319	349	354	402			
LBS	240	263	313	354	404	434	434	482			

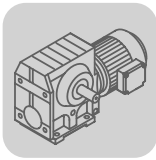


S..DR/DT/DV
S.. [mm]

05 011 03 00

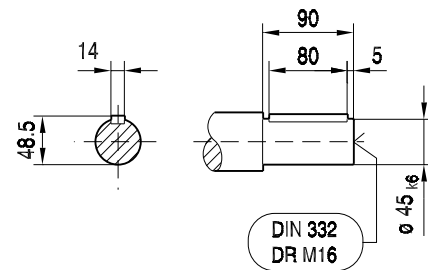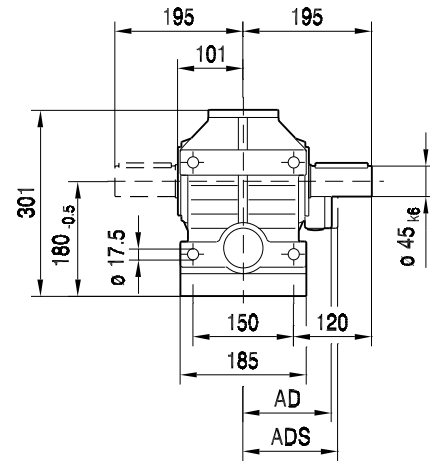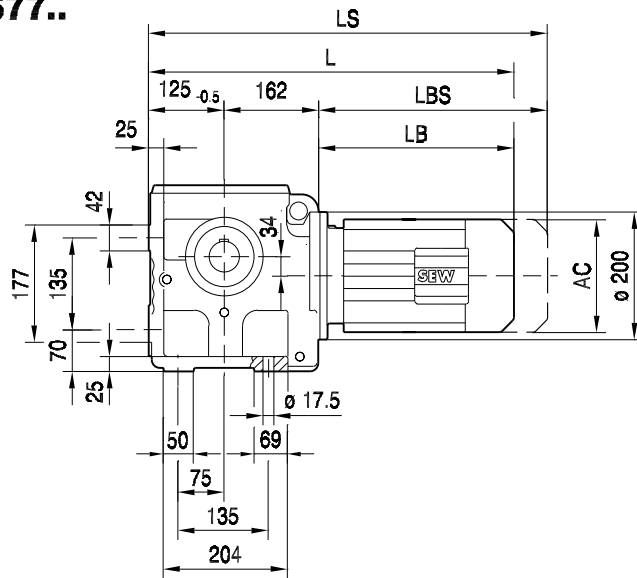
S77..

(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML			
AC	145	197	197	197	221	221	275	275			
AD	122	154	166	166	179	179	230	230			
ADS	127	161	166	166	182	182	230	230			
L	530	548	598	628	632	677	699	759			
LS	594	633	683	713	712	757	811	871			
LB	243	261	311	341	345	390	412	472			
LBS	307	346	396	426	425	470	524	584			

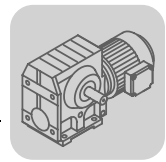


05 018 03 00


SF77..

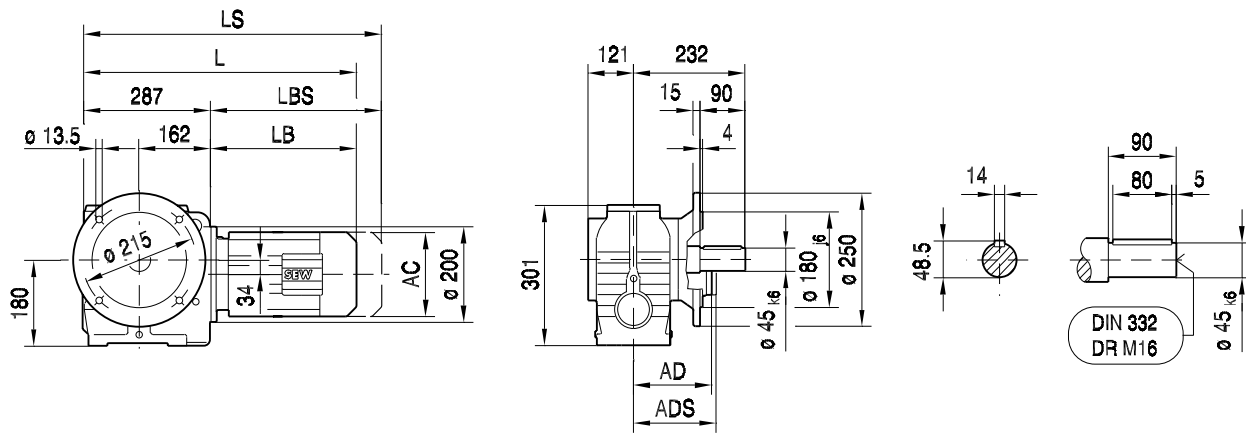


SAF77..

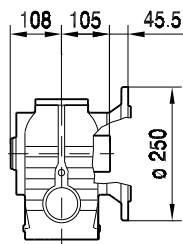



SHF77..

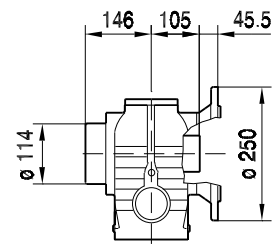


$\phi 60_{\text{H}7}$

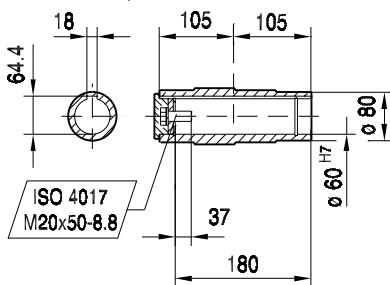

$\phi 50_{\text{H}7}$

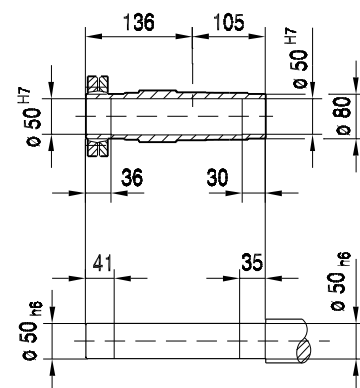
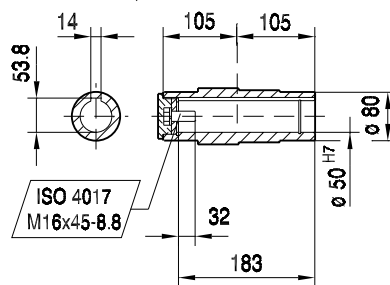


(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML			
AC	145	197	197	197	221	221	275	275			
AD	122	154	166	166	179	179	230	230			
ADS	127	161	166	166	182	182	230	230			
L	530	548	598	628	632	677	699	759			
LS	594	633	683	713	712	757	811	871			
LB	243	261	311	341	345	390	412	472			
LBS	307	346	396	426	425	470	524	584			

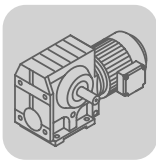


28 005 03 00


SA77..

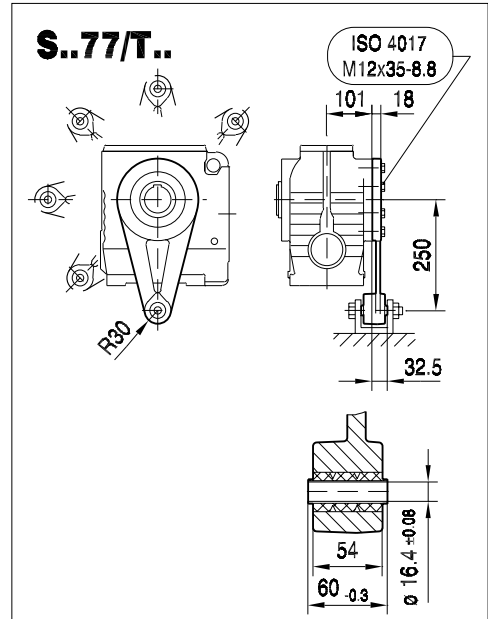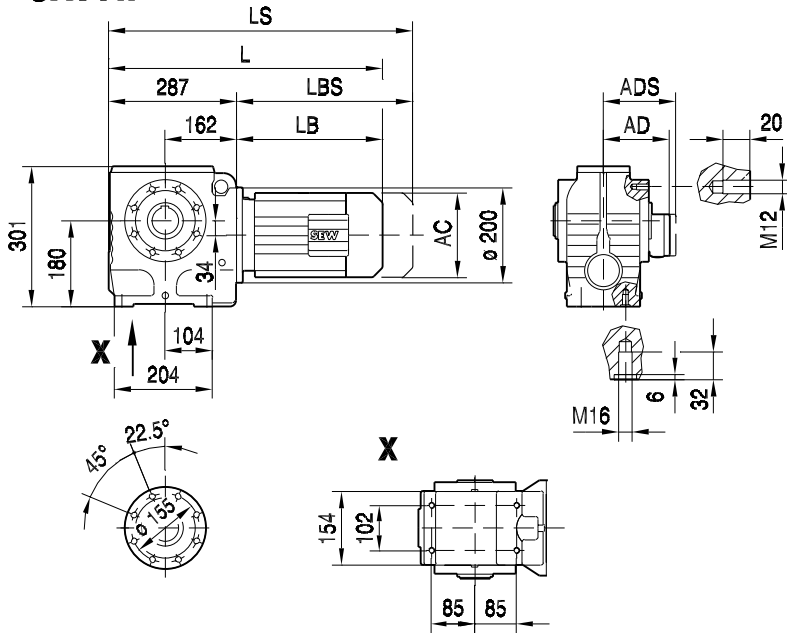


SA77..

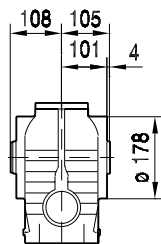



SH77..

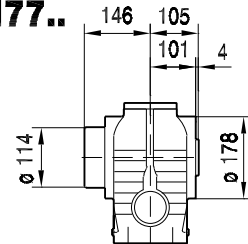


ø 60 H7

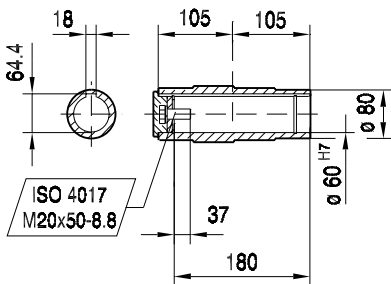

ø 50 H7


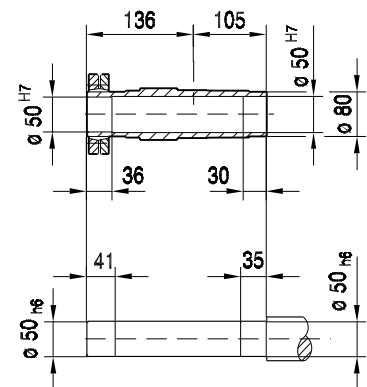
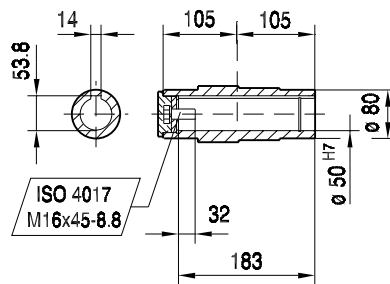


(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML			
AC	145	197	197	197	221	221	275	275			
AD	122	154	166	166	179	179	230	230			
ADS	127	161	166	166	182	182	230	230			
L	530	548	598	628	632	677	699	759			
LS	594	633	683	713	712	757	811	871			
LB	243	261	311	341	345	390	412	472			
LBS	307	346	396	426	425	470	524	584			

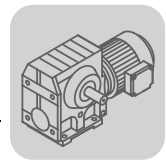


28 011 03 00


SAZ77..

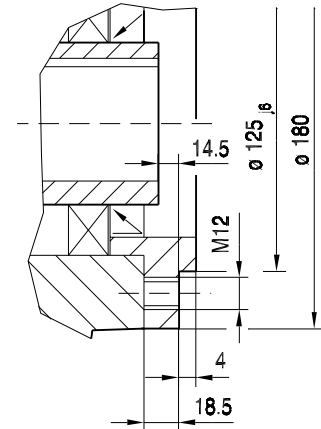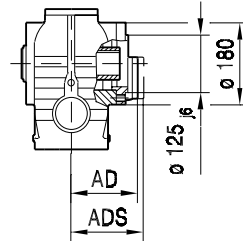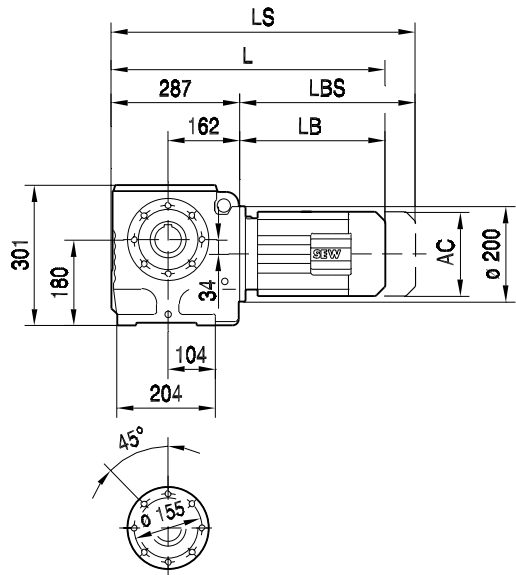


SAZ77..

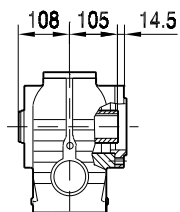



SHZ77..

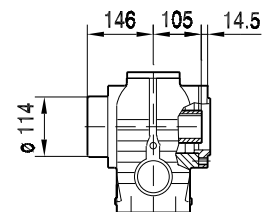

Ø 60 H7

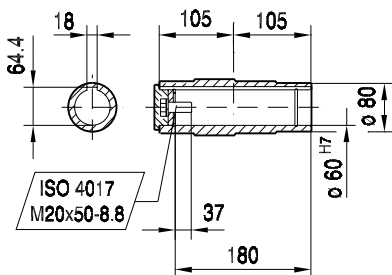


Ø 50 H7

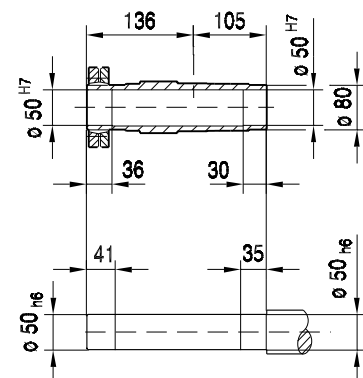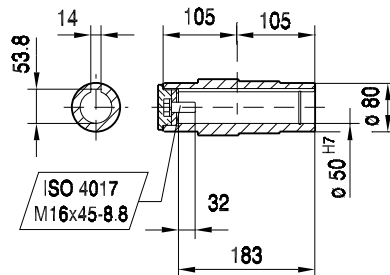






12

(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML			
AC	145	197	197	197	221	221	275	275			
AD	122	154	166	166	179	179	230	230			
ADS	127	161	166	166	182	182	230	230			
L	530	548	598	628	632	677	699	759			
LS	594	633	683	713	712	757	811	871			
LB	243	261	311	341	345	390	412	472			
LBS	307	346	396	426	425	470	524	584			

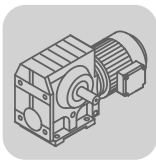


02 009 00 03

ST77..

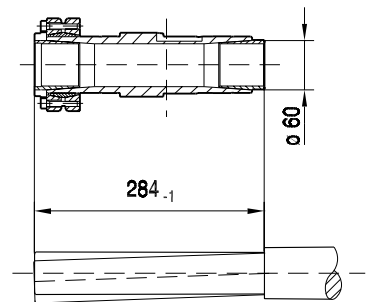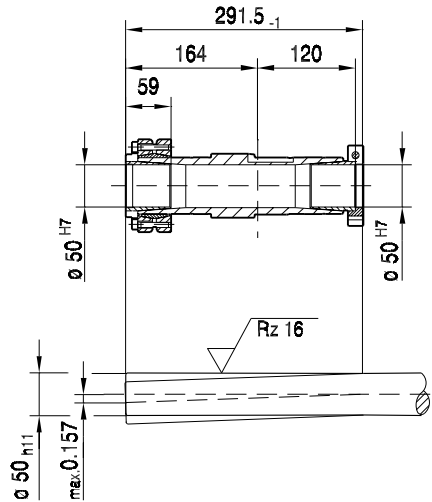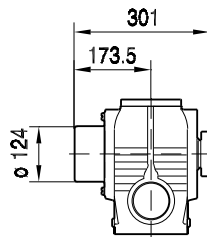
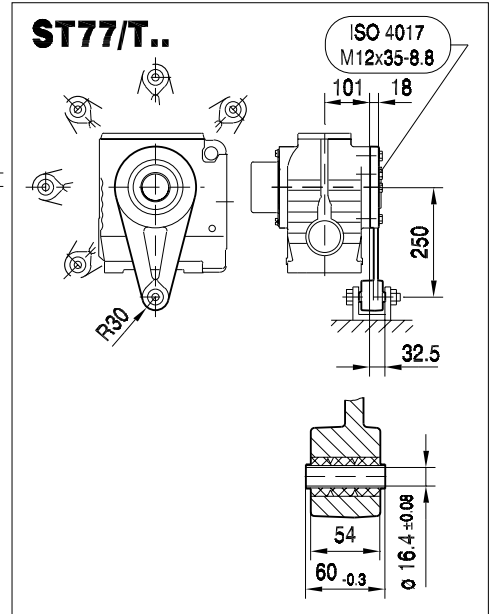
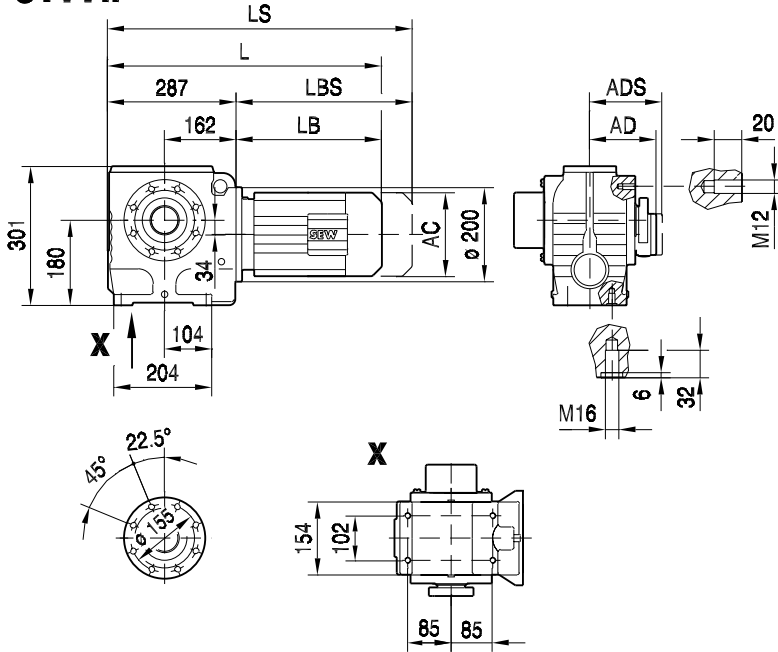


(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML			
AC	145	197	197	197	221	221	275	275			
AD	122	154	166	166	179	179	230	230			
ADS	127	161	166	166	182	182	230	230			
L	530	548	598	628	632	677	699	759			
LS	594	633	683	713	712	757	811	871			
LB	243	261	311	341	345	390	412	472			
LBS	307	346	396	426	425	470	524	584			

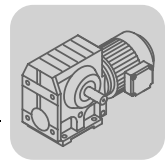


05 012 03 00

S87..

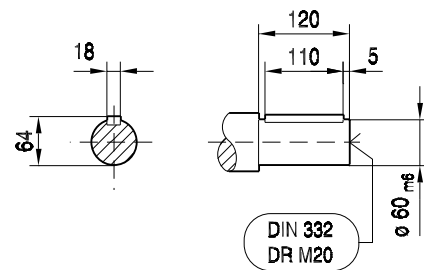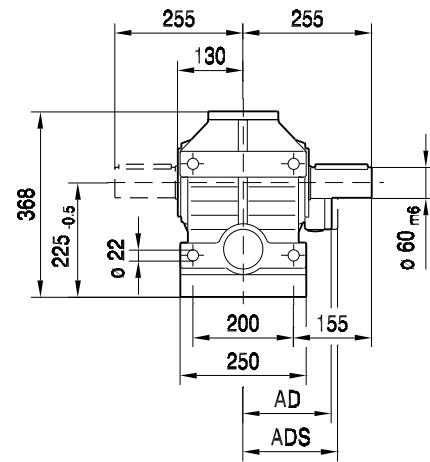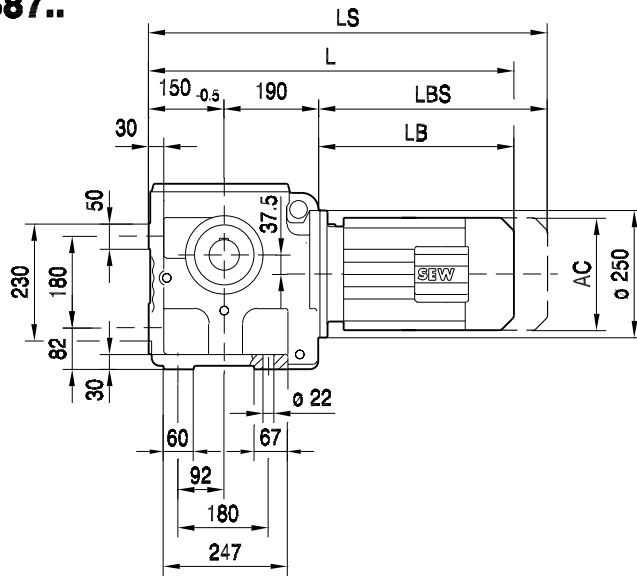


(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L
AC	145	197	197	197	221	221	275	275	275	331
AD	122	154	166	166	179	179	230	230	230	258
ADS	127	161	166	166	182	182	230	230	230	258
L	578	597	647	677	680	725	747	807	807	854
LS	642	682	732	762	760	805	859	919	919	1010
LB	238	257	307	337	340	385	407	467	467	514
LBS	302	342	392	422	420	465	519	579	579	670

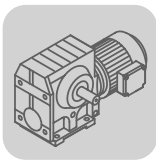


05 019 03 00





SF87..

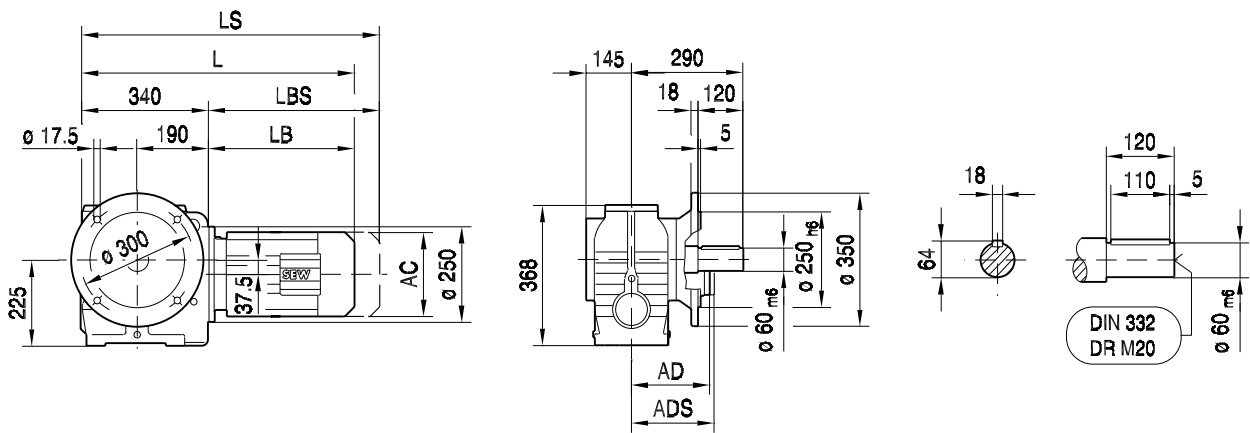


SAF87..

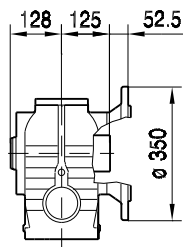

SHF87..

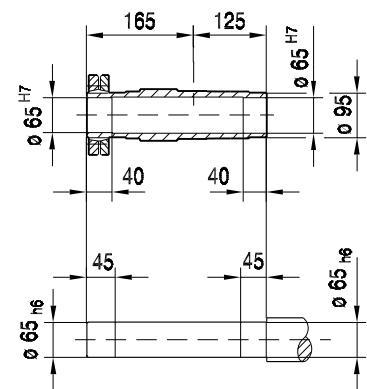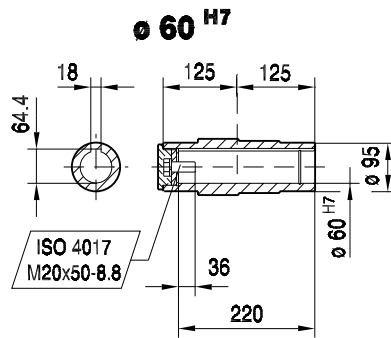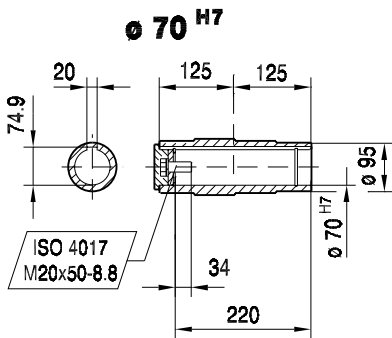
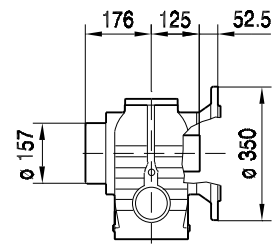


(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L
AC	145	197	197	197	221	221	275	275	275	331
AD	122	154	166	166	179	179	230	230	230	258
ADS	127	161	166	166	182	182	230	230	230	258
L	578	597	647	677	680	725	747	807	807	854
LS	642	682	732	762	760	805	859	919	919	1010
LB	238	257	307	337	340	385	407	467	467	514
LBS	302	342	392	422	420	465	519	579	579	670

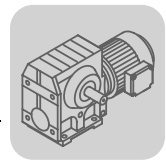


28 006 03 00


SA87..

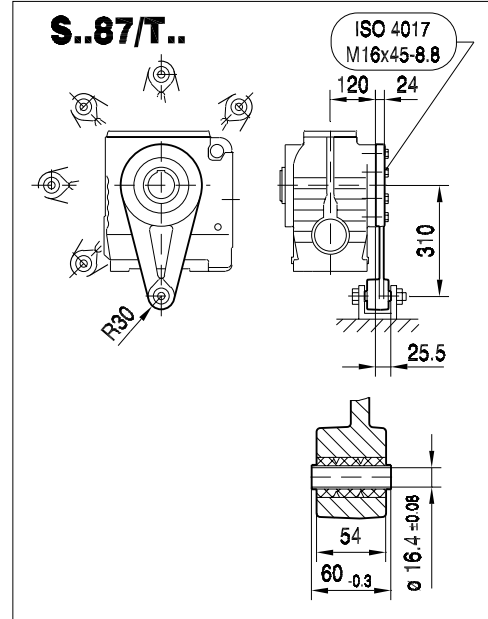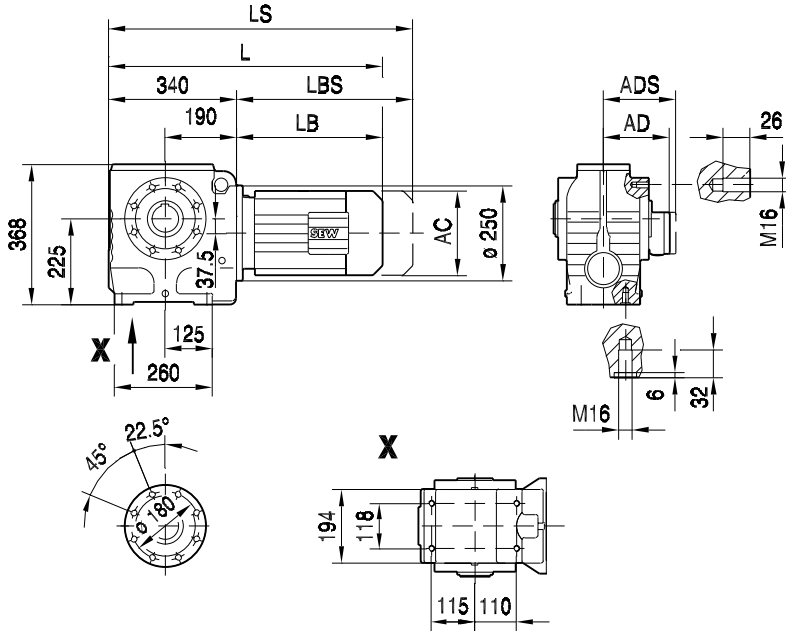


SA87..

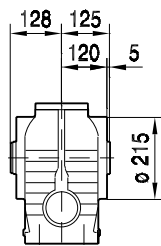



SH87..

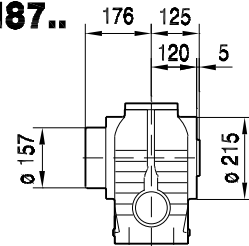


Ø 70 H7

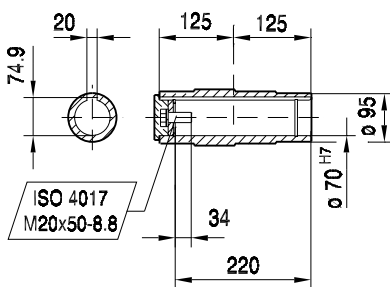

Ø 60 H7


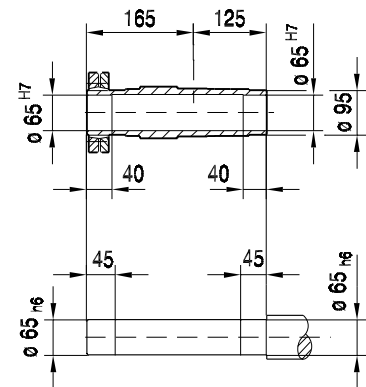
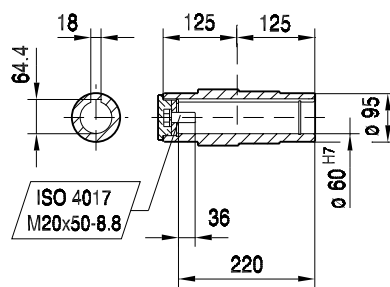


(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L
AC	145	197	197	197	221	221	275	275	275	331
AD	122	154	166	166	179	179	230	230	230	258
ADS	127	161	166	166	182	182	230	230	230	258
L	578	597	647	677	680	725	747	807	807	854
LS	642	682	732	762	760	805	859	919	919	1010
LB	238	257	307	337	340	385	407	467	467	514
LBS	302	342	392	422	420	465	519	579	579	670

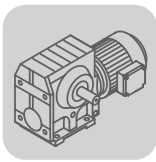


28 012 03 00


SAZ87..

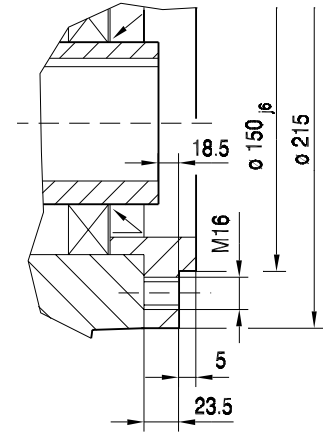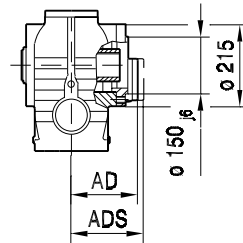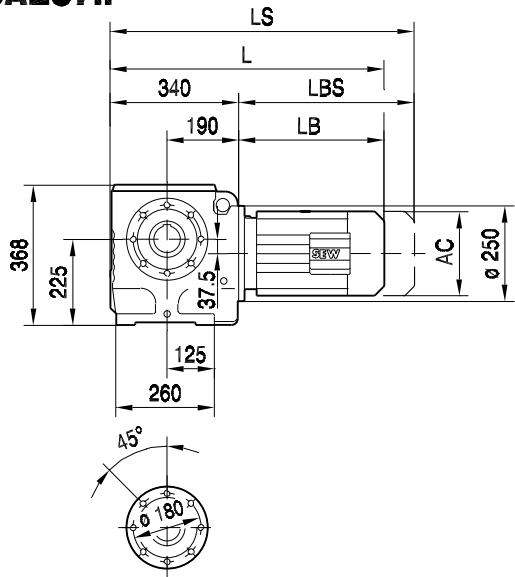


SAZ87..

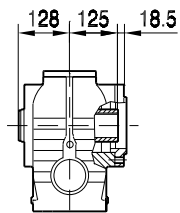



SHZ87..

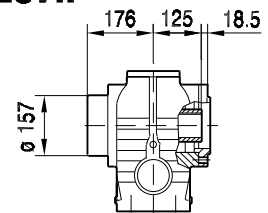


Ø 70 H7

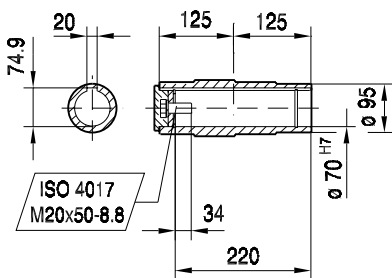

Ø 60 H7




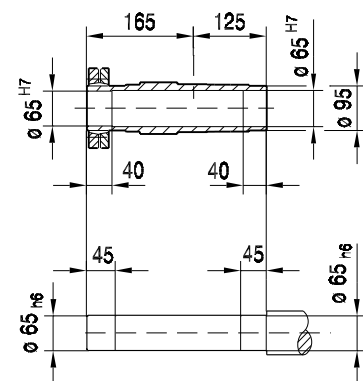
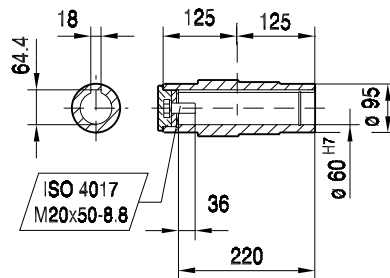


(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L
AC	145	197	197	197	221	221	275	275	275	331
AD	122	154	166	166	179	179	230	230	230	258
ADS	127	161	166	166	182	182	230	230	230	258
L	578	597	647	677	680	725	747	807	807	854
LS	642	682	732	762	760	805	859	919	919	1010
LB	238	257	307	337	340	385	407	467	467	514
LBS	302	342	392	422	420	465	519	579	579	670

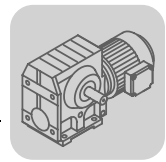


02 010 00 03

ST87..

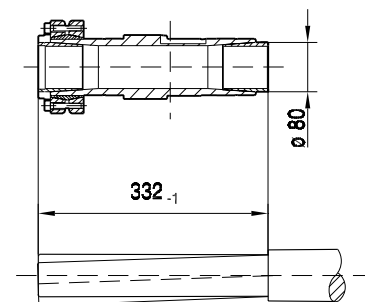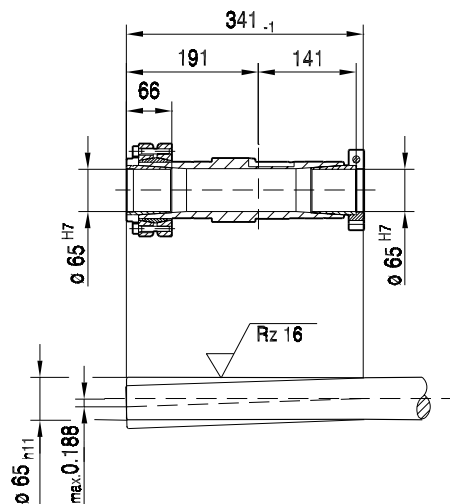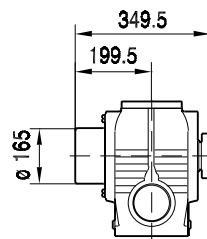
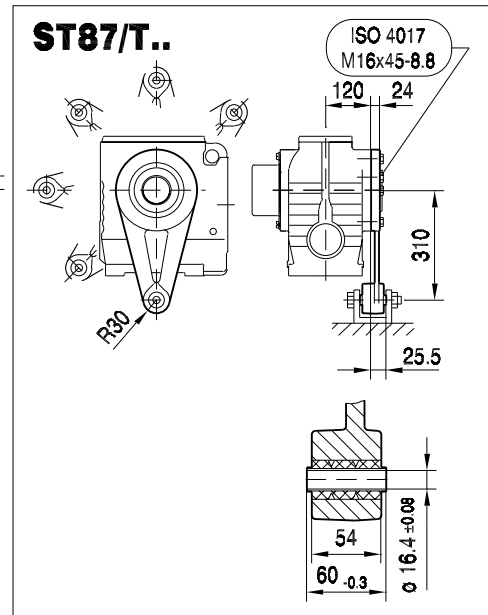
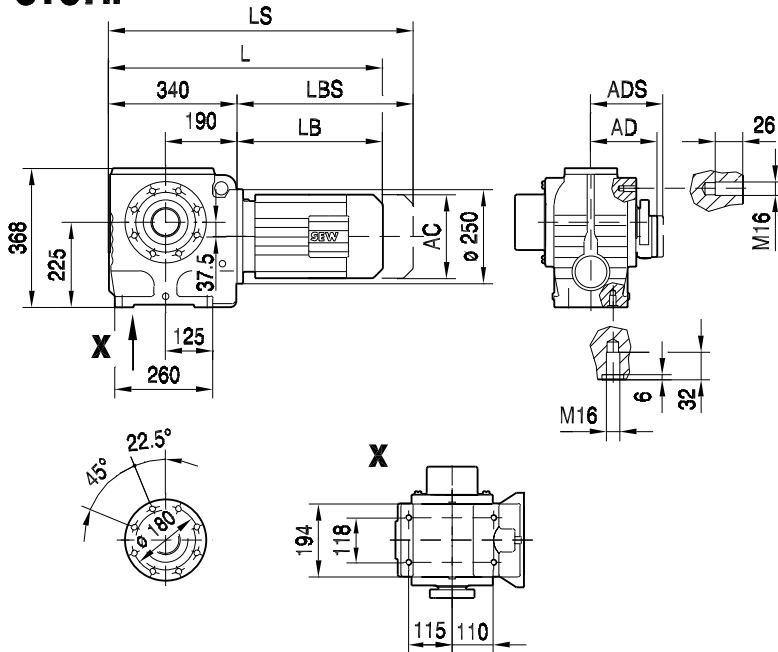


12


(→ 102)	DT80..	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L
AC	145	197	197	197	221	221	275	275	275	331
AD	122	154	166	166	179	179	230	230	230	258
ADS	127	161	166	166	182	182	230	230	230	258
L	578	597	647	677	680	725	747	807	807	854
LS	642	682	732	762	760	805	859	919	919	1010
LB	238	257	307	337	340	385	407	467	467	514
LBS	302	342	392	422	420	465	519	579	579	670

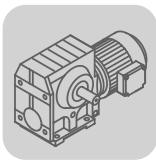

05 013 03 00

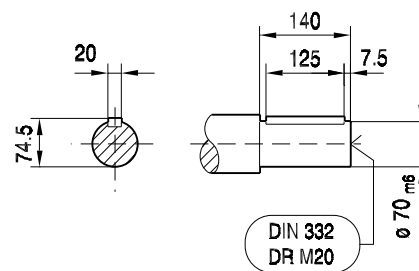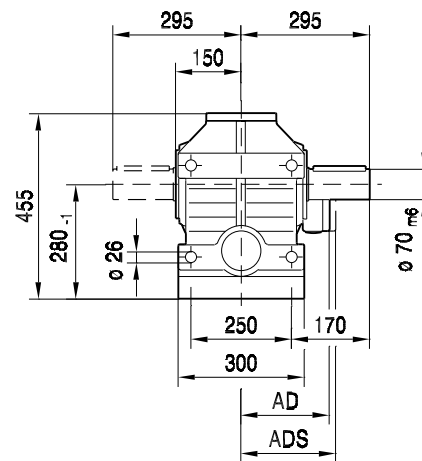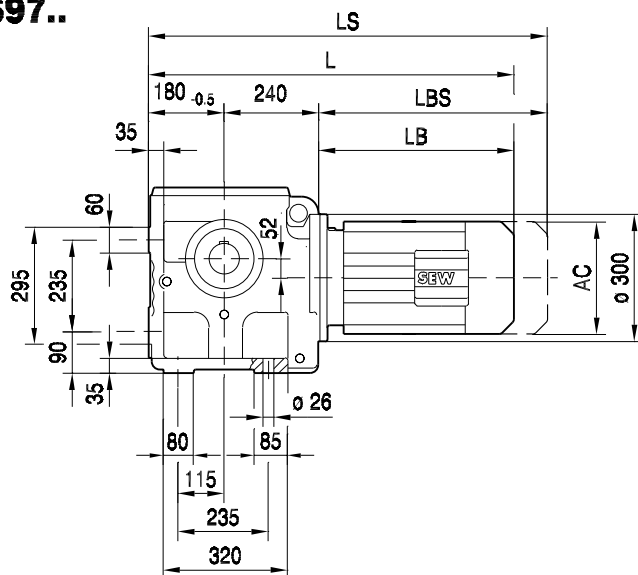
S97..

(→ 102)	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L	DV180..	
AC	197	197	197	221	221	275	275	275	331	331	
AD	154	166	166	179	179	230	230	230	258	258	
ADS	161	166	166	182	182	230	230	230	258	258	
L	671	721	751	755	800	822	882	882	929	1001	
LS	756	806	836	835	880	934	994	994	1085	1157	
LB	251	301	331	335	380	402	462	462	509	581	
LBS	336	386	416	415	460	514	574	574	665	737	

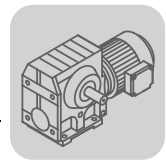


SF97..

05 020 03 00

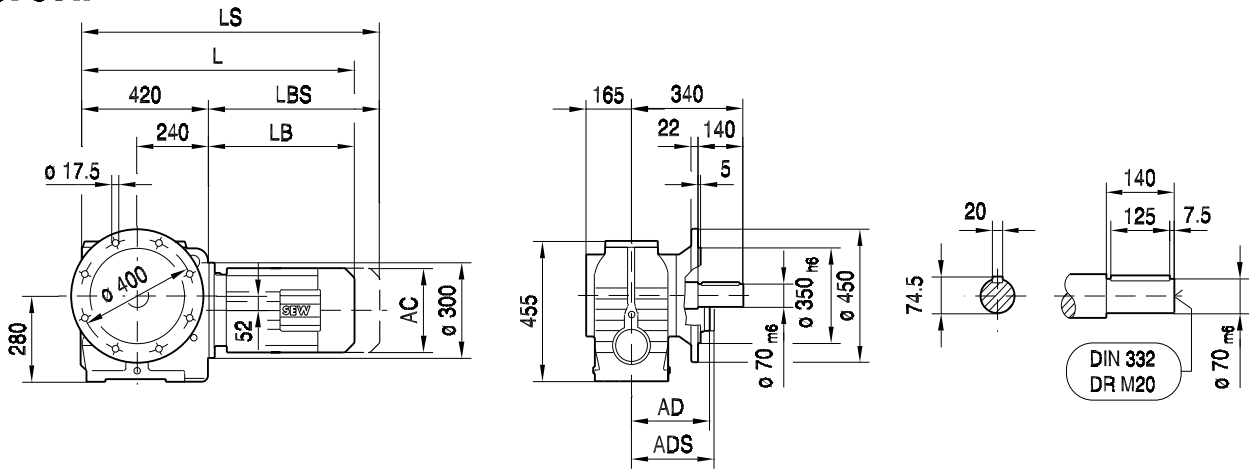


SAF97..

SHF97..

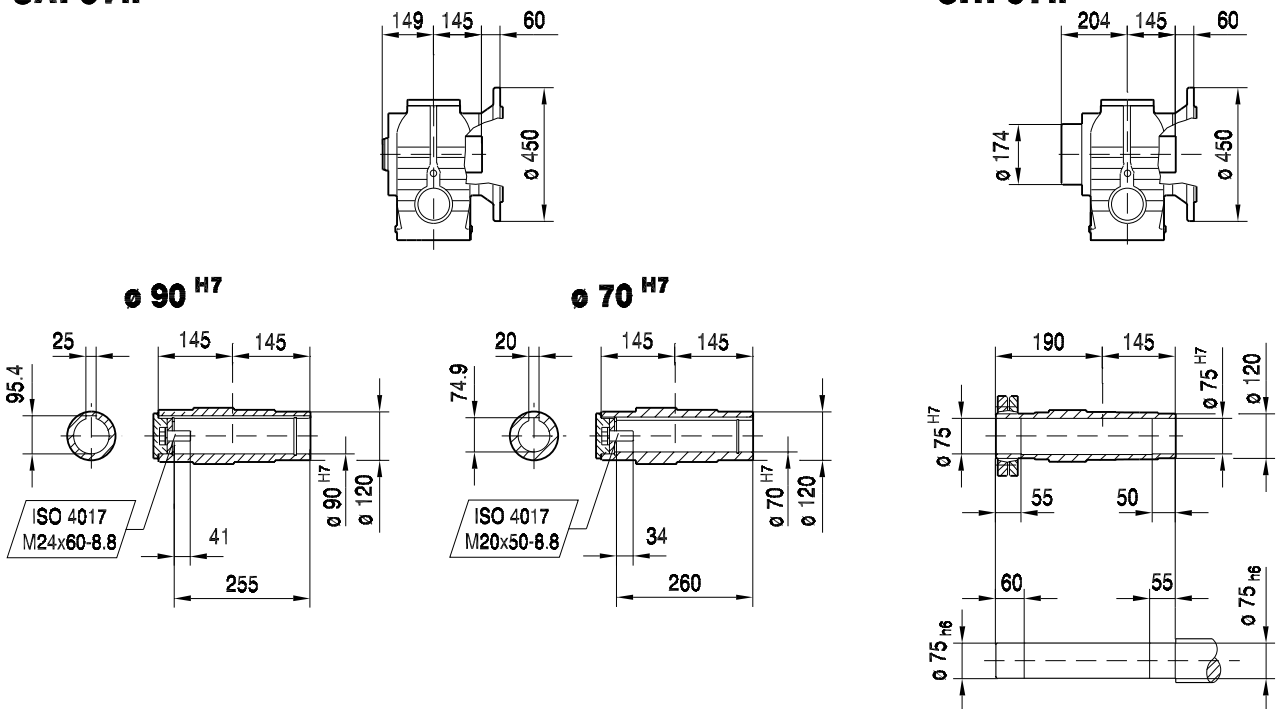



12

(→ 102)	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L	DV180..
AC	197	197	197	221	221	275	275	275	331	331
AD	154	166	166	179	179	230	230	230	258	258
ADS	161	166	166	182	182	230	230	230	258	258
L	671	721	751	755	800	822	882	882	929	1001
LS	756	806	836	835	880	934	994	994	1085	1157
LB	251	301	331	335	380	402	462	462	509	581
LBS	336	386	416	415	460	514	574	574	665	737

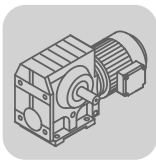


28 007 03 00


SA97..

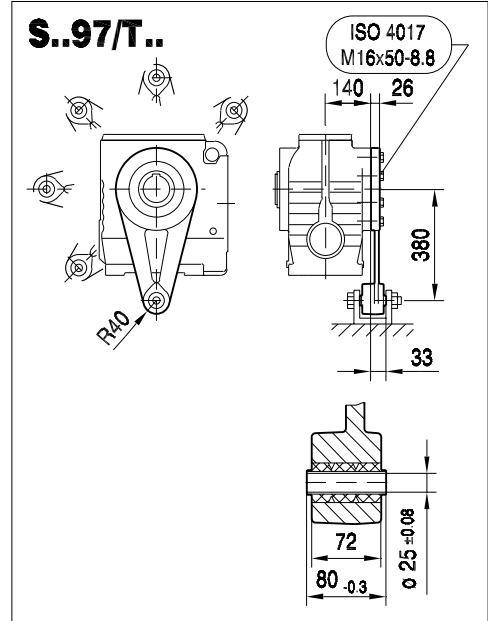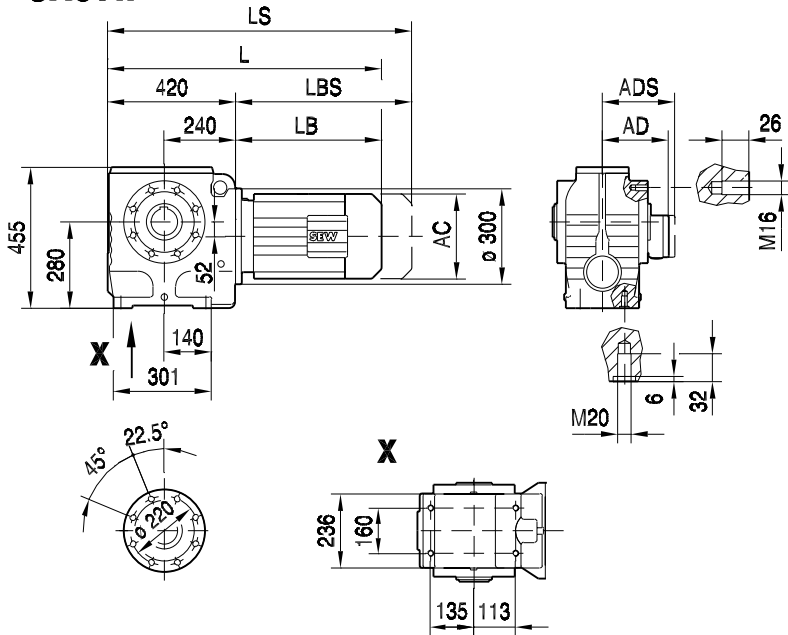


SA97..

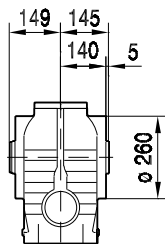



SH97..

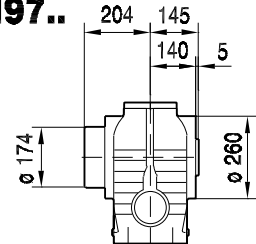


∅ 90 H7

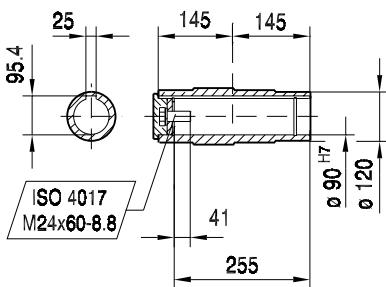

∅ 70 H7


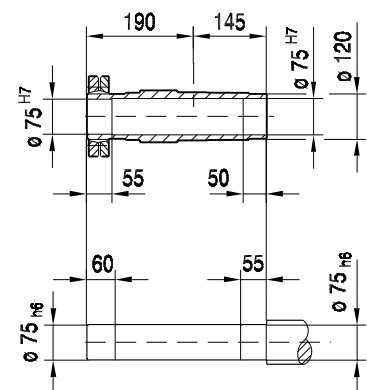
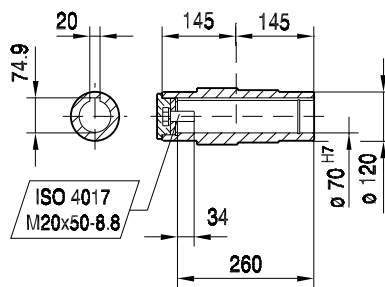


(→ 102)	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L	DV180..
AC	197	197	197	221	221	275	275	275	331	331
AD	154	166	166	179	179	230	230	230	258	258
ADS	161	166	166	182	182	230	230	230	258	258
L	671	721	751	755	800	822	882	882	929	1001
LS	756	806	836	835	880	934	994	994	1085	1157
LB	251	301	331	335	380	402	462	462	509	581
LBS	336	386	416	415	460	514	574	574	665	737

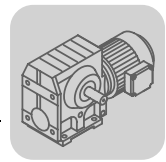


SAZ97..


28 013 03 00

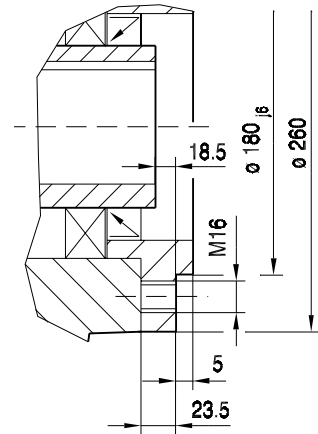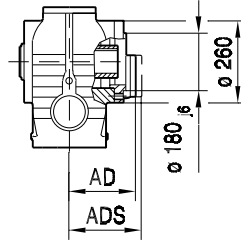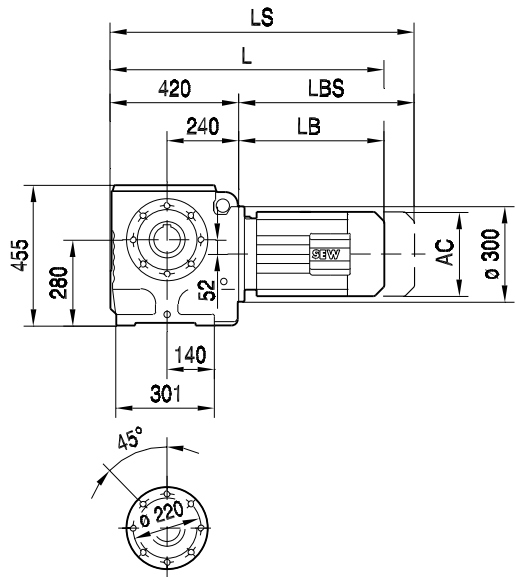

SAZ97..



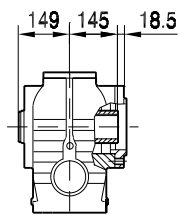


SHZ97..

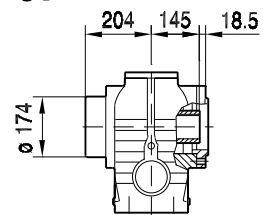


ø 90 H7

ø 70 H7

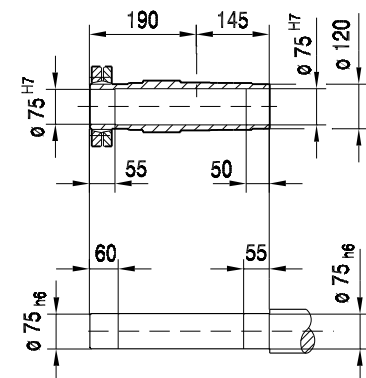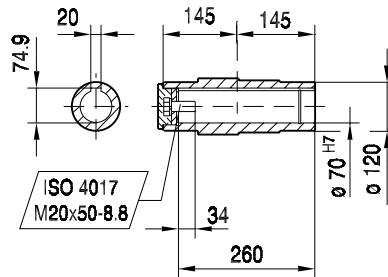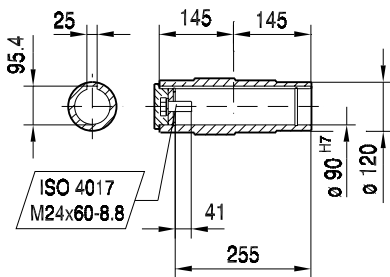


12


(→ 102)	DT90..	DV100M	DV100L	DV112M	DV132S	DV132M	DV132ML	DV160M	DV160L	DV180..
AC	197	197	197	221	221	275	275	275	331	331
AD	154	166	166	179	179	230	230	230	258	258
ADS	161	166	166	182	182	230	230	230	258	258
L	671	721	751	755	800	822	882	882	929	1001
LS	756	806	836	835	880	934	994	994	1085	1157
LB	251	301	331	335	380	402	462	462	509	581
LBS	336	386	416	415	460	514	574	574	665	737

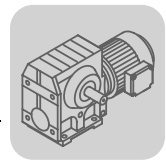

05 021 02 00

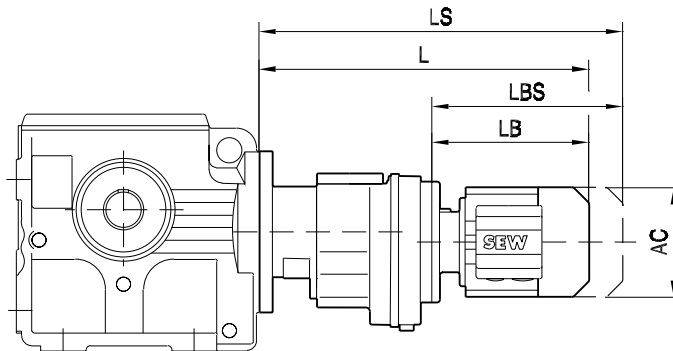


(→ 102)		AC	L	LS	LB	LBS
S..37R17	DR63..	132	324	379	149	204
	DT71D	145	339	403	164	228
	DT80..	145	389	453	214	278
S..47R17 S..57R17	DR63..	132	324	379	149	204
	DT71D	145	339	403	164	228
	DT80..	145	389	453	214	278
S..67R37	DR63..	132	356	411	191	246
	DT71D	145	371	435	206	270
	DT80..	145	421	485	256	320
S..77R37	DR63..	132	348	403	191	246
	DT71D	145	363	427	206	270
	DT80..	145	413	477	256	320
	DT90..	197	433	518	276	361
S..87R57	DR63..	132	401	456	185	240
	DT71D	145	415	479	199	263
	DT80..	145	465	529	249	313
	DT90..	197	485	570	269	354
	DV100M	197	535	620	319	404
	DV100L	197	565	650	349	434
S..97R57	DR63..	132	396	451	185	240
	DT71D	145	410	474	199	263
	DT80..	145	460	524	249	313
	DT90..	197	480	565	269	354
	DV100M	197	530	615	319	404
	DV100L	197	560	645	349	434
	DV112M	221	565	645	354	434

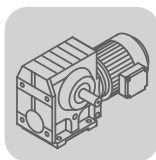
12.6 S, SF, SA, SAF 37
3400 - 2800 1/min
02 955 097

i_{ges}	i_{sch}	$n_e = 3400 \text{ 1/min}$				$n_e = 3200 \text{ 1/min}$				$n_e = 2800 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
157.43	38/1	22	78	0.31	57	20	80	0.30	57	18	82	0.27	57
144.40		24	76	0.33	58	22	78	0.31	58	19	80	0.28	57
122.94		28	74	0.37	58	26	75	0.35	58	23	78	0.32	58
106.00		32	71	0.41	59	30	72	0.39	59	26	76	0.36	59
98.80		34	70	0.43	59	32	72	0.41	59	28	75	0.38	59
86.36		39	68	0.47	60	37	69	0.45	60	32	72	0.41	60
80.96		42	66	0.49	60	40	68	0.47	60	35	72	0.43	60
71.44		48	55	0.47	58	45	64	0.50	60	39	70	0.47	61
63.33		54	37	0.41	51	51	51	0.47	57	44	67	0.51	61
53.83		63	29	0.39	49	59	32	0.40	50	52	53	0.49	59
55.93		61	70	0.58	77	57	71	0.56	76	50	72	0.50	76
51.30	27/2	66	68	0.61	77	62	70	0.60	77	55	72	0.54	76
43.68		78	66	0.70	77	73	67	0.67	77	64	70	0.61	77
37.66		90	64	0.78	78	85	65	0.74	78	74	68	0.68	78
35.10		97	62	0.81	78	91	64	0.78	78	80	66	0.71	78
30.68		111	61	0.90	78	104	62	0.87	78	91	64	0.78	78
28.76		118	58	0.92	78	111	61	0.91	78	97	64	0.83	78
25.38		134	47	0.86	77	126	53	0.90	78	110	62	0.91	79
22.50		151	31	0.69	71	142	43	0.84	76	124	57	0.94	79
19.13		178	24	0.65	69	167	27	0.67	70	146	44	0.87	77
19.89		171	42	0.88	86	161	43	0.85	86	141	44	0.76	86
18.24		186	41	0.93	86	175	42	0.90	86	154	44	0.83	86
15.53	24/5	219	39	1.0	86	206	40	1.0	86	180	42	0.92	86
13.39		254	37	1.1	86	239	39	1.1	86	209	41	1.0	86
12.48		272	37	1.2 *	86	256	38	1.2 *	86	224	40	1.1	86
10.91		312	35	1.3 *	86	293	36	1.3 *	86	257	39	1.2 *	87
10.23		332	35	1.4 *	87	313	36	1.4 *	87	274	38	1.3 *	87
9.02		377	31	1.4 *	86	355	34	1.5 *	87	310	36	1.3 *	87
8.00		425	20	1.1	82	400	29	1.4 *	86	350	35	1.5 *	87
6.80		500	16	1.0	81	471	18	1.1	82	412	29	1.4 *	86

 * $P_{emax} = 1.1 \text{ kW}$

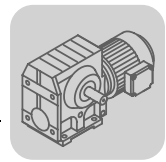


2200 - 1400 1/min

02 955 097

i_{ges}	i_{sch}	$n_e = 2200 \text{ 1/min}$				$n_e = 1700 \text{ 1/min}$				$n_e = 1400 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
157.43	38/1	14	87	0.23	56	11	91	0.19	54	8.9	92	0.16	53
144.40		15	86	0.24	56	12	90	0.20	55	9.7	92	0.17	54
122.94		18	83	0.27	57	14	87	0.22	56	11	91	0.20	55
106.00		21	81	0.30	58	16	86	0.25	57	13	88	0.22	56
98.80		22	80	0.32	58	17	85	0.27	57	14	87	0.23	56
86.36		25	78	0.35	59	20	82	0.29	58	16	86	0.25	57
80.96		27	77	0.37	60	21	82	0.31	59	17	85	0.27	58
71.44		31	75	0.40	60	24	80	0.33	60	20	84	0.29	59
63.33		35	73	0.44	61	27	79	0.37	60	22	82	0.32	60
53.83		41	69	0.48	62	32	76	0.41	61	26	80	0.36	61
55.93	27/2	39	77	0.42	75	30	81	0.35	74	25	81	0.29	73
51.30		43	76	0.45	76	33	80	0.37	75	27	81	0.31	74
43.68		50	74	0.51	76	39	78	0.42	76	32	81	0.36	75
37.66		58	72	0.57	77	45	76	0.47	76	37	79	0.41	76
35.10		63	71	0.60	77	48	75	0.50	77	40	78	0.43	76
30.68		72	70	0.67	78	55	73	0.55	77	46	76	0.47	76
28.76		76	68	0.70	78	59	73	0.58	77	49	75	0.50	77
25.38		87	67	0.77	79	67	71	0.64	78	55	74	0.55	77
22.50		98	66	0.85	79	76	70	0.70	79	62	73	0.61	78
19.13		115	63	0.95	80	89	68	0.80	79	73	71	0.69	79
19.89	24/5	111	48	0.65	85	85	50	0.53	85	70	52	0.46	84
18.24		121	47	0.70	85	93	49	0.56	85	77	52	0.50	84
15.53		142	45	0.78	86	109	48	0.64	85	90	50	0.56	85
13.39		164	44	0.88	86	127	47	0.73	86	105	49	0.63	85
12.48		176	43	0.92	86	136	46	0.76	86	112	48	0.66	86
10.91		202	42	1.0	87	156	45	0.85	86	128	48	0.75	86
10.23		215	41	1.1	87	166	45	0.90	87	137	47	0.78	86
9.02		244	40	1.2 *	87	188	43	0.98	87	155	46	0.86	87
8.00		275	39	1.3 *	87	213	43	1.1	87	175	45	0.95	87
6.80		324	37	1.4 *	88	250	41	1.2 *	88	206	43	1.1	87


* $P_{emax} = 1.1 \text{ kW}$

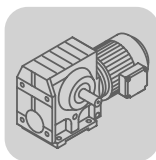

1100 - 700 1/min

02 956 097


i_{ges}	i_{sch}	$n_e = 1100 \text{ 1/min}$				$n_e = 900 \text{ 1/min}$				$n_e = 700 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
157.43	38/1	7.0	92	0.13	52	5.7	92	0.11	50	4.4	92	0.09	49
144.40		7.6	92	0.14	52	6.2	92	0.12	51	4.8	92	0.09	50
122.94		8.9	92	0.16	54	7.3	92	0.14	52	5.7	92	0.11	51
106.00		10	92	0.18	55	8.5	92	0.15	53	6.6	92	0.12	52
98.80		11	92	0.19	55	9.1	92	0.16	54	7.1	92	0.13	52
86.36		13	90	0.21	56	10	92	0.18	55	8.1	92	0.15	53
80.96		14	89	0.22	57	11	92	0.19	55	8.6	92	0.16	54
71.44		15	87	0.24	57	13	91	0.21	56	9.8	92	0.17	55
63.33		17	86	0.27	58	14	89	0.23	57	11	92	0.19	56
53.83		20	84	0.30	60	17	87	0.26	58	13	91	0.22	57
55.93	27/2	20	87	0.25	72	16	91	0.21	71	13	92	0.17	70
51.30		21	87	0.27	73	18	90	0.23	72	14	92	0.19	71
43.68		25	84	0.30	74	21	87	0.26	73	16	92	0.22	71
37.66		29	82	0.34	75	24	86	0.29	74	19	89	0.24	72
35.10		31	82	0.36	75	26	84	0.31	74	20	88	0.25	73
30.68		36	80	0.40	76	29	82	0.34	75	23	87	0.28	74
28.76		38	79	0.42	76	31	82	0.36	75	24	86	0.30	74
25.38		43	78	0.46	77	35	81	0.40	76	28	84	0.33	75
22.50		49	77	0.51	77	40	79	0.43	76	31	82	0.36	75
19.13		58	75	0.58	78	47	78	0.50	77	37	81	0.41	76
19.89	24/5	55	55	0.38	83	45	58	0.33	83	35	60	0.27	82
18.24		60	54	0.41	84	49	56	0.35	83	38	60	0.29	82
15.53		71	53	0.47	84	58	55	0.40	84	45	58	0.33	83
13.39		82	52	0.53	85	67	54	0.45	84	52	56	0.37	83
12.48		88	51	0.55	85	72	53	0.47	84	56	55	0.39	84
10.91		101	50	0.62	86	82	52	0.53	85	64	54	0.43	84
10.23		108	49	0.64	86	88	51	0.55	85	68	54	0.46	84
9.02		122	48	0.71	86	100	50	0.61	86	78	53	0.51	85
8.00		138	47	0.78	87	113	49	0.67	86	88	52	0.56	85
6.80		162	46	0.90	87	132	48	0.77	87	103	51	0.64	86

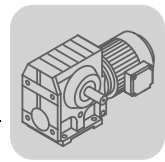

500 - 10 1/min


02 956 097

i_{ges}	i_{sch}	$n_e = 500 \text{ 1/min}$				$n_e = 250 \text{ 1/min}$				$n_e = 10 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
157.43	38/1	3.2	92	0.06	47	1.6	92	0.033	46	0.06	92	< 0.05	26
144.40		3.5	92	0.07	48	1.7	92	0.036	46	0.07	92	< 0.05	27
122.94		4.1	92	0.08	49	2.0	92	0.042	46	0.08	92	< 0.05	29
106.00		4.7	92	0.09	50	2.4	92	0.049	47	0.09	92	< 0.05	30
98.80		5.1	92	0.10	50	2.5	92	0.05	47	0.10	92	< 0.05	31
86.36		5.8	92	0.11	51	2.9	92	0.06	47	0.12	92	< 0.05	32
80.96		6.2	92	0.12	51	3.1	92	0.06	47	0.12	92	< 0.05	33
71.44		7.0	92	0.13	52	3.5	92	0.07	48	0.14	92	< 0.05	35
63.33		7.9	92	0.14	53	3.9	92	0.08	49	0.16	92	< 0.05	37
53.83		9.3	92	0.16	55	4.6	92	0.09	50	0.19	92	< 0.05	39
55.93	27/2	8.9	92	0.13	69	4.5	92	0.06	67	0.18	92	< 0.05	48
51.30		9.7	92	0.14	69	4.9	92	0.07	67	0.19	92	< 0.05	49
43.68		11	92	0.16	70	5.7	92	0.08	67	0.23	92	< 0.05	51
37.66		13	92	0.18	71	6.6	92	0.10	67	0.27	92	< 0.05	53
35.10		14	92	0.19	71	7.1	92	0.10	68	0.28	92	< 0.05	54
30.68		16	92	0.22	72	8.1	92	0.11	68	0.33	92	< 0.05	56
28.76		17	91	0.23	72	8.7	92	0.12	69	0.35	92	< 0.05	57
25.38		20	89	0.25	73	9.9	92	0.14	69	0.39	92	< 0.05	59
22.50		22	87	0.28	74	11	92	0.15	70	0.44	92	< 0.05	61
19.13		26	85	0.31	75	13	92	0.18	71	0.52	92	< 0.05	62
19.89	24/5	25	68	0.22	81	13	72	0.12	79	0.50	72	< 0.05	65
18.24		27	66	0.23	81	14	72	0.13	79	0.55	72	< 0.05	66
15.53		32	63	0.26	82	16	72	0.15	79	0.64	72	< 0.05	68
13.39		37	61	0.29	82	19	72	0.18	80	0.75	72	< 0.05	71
12.48		40	59	0.30	82	20	72	0.19	80	0.80	72	< 0.05	72
10.91		46	58	0.34	83	23	71	0.21	81	0.92	71	< 0.05	73
10.23		49	57	0.35	83	24	70	0.22	81	0.98	70	< 0.05	73
9.02		55	56	0.39	84	28	66	0.24	81	1.1	66	< 0.05	74
8.00		63	55	0.43	84	31	63	0.25	82	1.2	63	< 0.05	74
6.80		74	54	0.49	85	37	61	0.29	82	1.5	61	< 0.05	75

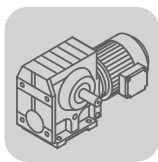
12.7 S, SF, SA, SAF 47
3400 - 2800 1/min
02 957 097

i_{ges}	i_{sch}	$n_e = 3400 \text{ 1/min}$				$n_e = 3200 \text{ 1/min}$				$n_e = 2800 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
201.00	42/1	17	150	0.44	60	16	150	0.42	60	14	150	0.37	59
184.80		18	150	0.48	60	17	150	0.45	60	15	150	0.40	59
158.12		22	150	0.55	61	20	150	0.52	61	18	150	0.46	60
137.05		25	150	0.63	62	23	150	0.59	62	20	150	0.52	61
128.10		27	150	0.67	63	25	150	0.63	62	22	150	0.56	62
110.73		31	138	0.70	63	29	148	0.71	63	25	150	0.63	63
94.08		36	113	0.69	62	34	123	0.70	63	30	146	0.72	63
84.00		40	95	0.66	61	38	107	0.69	62	33	130	0.71	63
71.75		47	58	0.55	53	45	82	0.64	60	39	107	0.70	63
67.20		51	53	0.54	52	48	68	0.60	57	42	99	0.69	62
56.61		60	40	0.51	49	57	46	0.53	51	49	75	0.65	60
69.39		49	140	0.91	79	46	140	0.86	78	40	140	0.76	78
63.80	53	140	0.99	79	50	140	0.93	79	44	140	0.82	78	
54.59	62	140	1.1	80	59	140	1.1	79	51	140	0.95	79	
47.32	72	139	1.3	80	68	140	1.2	80	59	140	1.1	80	
44.22	77	129	1.3	80	72	139	1.3	80	63	140	1.2	80	
38.23	29/2	89	112	1.3	80	84	120	1.3	80	73	139	1.3	80
32.48		105	91	1.3	79	99	100	1.3	80	86	117	1.3	80
29.00	117	76	1.2	78	110	86	1.3	79	97	104	1.3	80	
24.77	137	47	0.94	72	129	66	1.2	77	113	87	1.3	80	
23.20	147	42	0.90	71	138	54	1.0	75	121	79	1.3	79	
19.54	174	32	0.84	69	164	37	0.89	71	143	59	1.1	77	
20.33	167	100	2.0 *	88	157	100	1.9 *	88	138	100	1.6 *	88	
17.62	193	97	2.2 *	88	182	100	2.2 *	88	159	100	1.9 *	88	
16.47	206	90	2.2 *	88	194	97	2.2 *	88	170	100	2.0 *	88	
14.24	239	78	2.2 *	88	225	83	2.2 *	88	197	97	2.3 *	88	
12.10	27/5	281	63	2.1 *	88	264	69	2.2 *	88	231	82	2.2 *	88
10.80		315	53	2.0 *	87	296	60	2.1 *	88	259	72	2.2 *	88
9.23	368	32	1.5	83	347	45	1.9 *	86	303	60	2.2 *	88	
8.64	394	29	1.5	82	370	37	1.7 *	85	324	55	2.1 *	88	
7.28	467	22	1.3	81	440	25	1.4	82	385	41	1.9 *	86	

 * $P_{emax} = 1.5 \text{ kW}$

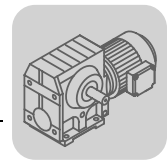


2200 - 1400 1/min

02 957 097

i_{ges}	i_{sch}	$n_e = 2200 \text{ 1/min}$				$n_e = 1700 \text{ 1/min}$				$n_e = 1400 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
201.00	42/1	11	167	0.33	58	8.5	170	0.27	56	7.0	170	0.23	55
184.80		12	167	0.36	58	9.2	168	0.29	57	7.6	170	0.24	56
158.12		14	167	0.41	60	11	168	0.33	58	8.9	170	0.28	57
137.05		16	165	0.46	60	12	167	0.37	59	10	168	0.31	58
128.10		17	165	0.49	61	13	167	0.39	59	11	168	0.33	58
110.73		20	165	0.55	62	15	167	0.44	61	13	168	0.38	59
94.08		23	165	0.64	63	18	167	0.51	62	15	168	0.43	60
84.00		26	162	0.70	64	20	167	0.57	62	17	167	0.48	61
71.75		31	145	0.73	64	24	167	0.65	63	20	167	0.55	62
67.20		33	137	0.73	64	25	164	0.68	64	21	167	0.58	63
56.61		39	115	0.73	64	30	152	0.74	65	25	165	0.67	64
69.39		32	155	0.67	77	24	155	0.52	76	20	155	0.44	75
63.80		34	155	0.72	77	27	155	0.57	76	22	155	0.47	75
54.59		40	155	0.84	78	31	155	0.66	77	26	155	0.55	76
47.32		46	155	0.96	79	36	155	0.75	78	30	155	0.63	77
44.22	29/2	50	155	1.0	79	38	155	0.80	78	32	155	0.67	77
38.23		58	154	1.2	80	44	155	0.92	79	37	155	0.76	78
32.48		68	146	1.3	80	52	155	1.1	80	43	155	0.89	79
29.00		76	137	1.3	81	59	154	1.2	80	48	155	0.99	79
24.77		89	117	1.3	81	69	145	1.3	81	57	155	1.1	80
23.20		95	111	1.4	81	73	142	1.3	81	60	152	1.2	80
19.54		113	92	1.3	81	87	123	1.4	81	72	144	1.3	81
20.33		108	109	1.4	87	84	110	1.1	87	69	110	0.92	86
17.62		125	108	1.6 *	88	96	109	1.3	87	79	110	1.1	86
16.47		134	108	1.7 *	88	103	109	1.4	87	85	110	1.1	87
14.24	27/5	154	108	2.0 *	88	119	109	1.6 *	88	98	110	1.3	87
12.10		182	105	2.3 *	89	140	109	1.8 *	88	116	109	1.5	88
10.80		204	95	2.3 *	89	157	108	2.0 *	88	130	109	1.7 *	88
9.23		238	82	2.3 *	89	184	105	2.3 *	89	152	109	2.0 *	88
8.64		255	77	2.3 *	89	197	100	2.3 *	89	162	109	2.1 *	88
7.28		302	64	2.3 *	89	234	86	2.4 *	89	192	103	2.3 *	89

* $P_{emax} = 1.5 \text{ kW}$

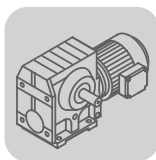


1100 - 700 1/min

02 958 097

i_{ges}	i_{sch}	$n_e = 1100 \text{ 1/min}$				$n_e = 900 \text{ 1/min}$				$n_e = 700 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
201.00	42/1	5.5	176	0.19	53	4.5	180	0.16	52	3.5	185	0.13	51
184.80		6.0	174	0.20	54	4.9	178	0.17	53	3.8	183	0.14	51
158.12		7.0	172	0.23	55	5.7	176	0.20	54	4.4	180	0.16	52
137.05		8.0	171	0.26	56	6.6	172	0.22	55	5.1	178	0.18	53
128.10		8.6	171	0.27	57	7.0	172	0.23	55	5.5	176	0.19	54
110.73		9.9	169	0.30	58	8.1	171	0.26	56	6.3	174	0.21	55
94.08		12	169	0.35	59	9.6	171	0.30	57	7.4	172	0.24	56
84.00		13	169	0.39	60	11	169	0.32	58	8.3	171	0.26	57
71.75		15	169	0.45	61	13	169	0.37	60	9.8	171	0.30	58
67.20		16	169	0.47	61	13	169	0.40	60	10	171	0.32	58
56.61	19	169	0.55	63	16	169	0.46	61	12	171	0.37	60	
69.39	29/2	16	173	0.39	74	13	176	0.33	73	10	180	0.27	71
63.80		17	173	0.42	74	14	175	0.35	73	11	180	0.29	72
54.59		20	171	0.48	75	16	173	0.40	74	13	176	0.33	73
47.32		23	171	0.55	76	19	173	0.46	75	15	175	0.37	73
44.22		25	171	0.58	76	20	171	0.49	75	16	175	0.39	74
38.23		29	169	0.66	77	24	171	0.56	76	18	173	0.44	75
32.48		34	169	0.77	78	28	171	0.65	77	22	171	0.51	75
29.00		38	170	0.86	78	31	171	0.72	77	24	171	0.57	76
24.77		44	169	0.99	79	36	170	0.83	78	28	171	0.66	77
23.20		47	164	1.0	79	39	170	0.88	79	30	171	0.70	77
19.54	56	154	1.1	80	46	165	1.0	79	36	170	0.81	78	
20.33	27/5	54	112	0.75	85	44	114	0.63	84	34	116	0.50	83
17.62		62	112	0.86	86	51	113	0.71	85	40	115	0.57	84
16.47		67	112	0.91	86	55	113	0.76	85	43	114	0.60	84
14.24		77	111	1.0	86	63	112	0.86	86	49	113	0.69	85
12.10		91	111	1.2	87	74	111	1.0	86	58	113	0.80	85
10.80		102	111	1.4	87	83	111	1.1	87	65	112	0.88	86
9.23		119	110	1.6 *	88	98	111	1.3	87	76	112	1.0	86
8.64		127	109	1.7 *	88	104	111	1.4	87	81	112	1.1	87
7.28		151	109	2.0 *	88	124	111	1.6 *	88	96	111	1.3	87


* $P_{emax} = 1.5 \text{ kW}$

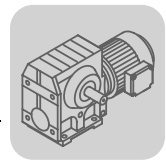

500 - 10 1/min

02 958 097

i _{ges}	i _{sch}	n _e = 500 1/min				n _e = 250 1/min				n _e = 10 1/min			
		n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]	n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]	n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]
201.00	42/1	2.5	185	0.10	49	1.2	185	0.05	48	0.05	185	< 0.05	32
184.80		2.7	185	0.11	49	1.4	185	0.05	48	0.05	185	< 0.05	32
158.12		3.2	185	0.12	50	1.6	185	0.06	48	0.06	185	< 0.05	35
137.05		3.6	185	0.14	51	1.8	185	0.07	48	0.07	185	< 0.05	37
128.10		3.9	183	0.15	51	2.0	185	0.08	48	0.08	185	< 0.05	38
110.73		4.5	181	0.16	52	2.3	185	0.09	49	0.09	185	< 0.05	40
94.08		5.3	178	0.19	54	2.7	185	0.10	49	0.11	185	< 0.05	42
84.00		6.0	176	0.20	54	3.0	185	0.12	50	0.12	185	< 0.05	43
71.75		7.0	174	0.23	56	3.5	185	0.13	51	0.14	185	< 0.05	44
67.20		7.4	172	0.24	56	3.7	185	0.14	51	0.15	185	< 0.05	44
56.61		8.8	172	0.28	57	4.4	181	0.16	53	0.18	181	< 0.05	45
69.39		7.2	185	0.20	70	3.6	185	0.10	68	0.14	185	< 0.05	56
63.80		7.8	185	0.22	70	3.9	185	0.11	68	0.16	185	< 0.05	57
54.59		9.2	185	0.25	71	4.6	185	0.13	68	0.18	185	< 0.05	60
47.32		11	181	0.28	72	5.3	185	0.15	68	0.21	185	< 0.05	61
44.22		11	180	0.30	72	5.7	185	0.16	69	0.23	185	< 0.05	62
38.23	29/2	13	178	0.33	73	6.5	185	0.18	69	0.26	185	< 0.05	63
32.48		15	174	0.38	74	7.7	185	0.21	70	0.31	185	< 0.05	64
29.00		17	174	0.42	74	8.6	185	0.24	71	0.34	185	< 0.05	65
24.77		20	172	0.48	75	10	183	0.27	71	0.40	183	< 0.05	66
23.20	22	172	0.51	76	11	181	0.28	72	0.43	181	< 0.05	66	
19.54	26	172	0.60	77	13	178	0.33	73	0.51	178	< 0.05	67	
20.33	25	124	0.39	82	12	157	0.25	80	0.49	157	< 0.05	75	
17.62	28	120	0.43	83	14	149	0.28	80	0.57	149	< 0.05	76	
16.47	30	118	0.45	83	15	145	0.29	81	0.61	145	< 0.05	76	
14.24	35	116	0.51	84	18	138	0.31	81	0.70	138	< 0.05	77	
12.10	27/5	41	115	0.59	84	21	131	0.35	82	0.83	131	< 0.05	77
10.80		46	114	0.65	85	23	127	0.37	82	0.93	127	< 0.05	77
9.23		54	113	0.75	85	27	121	0.41	83	1.1	121	< 0.05	78
8.64		58	113	0.80	86	29	120	0.44	83	1.2	120	< 0.05	78
7.28	69	112	0.93	86	34	117	0.50	84	1.4	117	< 0.05	78	

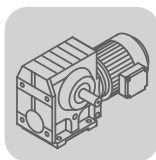

12.8 S, SF, SA, SAF 57

3400 - 2800 1/min

02 959 097

i_{ges}	i_{sch}	$n_e = 3400 \text{ 1/min}$				$n_e = 3200 \text{ 1/min}$				$n_e = 2800 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
201.00	42/1	17	270	0.75	64	16	270	0.71	63	14	270	0.63	62
184.80		18	270	0.81	64	17	270	0.77	64	15	270	0.68	63
158.12		22	270	0.93	65	20	270	0.88	65	18	270	0.78	64
137.05		25	255	1.0	66	23	270	1.0	66	20	270	0.89	65
128.10		27	245	1.0	66	25	255	1.0	66	22	270	0.94	65
110.73		31	215	1.0	67	29	230	1.0	67	25	255	1.0	66
94.08		36	184	1.0	67	34	196	1.0	67	30	225	1.1	67
84.00		40	165	1.0	67	38	175	1.0	67	33	200	1.0	67
71.75		47	139	1.0	67	45	149	1.0	67	39	174	1.1	67
67.20		51	128	1.0	66	48	139	1.0	67	42	164	1.1	67
56.61		60	103	1.0	65	57	114	1.0	66	49	138	1.1	67
69.39		49	220	1.4	81	46	220	1.3	80	40	220	1.2	80
63.80	53	220	1.5	81	50	220	1.4	81	44	220	1.3	80	
54.59	62	220	1.8	81	59	220	1.7	81	51	220	1.5	81	
47.32	72	210	1.9	82	68	220	1.9	82	59	220	1.7	81	
44.22	77	197	1.9	82	72	205	1.9	82	63	220	1.8	81	
38.23	29/2	89	174	2.0	82	84	184	2.0	82	73	205	1.9	82
32.48		105	148	2.0	82	99	157	2.0	82	86	180	2.0	82
29.00		117	131	2.0	82	110	141	2.0	82	97	162	2.0	82
24.77		137	111	1.9	82	129	120	2.0	82	113	139	2.0	82
23.20	147	102	1.9	82	138	111	2.0	82	121	131	2.0	82	
19.54	174	81	1.8	81	164	90	1.9	82	143	109	2.0	82	
20.33	167	160	3.2 *	89	157	160	3.0	89	138	160	2.6	88	
17.62	193	140	3.2 *	89	182	149	3.2 *	89	159	160	3.0	89	
16.47	206	132	3.2 *	89	194	140	3.2 *	89	170	158	3.2 *	89	
14.24	239	116	3.2 *	89	225	123	3.2 *	89	197	139	3.2 *	89	
12.10	27/5	281	99	3.3 *	89	264	105	3.3 *	89	231	121	3.3 *	89
10.80		315	88	3.3 *	89	296	94	3.3 *	89	259	108	3.3 *	89
9.23		368	73	3.2 *	89	347	79	3.2 *	89	303	93	3.3 *	89
8.64		394	68	3.2 *	89	370	74	3.2 *	89	324	87	3.3 *	89
7.28	467	54	3.0	88	440	60	3.1 *	89	385	72	3.2 *	89	

 * $P_{emax} = 3.0 \text{ kW}$

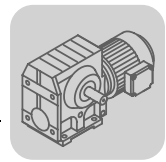


2200 - 1400 1/min

02 959 097

i_{ges}	i_{sch}	$n_e = 2200 \text{ 1/min}$				$n_e = 1700 \text{ 1/min}$				$n_e = 1400 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
201.00		11	295	0.55	61	8.5	295	0.44	59	7.0	295	0.37	58
184.80		12	295	0.60	62	9.2	295	0.48	60	7.6	295	0.40	58
158.12		14	295	0.69	63	11	295	0.55	61	8.9	295	0.46	60
137.05		16	295	0.78	64	12	295	0.62	62	10	295	0.52	61
128.10		17	295	0.83	64	13	295	0.66	62	11	295	0.55	61
110.73	42/1	20	290	0.93	65	15	295	0.75	63	13	295	0.63	62
94.08		23	275	1.0	66	18	300	0.88	65	15	295	0.73	63
84.00		26	250	1.0	67	20	285	0.93	65	17	295	0.80	64
71.75		31	220	1.1	67	24	275	1.0	66	20	290	0.91	65
67.20		33	210	1.1	67	25	260	1.0	67	21	285	0.95	65
56.61		39	179	1.1	68	30	225	1.1	67	25	265	1.0	67
69.39		32	245	1.0	79	24	245	0.81	77	20	245	0.68	76
63.80		34	245	1.1	79	27	245	0.88	78	22	245	0.73	77
54.59		40	245	1.3	80	31	245	1.0	79	26	245	0.85	78
47.32		46	245	1.5	81	36	245	1.2	79	30	245	0.97	79
44.22		50	245	1.6	81	38	245	1.2	80	32	245	1.0	79
38.23	29/2	58	245	1.8	81	44	245	1.4	80	37	245	1.2	80
32.48		68	225	1.9	82	52	245	1.7	81	43	245	1.4	80
29.00		76	200	1.9	82	59	245	1.8	81	48	245	1.5	81
24.77		89	177	2.0	82	69	220	1.9	82	57	245	1.8	81
23.20		95	167	2.0	83	73	210	2.0	82	60	245	1.9	82
19.54		113	143	2.0	83	87	183	2.0	83	72	215	2.0	82
20.33		108	168	2.2	88	84	168	1.7	87	69	168	1.4	87
17.62		125	168	2.5	88	96	168	1.9	88	79	168	1.6	87
16.47		134	169	2.7	88	103	168	2.1	88	85	168	1.7	87
14.24		154	169	3.1 *	89	119	169	2.4	88	98	169	2.0	88
12.10	27/5	182	150	3.2 *	89	140	169	2.8	89	116	169	2.3	88
10.80		204	136	3.2 *	89	157	169	3.1 *	89	130	169	2.6	88
9.23		238	119	3.3 *	89	184	149	3.2 *	89	152	169	3.0	89
8.64		255	112	3.3 *	89	197	141	3.3 *	89	162	166	3.2 *	89
7.28		302	96	3.4 *	90	234	122	3.3 *	90	192	146	3.3 *	89


* $P_{emax} = 3.0 \text{ kW}$

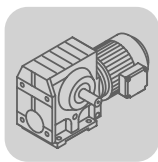

1100 - 700 1/min

02 960 097


i_{ges}	i_{sch}	$n_e = 1100 \text{ 1/min}$				$n_e = 900 \text{ 1/min}$				$n_e = 700 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
201.00		5.5	295	0.30	56	4.5	300	0.26	55	3.5	310	0.21	53
184.80		6.0	295	0.32	57	4.9	300	0.28	55	3.8	305	0.23	54
158.12		7.0	295	0.37	58	5.7	295	0.31	56	4.4	300	0.25	55
137.05		8.0	295	0.42	59	6.6	295	0.35	57	5.1	300	0.29	56
128.10		8.6	295	0.45	59	7.0	295	0.37	58	5.5	295	0.30	56
110.73	42/1	9.9	295	0.51	61	8.1	295	0.43	59	6.3	295	0.34	57
94.08		12	295	0.59	62	9.6	295	0.49	60	7.4	295	0.39	58
84.00		13	295	0.65	63	11	295	0.54	61	8.3	295	0.43	59
71.75		15	295	0.74	64	13	295	0.62	62	9.8	295	0.50	61
67.20		16	300	0.80	64	13	295	0.66	63	10	295	0.53	61
56.61		19	290	0.91	65	16	300	0.78	64	12	295	0.61	62
69.39		16	270	0.60	75	13	270	0.49	74	10	270	0.39	73
63.80		17	270	0.64	76	14	270	0.53	75	11	270	0.42	73
54.59		20	270	0.74	77	16	270	0.62	75	13	270	0.49	74
47.32		23	270	0.85	77	19	270	0.70	76	15	270	0.56	75
44.22		25	270	0.91	78	20	270	0.75	77	16	270	0.59	75
38.23	29/2	29	270	1.0	79	24	270	0.86	77	18	270	0.68	76
32.48		34	270	1.2	79	28	270	1.0	78	22	270	0.79	77
29.00		38	270	1.3	80	31	270	1.1	79	24	270	0.88	78
24.77		44	270	1.6	81	36	270	1.3	80	28	270	1.0	78
23.20		47	270	1.7	81	39	270	1.4	80	30	270	1.1	79
19.54		56	250	1.8	81	46	270	1.6	81	36	270	1.3	80
20.33		54	168	1.1	86	44	170	0.93	85	34	172	0.74	84
17.62		62	169	1.3	86	51	169	1.1	86	40	170	0.83	85
16.47		67	168	1.4	87	55	168	1.1	86	43	170	0.89	85
14.24		77	168	1.6	87	63	168	1.3	86	49	170	1.0	86
12.10	27/5	91	169	1.8	88	74	169	1.5	87	58	169	1.2	86
10.80		102	169	2.1	88	83	169	1.7	87	65	169	1.3	87
9.23		119	170	2.4	88	98	168	2.0	88	76	168	1.5	87
8.64		127	170	2.6	88	104	169	2.1	88	81	168	1.6	87
7.28		151	170	3.0	89	124	170	2.5	88	96	170	1.9	88

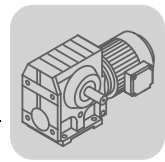

500 - 10 1/min

02 960 097

i_{ges}	i_{sch}	$n_e = 500 \text{ 1/min}$				$n_e = 250 \text{ 1/min}$				$n_e = 10 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
201.00		2.5	330	0.17	51	1.2	330	0.09	49	0.05	330	< 0.05	42
184.80		2.7	330	0.18	51	1.4	330	0.10	49	0.05	330	< 0.05	43
158.12		3.2	315	0.20	52	1.6	330	0.11	49	0.06	330	< 0.05	44
137.05		3.6	310	0.22	53	1.8	330	0.13	50	0.07	330	< 0.05	45
128.10		3.9	305	0.23	54	2.0	330	0.14	50	0.08	330	< 0.05	46
110.73	42/1	4.5	300	0.26	55	2.3	330	0.15	51	0.09	330	< 0.05	46
94.08		5.3	300	0.30	56	2.7	330	0.18	51	0.11	330	< 0.05	47
84.00		6.0	295	0.32	57	3.0	325	0.19	52	0.12	325	< 0.05	47
71.75		7.0	295	0.37	58	3.5	310	0.21	53	0.14	310	< 0.05	48
67.20		7.4	295	0.39	58	3.7	310	0.23	54	0.15	310	< 0.05	48
56.61		8.8	295	0.46	60	4.4	300	0.25	55	0.18	300	< 0.05	48
69.39		7.2	300	0.32	71	3.6	300	0.17	68	0.14	300	< 0.05	63
63.80		7.8	300	0.34	71	3.9	300	0.18	68	0.16	300	< 0.05	64
54.59		9.2	300	0.40	72	4.6	300	0.21	69	0.18	300	< 0.05	65
47.32		11	300	0.45	73	5.3	300	0.24	70	0.21	300	< 0.05	66
44.22		11	300	0.48	74	5.7	300	0.25	70	0.23	300	< 0.05	66
38.23	29/2	13	295	0.54	74	6.5	300	0.29	71	0.26	300	< 0.05	67
32.48		15	295	0.63	75	7.7	300	0.34	71	0.31	300	< 0.05	67
29.00		17	295	0.70	76	8.6	300	0.38	72	0.34	300	< 0.05	67
24.77		20	295	0.81	77	10	300	0.43	73	0.40	300	< 0.05	68
23.20		22	295	0.86	77	11	300	0.46	73	0.43	300	< 0.05	68
19.54		26	295	1.0	78	13	295	0.53	74	0.51	295	< 0.05	68
20.33		25	181	0.56	83	12	215	0.35	80	0.49	215	< 0.05	77
17.62		28	175	0.62	83	14	210	0.39	81	0.57	210	< 0.05	77
16.47		30	174	0.66	84	15	205	0.40	81	0.61	205	< 0.05	78
14.24		35	172	0.75	84	18	198	0.45	81	0.70	198	< 0.05	78
12.10	27/5	41	170	0.87	85	21	188	0.49	82	0.83	188	< 0.05	78
10.80		46	170	0.97	85	23	184	0.54	83	0.93	184	< 0.05	78
9.23		54	170	1.1	86	27	177	0.60	83	1.1	177	< 0.05	79
8.64		58	170	1.2	86	29	175	0.64	83	1.2	175	< 0.05	79
7.28		69	170	1.4	87	34	172	0.73	84	1.4	172	< 0.05	79

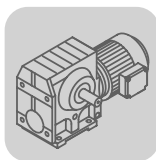

12.9 S, SF, SA, SAF 67

3400 - 2800 1/min

02 961 097

i_{ges}	i_{sch}	$n_e = 3400$ 1/min				$n_e = 3200$ 1/min				$n_e = 2800$ 1/min				
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	
217.41	42/1	16	465	1.2	66	15	465	1.1	66	13	465	0.96	65	
190.11		18	465	1.3	67	17	465	1.2	67	15	465	1.1	66	
180.60		19	465	1.4	67	18	465	1.3	67	16	465	1.1	66	
158.45		21	465	1.5	68	20	465	1.5	68	18	465	1.3	67	
134.40		25	465	1.8	69	24	465	1.7	68	21	465	1.5	68	
121.33		28	455	1.9	69	26	465	1.9	69	23	465	1.6	68	
106.75		32	405	2.0	69	30	430	2.0	69	26	465	1.9	69	
100.80		34	380	1.9	69	32	410	2.0	69	28	465	2.0	69	
85.83		40	320	1.9	69	37	345	1.9	69	33	400	2.0	70	
78.00		44	285	1.9	69	41	310	1.9	69	36	365	2.0	70	
67.57		50	235	1.8	67	47	260	1.9	68	41	315	2.0	69	
58.80		58	184	1.7	65	54	215	1.8	67	48	270	1.9	69	
75.06		29/2	45	435	2.5	82	43	435	2.4	82	37	435	2.1	81
65.63			52	435	2.9	82	49	435	2.7	82	43	435	2.4	82
62.35	55		435	3.0	83	51	435	2.8	82	45	435	2.5	82	
54.70	62		435	3.4	83	59	435	3.2	83	51	435	2.8	83	
46.40	73		395	3.6	83	69	415	3.6	83	60	435	3.3	83	
41.89	81		355	3.6	83	76	380	3.6	83	67	430	3.6	83	
36.85	92		310	3.6	83	87	335	3.6	84	76	380	3.6	84	
34.80	98		295	3.6	83	92	315	3.6	84	80	365	3.7	84	
29.63	115		250	3.6	83	108	270	3.7	83	94	310	3.7	84	
26.93	126		220	3.5	83	119	240	3.6	83	104	280	3.6	84	
23.33	146		182	3.4	82	137	200	3.5	83	120	245	3.7	84	
20.30	167		141	3.1	81	158	164	3.3	82	138	205	3.6	83	
24.44	27/5		139	315	5.1	90	131	315	4.8	90	115	315	4.2	89
23.22			146	315	5.4	90	138	315	5.1	90	121	315	4.4	90
20.37		167	315	6.1 *	90	157	315	5.8 *	90	137	315	5.0	90	
17.28		197	270	6.2 *	90	185	290	6.2 *	90	162	315	5.9 *	90	
15.60		218	245	6.2 *	90	205	260	6.2 *	90	179	295	6.1 *	90	
13.73		248	215	6.2 *	90	233	230	6.2 *	90	204	265	6.3 *	90	
12.96		262	200	6.1 *	90	247	215	6.1 *	90	216	250	6.3 *	90	
11.03		308	169	6.1 *	90	290	183	6.2 *	90	254	215	6.3 *	90	
10.03		339	151	6.0 *	90	319	164	6.1 *	90	279	194	6.3 *	90	
8.69		391	124	5.7 *	89	368	137	5.9 *	90	322	166	6.2 *	90	
7.56		450	95	5.1 *	88	423	112	5.6 *	89	370	141	6.1 *	90	

 * $P_{emax} = 5.5$ kW

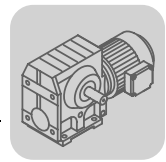


2200 - 1400 1/min

02 961 097

i_{ges}	i_{sch}	$n_e = 2200 \text{ 1/min}$				$n_e = 1700 \text{ 1/min}$				$n_e = 1400 \text{ 1/min}$				
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	
217.41	42/1	10	520	0.86	64	7.8	520	0.69	62	6.4	520	0.58	61	
190.11		12	520	0.97	65	8.9	520	0.77	63	7.4	520	0.65	62	
180.60		12	520	1.0	65	9.4	520	0.81	63	7.8	520	0.68	62	
158.45		14	520	1.1	66	11	520	0.91	64	8.8	520	0.76	63	
134.40		16	520	1.3	67	13	520	1.1	65	10	520	0.88	64	
121.33		18	520	1.5	68	14	520	1.2	66	12	520	0.97	65	
106.75		21	520	1.6	68	16	520	1.3	67	13	520	1.1	66	
100.80		22	510	1.7	69	17	520	1.4	67	14	520	1.1	66	
85.83		26	490	1.9	69	20	520	1.6	68	16	520	1.3	67	
78.00		28	465	2.0	70	22	510	1.7	69	18	520	1.4	68	
67.57		33	410	2.0	70	25	495	1.9	69	21	520	1.6	69	
58.80		37	360	2.0	70	29	460	2.0	70	24	500	1.8	69	
75.06		29/2	29	480	1.8	81	23	480	1.4	79	19	480	1.2	79
65.63			34	480	2.1	81	26	480	1.6	80	21	480	1.4	79
62.35	35		480	2.2	81	27	480	1.7	80	22	480	1.4	79	
54.70	40		480	2.5	82	31	480	1.9	81	26	480	1.6	80	
46.40	47		480	2.9	82	37	480	2.3	82	30	480	1.9	81	
41.89	53		480	3.2	83	41	480	2.5	82	33	480	2.1	81	
36.85	60		475	3.6	83	46	480	2.8	82	38	480	2.3	82	
34.80	63		450	3.6	83	49	480	3.0	83	40	480	2.5	82	
29.63	74		395	3.7	84	57	480	3.5	83	47	480	2.9	83	
26.93	82		360	3.7	84	63	455	3.6	83	52	480	3.2	83	
23.33	94		320	3.8	84	73	405	3.7	84	60	480	3.6	83	
20.30	108		280	3.8	84	84	360	3.8	84	69	425	3.7	84	
24.44	27/5		90	340	3.6	89	70	340	2.8	88	57	340	2.3	88
23.22			95	340	3.8	89	73	340	2.9	89	60	340	2.4	88
20.37		108	340	4.3	89	83	340	3.3	89	69	340	2.8	88	
17.28		127	340	5.0	90	98	340	3.9	89	81	340	3.2	89	
15.60		141	340	5.6 *	90	109	340	4.3	89	90	340	3.6	89	
13.73		160	330	6.1 *	90	124	340	4.9	90	102	340	4.1	89	
12.96		170	315	6.2 *	90	131	340	5.2	90	108	340	4.3	89	
11.03		199	275	6.3 *	90	154	340	6.1 *	90	127	340	5.0	90	
10.03		219	250	6.3 *	91	169	315	6.2 *	90	140	340	5.5	90	
8.69		253	220	6.4 *	91	196	280	6.3 *	91	161	335	6.3 *	90	
7.56		291	192	6.5 *	91	225	250	6.5 *	91	185	295	6.3 *	91	

* $P_{emax} = 5.5 \text{ kW}$

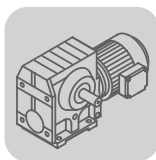


1100 - 700 1/min

02 962 097

i_{ges}	i_{sch}	$n_e = 1100 \text{ 1/min}$				$n_e = 900 \text{ 1/min}$				$n_e = 700 \text{ 1/min}$				
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	
217.41	42/1	5.1	555	0.50	59	4.1	560	0.42	58	3.2	570	0.34	56	
190.11		5.8	555	0.56	60	4.7	560	0.47	59	3.7	565	0.38	57	
180.60		6.1	555	0.59	61	5.0	555	0.49	59	3.9	565	0.40	57	
158.45		6.9	550	0.65	62	5.7	555	0.55	60	4.4	560	0.44	58	
134.40		8.2	550	0.75	63	6.7	550	0.63	61	5.2	555	0.51	60	
121.33		9.1	550	0.82	63	7.4	550	0.69	62	5.8	555	0.56	60	
106.75		10	550	0.92	64	8.4	550	0.77	63	6.6	555	0.62	61	
100.80		11	550	0.97	65	8.9	550	0.81	63	6.9	555	0.66	62	
85.83		13	550	1.1	66	10	550	0.94	64	8.2	550	0.75	63	
78.00		14	550	1.2	66	12	550	1.0	65	9.0	550	0.82	63	
67.57		16	550	1.4	67	13	550	1.2	66	10	550	0.93	64	
58.80		19	530	1.5	68	15	550	1.3	67	12	550	1.0	65	
75.06		29/2	15	525	1.0	77	12	525	0.86	76	9.3	525	0.68	75
65.63			17	525	1.2	78	14	525	0.98	77	11	525	0.77	76
62.35	18		525	1.2	78	14	525	1.0	77	11	525	0.81	76	
54.70	20		525	1.4	79	16	525	1.2	78	13	525	0.92	77	
46.40	24		525	1.6	80	19	525	1.4	79	15	525	1.1	78	
41.89	26		525	1.8	80	21	525	1.5	79	17	525	1.2	78	
36.85	30		525	2.0	81	24	525	1.7	80	19	525	1.3	79	
34.80	32		525	2.1	81	26	525	1.8	80	20	525	1.4	79	
29.63	37		525	2.5	82	30	525	2.1	81	24	525	1.6	80	
26.93	41		525	2.7	82	33	525	2.3	81	26	525	1.8	80	
23.33	47		525	3.1	83	39	525	2.6	82	30	525	2.0	81	
20.30	54		520	3.5	83	44	525	3.0	82	34	525	2.3	81	
24.44	27/5		45	355	1.9	87	37	360	1.6	87	29	365	1.3	86
23.22			47	355	2.0	87	39	360	1.7	87	30	365	1.3	86
20.37		54	355	2.3	88	44	355	1.9	87	34	365	1.5	86	
17.28		64	355	2.7	88	52	355	2.2	88	41	360	1.8	87	
15.60		71	350	2.9	88	58	355	2.4	88	45	355	1.9	87	
13.73		80	350	3.3	89	66	355	2.8	88	51	355	2.2	88	
12.96		85	350	3.5	89	69	350	2.9	88	54	355	2.3	88	
11.03		100	350	4.1	89	82	350	3.4	89	63	355	2.7	88	
10.03		110	345	4.4	90	90	350	3.7	89	70	355	2.9	88	
8.69		127	345	5.1	90	104	350	4.2	89	81	350	3.3	89	
7.56		146	345	5.8 *	90	119	345	4.8	90	93	350	3.8	89	


* $P_{emax} = 5.5 \text{ kW}$

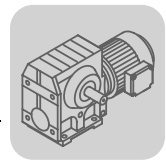

500 - 10 1/min

02 962 097


i_{ges}	i_{sch}	$n_e = 500 \text{ 1/min}$				$n_e = 250 \text{ 1/min}$				$n_e = 10 \text{ 1/min}$				
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	
217.41	42/1	2.3	570	0.25	54	1.1	570	0.13	51	0.05	570	< 0.05	47	
190.11		2.6	570	0.29	55	1.3	570	0.15	51	0.05	570	< 0.05	48	
180.60		2.8	570	0.30	55	1.4	570	0.16	51	0.06	570	< 0.05	48	
158.45		3.2	570	0.34	56	1.6	570	0.18	52	0.06	570	< 0.05	49	
134.40		3.7	565	0.38	57	1.9	570	0.21	53	0.07	570	< 0.05	50	
121.33		4.1	560	0.42	58	2.1	570	0.23	53	0.08	570	< 0.05	50	
106.75		4.7	560	0.47	59	2.3	570	0.26	54	0.09	570	< 0.05	50	
100.80		5.0	560	0.49	59	2.5	570	0.27	55	0.10	570	< 0.05	50	
85.83		5.8	555	0.56	60	2.9	570	0.31	56	0.12	570	< 0.05	51	
78.00		6.4	555	0.61	61	3.2	570	0.34	56	0.13	570	< 0.05	51	
67.57		7.4	555	0.69	62	3.7	565	0.38	57	0.15	565	< 0.05	51	
58.80		8.5	550	0.78	63	4.3	560	0.43	58	0.17	560	< 0.05	51	
75.06		29/2	6.7	570	0.54	73	3.3	570	0.28	70	0.13	570	< 0.05	68
65.63			7.6	570	0.61	74	3.8	570	0.32	71	0.15	570	< 0.05	68
62.35			8.0	570	0.64	74	4.0	570	0.34	71	0.16	570	< 0.05	69
54.70			9.1	570	0.73	75	4.6	570	0.38	71	0.18	570	< 0.05	69
46.40	11		570	0.85	76	5.4	570	0.44	72	0.22	570	< 0.05	69	
41.89	12		570	0.93	76	6.0	570	0.49	73	0.24	570	< 0.05	69	
36.85	14		570	1.1	77	6.8	570	0.55	73	0.27	570	< 0.05	69	
34.80	14		570	1.1	77	7.2	570	0.58	74	0.29	570	< 0.05	69	
29.63	17		565	1.3	78	8.4	570	0.68	75	0.34	570	< 0.05	70	
26.93	19		565	1.4	79	9.3	570	0.74	75	0.37	570	< 0.05	70	
23.33	21		565	1.6	79	11	570	0.84	76	0.43	570	< 0.05	70	
20.30	25		565	1.8	80	12	570	0.96	77	0.49	570	< 0.05	70	
24.44	27/5		20	365	0.93	85	10	355	0.46	82	0.41	355	0.019	80
23.22			22	365	0.97	85	11	355	0.49	82	0.43	355	< 0.05	80
20.37			25	380	1.1	85	12	365	0.57	83	0.49	365	< 0.05	80
17.28			29	365	1.3	86	14	435	0.79	83	0.58	435	< 0.05	81
15.60		32	365	1.4	86	16	430	0.86	84	0.64	430	< 0.05	81	
13.73		36	365	1.6	87	18	415	0.94	84	0.73	415	< 0.05	81	
12.96		39	360	1.7	87	19	410	0.98	84	0.77	410	< 0.05	81	
11.03		45	355	1.9	87	23	390	1.1	85	0.91	390	< 0.05	81	
10.03		50	355	2.1	88	25	380	1.2	85	1.0	380	< 0.05	81	
8.69		58	355	2.4	88	29	370	1.3	86	1.2	370	0.06	81	
7.56		66	355	2.8	88	33	365	1.5	86	1.3	365	0.06	81	

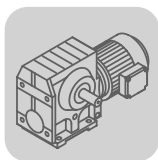
12.10 S, SF, SA, SAF 77
3400 - 2800 1/min

02 963 097

i_{ges}	i_{sch}	$n_e = 3400 \text{ 1/min}$				$n_e = 3200 \text{ 1/min}$				$n_e = 2800 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
256.47	40/1	13	1160	2.3	71	12	1160	2.1	71	11	1160	1.9	70
225.26		15	1130	2.5	72	14	1150	2.4	71	12	1160	2.1	71
214.00		16	1110	2.6	72	15	1140	2.5	71	13	1160	2.2	71
189.09		18	1080	2.8	72	17	1100	2.7	72	15	1140	2.5	71
161.60		21	1040	3.1	73	20	1050	3.0	73	17	1090	2.7	72
148.15		23	1010	3.3	73	22	1030	3.2	73	19	1070	2.9	73
130.00		26	970	3.6	74	25	990	3.5	74	22	1030	3.2	73
123.20		28	950	3.7	74	26	970	3.6	74	23	1010	3.3	73
107.83		32	900	4.0	74	30	920	3.9	74	26	970	3.6	74
97.14		35	860	4.2	75	33	880	4.1	74	29	930	3.8	74
85.22		40	770	4.3	75	38	820	4.3	75	33	880	4.1	75
75.20		45	675	4.3	74	43	725	4.3	75	37	830	4.3	75
66.67		51	585	4.2	74	48	635	4.3	75	42	745	4.4	75
56.92		60	485	4.1	73	56	530	4.2	74	49	635	4.4	75
75.09		45	1020	5.6	86	43	1020	5.3	86	37	1020	4.6	86
71.33		48	1020	5.9	87	45	1020	5.5	86	39	1020	4.9	86
63.03	54	1020	6.6	87	51	1020	6.2	87	44	1020	5.5	86	
53.87	63	980	7.4	87	59	1000	7.1	87	52	1020	6.4	87	
49.38	69	950	7.8	87	65	970	7.5	87	57	1010	6.9	87	
43.33	78	910	8.5	88	74	930	8.2	88	65	970	7.5	87	
41.07	40/3	83	900	8.9	88	78	910	8.5	88	68	950	7.8	87
35.94		95	800	9.0	88	89	850	9.0	88	78	910	8.5	88
32.38		105	725	9.1	88	99	770	9.1	88	86	880	9.1	88
28.41		120	635	9.1	88	113	680	9.1	88	99	780	9.1	88
25.07		136	560	9.1	88	128	600	9.1	88	112	695	9.2	88
22.22		153	485	8.9	88	144	525	9.0	88	126	615	9.2	88
18.97		179	395	8.5	87	169	440	8.9	88	148	520	9.1	88
22.89		149	590	10.0 *	91	140	590	9.5	91	122	590	8.3	91
20.99	162	590	10.9 *	92	152	590	10.3 *	92	133	590	9.0	91	
18.42	185	590	12.4 *	92	174	590	11.7 *	92	152	590	10.3 *	92	
17.45	195	590	13.1 *	92	183	590	12.4 *	92	160	590	10.8 *	92	
15.28	34/6	223	530	13.5 *	92	209	560	13.4 *	92	183	590	12.3 *	92
13.76		247	480	13.5 *	92	233	505	13.4 *	92	203	585	13.6 *	92
12.07		282	415	13.3 *	92	265	445	13.4 *	92	232	515	13.6 *	92
10.65		319	365	13.3 *	92	300	390	13.4 *	92	263	455	13.6 *	92
9.44		360	315	13.0 *	92	339	345	13.3 *	92	297	405	13.7 *	92
8.06		422	260	12.6 *	91	397	285	12.9 *	92	347	340	13.5 *	92

 * $P_{emax} = 9.2 \text{ kW}$

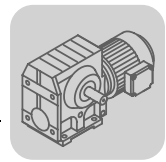


2200 - 1400 1/min

02 963 097

i_{ges}	i_{sch}	$n_e = 2200 \text{ 1/min}$				$n_e = 1700 \text{ 1/min}$				$n_e = 1400 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
256.47		8.6	1260	1.6	69	6.6	1270	1.3	67	5.5	1270	1.1	66
225.26		9.8	1230	1.8	69	7.5	1270	1.5	68	6.2	1270	1.2	67
214.00		10	1220	1.9	70	7.9	1270	1.6	68	6.5	1270	1.3	67
189.09		12	1200	2.1	70	9.0	1240	1.7	69	7.4	1270	1.5	68
161.60		14	1160	2.3	71	11	1220	1.9	70	8.7	1260	1.7	69
148.15		15	1140	2.5	72	11	1200	2.1	70	9.4	1240	1.8	69
130.00	40/1	17	1100	2.7	72	13	1170	2.3	71	11	1210	1.9	70
123.20		18	1080	2.8	73	14	1150	2.3	71	11	1200	2.0	70
107.83		20	1040	3.0	73	16	1110	2.5	72	13	1170	2.2	71
97.14		23	1010	3.3	74	18	1090	2.8	73	14	1140	2.4	72
85.22		26	970	3.5	74	20	1050	3.0	73	16	1100	2.6	72
75.20		29	920	3.8	74	23	1010	3.2	74	19	1070	2.9	73
66.67		33	880	4.1	75	25	970	3.5	74	21	1040	3.1	73
56.92		39	830	4.5	75	30	920	3.9	75	25	990	3.4	74
75.09		29	1100	4.0	85	23	1100	3.1	84	19	1100	2.6	83
71.33		31	1100	4.2	85	24	1100	3.2	85	20	1100	2.7	84
63.03		35	1100	4.7	86	27	1100	3.7	85	22	1100	3.0	84
53.87		41	1100	5.5	86	32	1100	4.3	86	26	1100	3.5	85
49.38		45	1080	5.8	87	34	1100	4.6	86	28	1100	3.8	85
43.33		51	1050	6.4	87	39	1100	5.2	86	32	1100	4.3	86
41.07	40/3	54	1030	6.6	87	41	1100	5.5	86	34	1100	4.6	86
35.94		61	980	7.2	87	47	1060	6.1	87	39	1100	5.2	86
32.38		68	960	7.8	88	53	1040	6.6	87	43	1090	5.7	87
28.41		77	920	8.5	88	60	990	7.1	87	49	1050	6.2	87
25.07		88	870	9.1	88	68	960	7.8	88	56	1020	6.8	87
22.22		99	790	9.3	88	77	920	8.4	88	63	980	7.4	87
18.97		116	680	9.4	88	90	860	9.2	88	74	930	8.2	88
22.89		96	710	7.9	91	74	705	6.1	90	61	705	5.0	90
20.99		105	710	8.6	91	81	705	6.6	91	67	705	5.5	90
18.42		119	720	9.9	91	92	710	7.6	91	76	705	6.2	90
17.45		126	720	10.4 *	91	97	710	8.0	91	80	710	6.6	91
15.28	34/6	144	720	11.9 *	92	111	720	9.2	91	92	710	7.5	91
13.76		160	725	13.2 *	92	124	720	10.2 *	91	102	710	8.3	91
12.07		182	650	13.5 *	92	141	725	11.7 *	92	116	720	9.6 *	91
10.65		207	580	13.6 *	92	160	725	13.2 *	92	131	720	10.8 *	92
9.44		233	520	13.8 *	92	180	655	13.4 *	92	148	725	12.3 *	92
8.06		273	445	13.8 *	92	211	575	13.8 *	92	174	680	13.5 *	92

* $P_{emax} = 9.2 \text{ kW}$

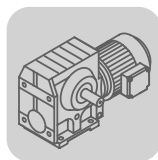


1100 - 700 1/min

02 964 097

i_{ges}	i_{sch}	$n_e = 1100 \text{ 1/min}$				$n_e = 900 \text{ 1/min}$				$n_e = 700 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
256.47	40/1	4.3	1270	0.89	64	3.5	1270	0.75	63	2.7	1270	0.60	61
225.26		4.9	1270	1.0	65	4.0	1270	0.84	63	3.1	1270	0.67	62
214.00		5.1	1270	1.0	65	4.2	1270	0.88	64	3.3	1270	0.70	62
189.09		5.8	1270	1.2	66	4.8	1270	0.98	65	3.7	1270	0.78	63
161.60		6.8	1270	1.3	67	5.6	1270	1.1	66	4.3	1270	0.90	64
148.15		7.4	1270	1.5	68	6.1	1270	1.2	66	4.7	1270	0.97	65
130.00		8.5	1260	1.6	69	6.9	1270	1.4	67	5.4	1270	1.1	66
123.20		8.9	1250	1.7	69	7.3	1270	1.4	68	5.7	1270	1.1	66
107.83		10	1220	1.9	70	8.3	1260	1.6	69	6.5	1270	1.3	67
97.14		11	1200	2.0	70	9.3	1250	1.8	69	7.2	1270	1.4	68
85.22		13	1170	2.2	71	11	1220	1.9	70	8.2	1270	1.6	69
75.20		15	1140	2.4	72	12	1190	2.1	71	9.3	1250	1.8	69
66.67		16	1110	2.6	72	13	1160	2.3	71	10	1220	1.9	70
56.92		19	1060	2.9	73	16	1120	2.6	72	12	1190	2.2	71
75.09		15	1120	2.1	83	12	1130	1.7	82	9.3	1170	1.4	81
71.33		15	1120	2.2	83	13	1130	1.8	82	9.8	1120	1.4	81
63.03		17	1120	2.5	83	14	1120	2.0	82	11	1130	1.6	81
53.87		20	1120	2.9	84	17	1120	2.4	83	13	1120	1.9	82
49.38		22	1120	3.1	84	18	1120	2.6	83	14	1120	2.0	82
43.33	25	1130	3.5	85	21	1120	2.9	84	16	1120	2.3	83	
41.07	27	1130	3.7	85	22	1120	3.1	84	17	1120	2.4	83	
35.94	31	1150	4.3	85	25	1130	3.5	85	19	1120	2.7	84	
32.38	34	1130	4.7	86	28	1130	3.9	85	22	1120	3.0	84	
28.41	39	1110	5.2	86	32	1150	4.5	86	25	1130	3.4	85	
25.07	44	1080	5.7	87	36	1120	4.9	86	28	1130	3.9	85	
22.22	50	1050	6.3	87	41	1100	5.4	86	32	1150	4.4	86	
18.97	58	1010	7.0	87	47	1060	6.1	87	37	1120	5.0	86	
22.89	48	695	3.9	89	39	695	3.2	89	31	705	2.6	88	
20.99	52	705	4.3	90	43	695	3.5	89	33	705	2.8	88	
18.42	60	700	4.9	90	49	700	4.0	89	38	700	3.1	89	
17.45	63	700	5.1	90	52	700	4.2	90	40	700	3.3	89	
15.28	72	710	5.9	90	59	700	4.8	90	46	700	3.8	89	
13.76	80	710	6.6	91	65	700	5.3	90	51	700	4.2	90	
12.07	91	710	7.5	91	75	710	6.1	90	58	700	4.7	90	
10.65	103	715	8.5	91	85	710	6.9	91	66	710	5.4	90	
9.44	117	720	9.6 *	91	95	715	7.8	91	74	710	6.1	90	
8.06	136	725	11.3 *	92	112	720	9.2	91	87	710	7.1	91	


* $P_{emax} = 9.2 \text{ kW}$

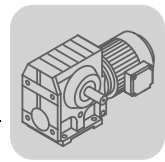

500 - 10 1/min

02 964 097


i_{ges}	i_{sch}	$n_e = 500 \text{ 1/min}$				$n_e = 250 \text{ 1/min}$				$n_e = 10 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
256.47	40/1	1.9	1270	0.44	59	0.97	1270	0.23	56	0.04	1270	< 0.05	54
225.26		2.2	1270	0.49	60	1.1	1270	0.26	56	0.04	1270	< 0.05	55
214.00		2.3	1270	0.52	60	1.2	1270	0.28	56	0.05	1270	< 0.05	55
189.09		2.6	1270	0.58	61	1.3	1270	0.31	57	0.05	1270	< 0.05	55
161.60		3.1	1270	0.67	62	1.5	1270	0.36	58	0.06	1270	< 0.05	55
148.15		3.4	1270	0.72	62	1.7	1270	0.39	58	0.07	1270	< 0.05	55
130.00		3.8	1270	0.81	63	1.9	1270	0.43	59	0.08	1270	< 0.05	55
123.20		4.1	1270	0.85	64	2.0	1270	0.46	59	0.08	1270	< 0.05	55
107.83		4.6	1270	0.95	65	2.3	1270	0.51	60	0.09	1270	< 0.05	56
97.14		5.1	1270	1.0	65	2.6	1270	0.56	61	0.10	1270	< 0.05	56
85.22		5.9	1270	1.2	66	2.9	1270	0.63	62	0.12	1270	< 0.05	56
75.20		6.6	1270	1.3	67	3.3	1270	0.71	62	0.13	1270	< 0.05	56
66.67		7.5	1270	1.5	68	3.7	1270	0.79	63	0.15	1270	< 0.05	56
56.92		8.8	1260	1.7	69	4.4	1270	0.91	64	0.18	1270	< 0.05	56
75.09		6.7	1160	1.0	79	3.3	1120	0.51	76	0.13	1120	< 0.05	75
71.33		7.0	1110	1.0	79	3.5	1060	0.51	77	0.14	1060	< 0.05	75
63.03	7.9	1230	1.3	80	4.0	1200	0.65	77	0.16	1200	< 0.05	76	
53.87	9.3	1180	1.4	81	4.6	1240	0.77	78	0.19	1240	< 0.05	76	
49.38	10	1160	1.5	81	5.1	1240	0.84	78	0.20	1240	< 0.05	76	
43.33	12	1120	1.7	82	5.8	1240	0.95	79	0.23	1240	< 0.05	76	
41.07	40/3	12	1120	1.7	82	6.1	1240	1.0	79	0.24	1240	< 0.05	76
35.94		14	1120	2.0	82	7.0	1240	1.1	79	0.28	1240	< 0.05	76
32.38		15	1120	2.2	83	7.7	1240	1.3	80	0.31	1240	0.05	76
28.41		18	1120	2.5	83	8.8	1190	1.4	80	0.35	1190	0.06	76
25.07	20	1120	2.8	84	10	1170	1.5	81	0.40	1170	0.06	76	
22.22	23	1130	3.2	84	11	1130	1.6	81	0.45	1130	0.07	76	
18.97	26	1130	3.7	85	13	1120	1.9	82	0.53	1120	0.08	76	
22.89	22	690	1.8	87	11	675	0.91	85	0.44	675	< 0.05	83	
20.99	24	725	2.1	87	12	740	1.1	85	0.48	740	< 0.05	83	
18.42	27	705	2.3	88	14	830	1.4	86	0.54	830	0.06	83	
17.45	29	705	2.4	88	14	810	1.4	86	0.57	810	0.06	83	
15.28	34/6	33	705	2.7	88	16	785	1.6	86	0.65	785	0.06	83
13.76		36	695	3.0	89	18	770	1.7	87	0.73	770	0.07	83
12.07		41	695	3.4	89	21	750	1.9	87	0.83	750	0.08	83
10.65		47	695	3.8	89	23	725	2.0	87	0.94	725	0.09	83
9.44	53	705	4.4	90	26	705	2.2	88	1.1	705	0.09	83	
8.06	62	705	5.1	90	31	705	2.6	88	1.2	705	0.11	83	

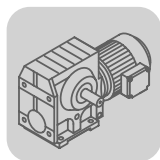
12.11 S, SF, SA, SAF 87
3400 - 2800 1/min

02 965 097

i_{ges}	i_{sch}	$n_e = 3400 \text{ 1/min}$				$n_e = 3200 \text{ 1/min}$				$n_e = 2800 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
288.00		12	2030	3.4	74	11	2070	3.3	73	9.7	2070	2.9	73
258.18		13	1990	3.7	74	12	2010	3.5	74	11	2070	3.2	73
222.40		15	1910	4.1	75	14	1950	4.0	74	13	2010	3.6	74
202.96		17	1850	4.3	75	16	1890	4.2	75	14	1970	3.8	74
180.00		19	1800	4.7	75	18	1830	4.5	75	16	1910	4.2	75
151.30		22	1690	5.3	75	21	1730	5.1	75	19	1800	4.6	75
139.05	40/1	24	1630	5.5	76	23	1680	5.4	76	20	1760	4.9	75
123.48		28	1570	6.0	76	26	1600	5.7	76	23	1690	5.3	76
110.40		31	1430	6.1	76	29	1540	6.2	76	25	1620	5.7	76
99.26		34	1260	6.0	75	32	1380	6.2	76	28	1550	6.0	76
86.15		39	1030	5.8	74	37	1150	6.0	75	33	1390	6.2	76
77.14		44	830	5.3	72	41	970	5.7	74	36	1220	6.1	76
64.00		53	500	4.3	65	50	620	4.7	68	44	960	5.9	75
91.20		37	1470	6.6	88	35	1470	6.2	87	31	1470	5.4	87
81.76		42	1470	7.3	88	39	1470	6.9	88	34	1470	6.0	87
70.43		48	1470	8.4	88	45	1470	7.9	88	40	1470	7.0	88
64.27		53	1470	9.2	88	50	1470	8.7	88	44	1470	7.6	88
57.00		60	1470	10.4	88	56	1470	9.8	88	49	1470	8.6	88
47.91		71	1470	12.3	89	67	1470	11.6	89	58	1470	10.2	88
44.03	38/3	77	1470	13.4	89	73	1470	12.6	89	64	1470	11.0	89
39.10		87	1300	13.3	89	82	1400	13.5	89	72	1470	12.4	89
34.96		97	1140	13.1	89	92	1240	13.4	89	80	1440	13.6	89
31.43		108	1000	12.8	88	102	1090	13.1	89	89	1290	13.5	89
27.28		125	810	12.1	88	117	910	12.7	88	103	1110	13.4	89
24.43		139	660	11.1	87	131	775	12.1	88	115	960	13.0	89
20.27		168	395	8.4	82	158	490	9.6	84	138	755	12.4	88
25.50		133	990	15.0	92	125	990	14.1	92	110	990	12.4	92
21.43		159	990	17.8 *	92	149	990	16.8 *	92	131	990	14.7	92
19.70		173	990	19 *	92	162	990	18.3 *	92	142	990	16.0 *	92
17.49		194	870	19 *	92	183	930	19 *	92	160	990	18.0 *	92
15.64		217	760	19 *	92	205	830	19 *	92	179	960	19 *	92
14.06	34/6	242	660	18.2 *	92	228	725	19 *	92	199	860	19 *	92
12.21		278	540	17.2 *	91	262	605	18.1 *	92	229	730	19 *	92
10.93		311	440	15. *8	90	293	510	17.1 *	91	256	645	19 *	92
9.07		375	255	11.5	87	353	325	13.5	89	309	500	17.7 *	92
7.88		431	200	10.5	86	406	230	11.3	87	355	375	15.5 *	90

 * $P_{emax} = 15 \text{ kW}$

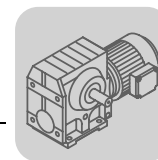


2200 - 1400 1/min

02 965 097

i_{ges}	i_{sch}	$n_e = 2200$ 1/min				$n_e = 1700$ 1/min				$n_e = 1400$ 1/min			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
288.00		7.6	2210	2.5	71	5.9	2280	2.0	70	4.9	2280	1.7	69
258.18		8.5	2170	2.7	72	6.6	2260	2.2	71	5.4	2280	1.9	69
222.40		9.9	2130	3.0	73	7.6	2210	2.5	71	6.3	2280	2.1	70
202.96		11	2080	3.2	73	8.4	2190	2.7	72	6.9	2260	2.3	71
180.00		12	2020	3.5	74	9.4	2130	2.9	73	7.8	2210	2.5	72
151.30		15	1940	4.0	75	11	2060	3.3	74	9.3	2150	2.9	73
139.05	40/1	16	1880	4.2	75	12	2020	3.5	74	10	2100	3.0	73
123.48		18	1820	4.5	75	14	1960	3.8	74	11	2060	3.3	74
110.40		20	1770	4.9	76	15	1900	4.1	75	13	2000	3.6	74
99.26		22	1700	5.2	76	17	1840	4.4	75	14	1960	3.9	75
86.15		26	1620	5.7	76	20	1770	4.8	76	16	1880	4.3	75
77.14		29	1540	6.0	76	22	1700	5.2	76	18	1820	4.6	76
64.00		34	1360	6.4	77	27	1580	5.7	77	22	1700	5.1	76
91.20		24	1540	4.5	87	19	1520	3.5	86	15	1510	2.9	85
81.76		27	1600	5.2	87	21	1600	4.0	86	17	1600	3.4	86
70.43		31	1600	6.0	87	24	1600	4.7	87	20	1600	3.9	86
64.27		34	1600	6.6	88	26	1600	5.1	87	22	1600	4.2	86
57.00		39	1600	7.4	88	30	1600	5.7	87	25	1600	4.8	87
47.91		46	1600	8.7	88	35	1600	6.8	88	29	1600	5.6	87
44.03	38/3	50	1600	9.5	88	39	1600	7.4	88	32	1600	6.1	87
39.10		56	1600	10.6	89	43	1600	8.3	88	36	1600	6.8	88
34.96		63	1600	11.9	89	49	1600	9.2	88	40	1600	7.6	88
31.43		70	1600	13.2	89	54	1600	10.2	89	45	1600	8.5	88
27.28		81	1450	13.7	89	62	1600	11.7	89	51	1600	9.7	89
24.43		90	1310	13.8	89	70	1600	13.1	89	57	1600	10.8	89
20.27		109	1080	13.8	89	84	1420	14.0	89	69	1600	13.0	89
25.50		86	1240	12.2	92	67	1240	9.5	91	55	1240	7.8	91
21.43		103	1240	14.5	92	79	1240	11.2	92	65	1240	9.3	91
19.70		112	1240	15.7 *	92	86	1240	12.2	92	71	1240	10.1	91
17.49		126	1240	17.7 *	92	97	1240	13.7	92	80	1240	11.3	92
15.64	34/6	141	1230	20 *	92	109	1240	15.3 *	92	90	1240	12.7	92
14.06		156	1110	20 *	92	121	1240	17.0 *	92	100	1240	14.1	92
12.21		180	970	20 *	93	139	1240	20 *	92	115	1240	16.1 *	92
10.93		201	870	20 *	93	156	1130	20 *	93	128	1240	18.0 *	92
9.07		243	720	20 *	92	187	950	20 *	93	154	1140	20 *	93
7.88		279	605	19 *	92	216	830	20 *	93	178	1010	20 *	93

* $P_{emax} = 15$ kW

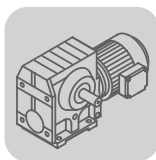


1100 - 700 1/min

02 966 097

i_{ges}	i_{sch}	$n_e = 1100 \text{ 1/min}$				$n_e = 900 \text{ 1/min}$				$n_e = 700 \text{ 1/min}$				
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	
288.00	40/1	3.8	2400	1.4	67	3.1	2450	1.2	66	2.4	2480	0.98	64	
258.18		4.3	2380	1.6	68	3.5	2430	1.3	67	2.7	2470	1.1	65	
222.40		4.9	2350	1.8	69	4.0	2400	1.5	68	3.1	2450	1.2	66	
202.96		5.4	2330	1.9	70	4.4	2380	1.6	68	3.4	2430	1.3	67	
180.00		6.1	2280	2.1	70	5.0	2350	1.8	69	3.9	2400	1.4	68	
151.30		7.3	2240	2.4	71	5.9	2310	2.0	70	4.6	2350	1.7	69	
139.05		7.9	2190	2.5	72	6.5	2260	2.2	71	5.0	2330	1.8	69	
123.48		8.9	2150	2.8	73	7.3	2240	2.4	71	5.7	2310	2.0	70	
110.40		10	2110	3.0	73	8.2	2190	2.6	72	6.3	2280	2.1	71	
99.26		11	2070	3.3	74	9.1	2150	2.8	73	7.1	2240	2.3	71	
86.15		13	2000	3.6	74	10	2090	3.1	73	8.1	2190	2.6	72	
77.14		14	1940	3.9	75	12	2040	3.4	74	9.1	2150	2.8	73	
64.00		17	1840	4.4	76	14	1960	3.9	75	11	2070	3.2	74	
91.20		38/3	12	1490	2.2	84	9.9	1480	1.8	83	7.7	1460	1.4	82
81.76			13	1760	2.9	85	11	1760	2.4	84	8.6	1760	1.9	83
70.43			16	1760	3.4	85	13	1760	2.8	85	9.9	1760	2.2	83
64.27	17		1760	3.7	86	14	1760	3.0	85	11	1760	2.4	84	
57.00	19		1760	4.1	86	16	1760	3.4	85	12	1760	2.7	84	
47.91	23		1760	4.9	87	19	1760	4.0	86	15	1760	3.2	85	
44.03	25		1760	5.3	87	20	1760	4.4	86	16	1760	3.4	85	
39.10	28		1760	6.0	87	23	1760	4.9	87	18	1760	3.9	86	
34.96	31		1760	6.6	88	26	1760	5.5	87	20	1760	4.3	86	
31.43	35		1760	7.4	88	29	1760	6.1	87	22	1760	4.7	87	
27.28	40		1760	8.4	88	33	1760	6.9	88	26	1760	5.4	87	
24.43	45		1760	9.4	88	37	1760	7.7	88	29	1760	6.0	87	
20.27	54		1760	11.3	89	44	1760	9.3	88	35	1760	7.2	88	
25.50	34/6		43	1340	6.7	90	35	1340	5.5	90	27	1340	4.3	89
21.43			51	1340	7.9	91	42	1340	6.5	90	33	1340	5.1	90
19.70			56	1340	8.6	91	46	1340	7.1	91	36	1340	5.5	90
17.49		63	1340	9.7	91	51	1340	7.9	91	40	1340	6.2	90	
15.64		70	1340	10.8	92	58	1340	8.9	91	45	1340	6.9	91	
14.06		78	1340	12.0	92	64	1340	9.8	91	50	1340	7.7	91	
12.21		90	1340	13.8	92	74	1340	11.3	92	57	1340	8.8	91	
10.93		101	1340	15.3 *	92	82	1340	12.6	92	64	1340	9.8	91	
9.07		121	1340	18.4 *	92	99	1340	15.1 *	92	77	1340	11.8	92	
7.88		140	1260	20 *	93	114	1340	17.4 *	92	89	1340	13.6	92	


* $P_{emax} = 15 \text{ kW}$

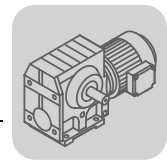

500 - 10 1/min

02 966 097


i _{ges}	i _{sch}	n _e = 500 1/min				n _e = 250 1/min				n _e = 10 1/min			
		n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]	n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]	n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]
288.00		1.7	2500	0.73	62	0.87	2500	0.38	59	0.03	2500	< 0.05	58
258.18		1.9	2500	0.80	63	0.97	2500	0.43	59	0.04	2500	< 0.05	58
222.40		2.2	2500	0.92	64	1.1	2500	0.49	60	0.04	2500	< 0.05	59
202.96		2.5	2480	0.99	64	1.2	2500	0.53	61	0.05	2500	< 0.05	59
180.00		2.8	2480	1.1	65	1.4	2500	0.60	61	0.06	2500	< 0.05	59
151.30		3.3	2430	1.3	67	1.7	2500	0.70	62	0.07	2500	< 0.05	59
139.05	40/1	3.6	2430	1.4	67	1.8	2500	0.75	63	0.07	2500	< 0.05	59
123.48		4.0	2400	1.5	68	2.0	2500	0.84	63	0.08	2500	< 0.05	59
110.40		4.5	2380	1.6	69	2.3	2500	0.93	64	0.09	2500	< 0.05	59
99.26		5.0	2330	1.8	69	2.5	2470	1.0	65	0.10	2470	< 0.05	59
86.15		5.8	2310	2.0	70	2.9	2450	1.1	66	0.12	2450	0.05	59
77.14		6.5	2260	2.2	71	3.2	2430	1.2	66	0.13	2430	0.06	59
64.00		7.8	2220	2.5	72	3.9	2400	1.5	68	0.16	2400	0.07	59
91.20		5.5	1450	1.0	81	2.7	1390	0.51	79	0.11	1390	< 0.05	78
81.76		6.1	1960	1.5	82	3.1	1880	0.76	79	0.12	1880	< 0.05	78
70.43		7.1	1980	1.8	82	3.5	1980	0.92	80	0.14	1980	< 0.05	79
64.27		7.8	1980	2.0	83	3.9	1980	1.0	80	0.16	1980	< 0.05	79
57.00		8.8	1980	2.2	83	4.4	1980	1.1	80	0.18	1980	< 0.05	79
47.91		10	1980	2.6	84	5.2	1980	1.3	81	0.21	1980	0.06	79
44.03	38/3	11	1980	2.8	84	5.7	1980	1.4	81	0.23	1980	0.06	79
39.10		13	1980	3.1	85	6.4	1980	1.6	82	0.26	1980	0.07	79
34.96		14	1980	3.5	85	7.2	1980	1.8	82	0.29	1980	0.08	79
31.43		16	1980	3.9	85	8.0	1980	2.0	83	0.32	1980	0.08	79
27.28		18	1980	4.4	86	9.2	1980	2.3	83	0.37	1980	0.10	79
24.43		20	1980	4.9	86	10	1980	2.5	84	0.41	1980	0.11	79
20.27		25	1980	5.9	87	12	1980	3.0	85	0.49	1980	0.13	79
25.50		20	1430	3.3	88	9.8	1390	1.6	87	0.39	1390	0.07	85
21.43		23	1420	3.9	89	12	1510	2.1	87	0.47	1510	0.09	85
19.70		25	1410	4.2	89	13	1570	2.4	87	0.51	1570	0.10	85
17.49		29	1390	4.6	89	14	1570	2.7	88	0.57	1570	0.11	85
15.64	34/6	32	1390	5.2	90	16	1540	2.9	88	0.64	1540	0.12	85
14.06		36	1390	5.7	90	18	1510	3.2	88	0.71	1510	0.13	85
12.21		41	1390	6.6	90	20	1460	3.5	89	0.82	1460	0.15	85
10.93		46	1390	7.3	91	23	1430	3.9	89	0.91	1430	0.16	85
9.07		55	1410	8.9	91	28	1390	4.5	89	1.1	1390	0.19	85
7.88		63	1410	10.3	91	32	1390	5.1	90	1.3	1390	0.22	85

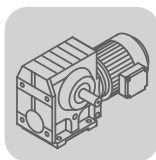
12.12 S, SF, SA, SAF 97
3400 - 2800 1/min

02 967 097

i_{ges}	i_{sch}	$n_e = 3400 \text{ 1/min}$				$n_e = 3200 \text{ 1/min}$				$n_e = 2800 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
286.40	40/1	12	3520	5.8	76	11	3590	5.6	76	9.8	3700	5.0	75
262.22		13	3450	6.2	76	12	3520	5.9	76	11	3630	5.4	75
231.67		15	3310	6.7	76	14	3380	6.4	76	12	3520	5.9	76
196.52		17	3120	7.4	77	16	3210	7.2	76	14	3350	6.6	76
180.95		19	3030	7.8	77	18	3120	7.5	77	15	3250	6.9	76
161.74		21	2910	8.3	77	20	2970	8.0	77	17	3120	7.4	77
145.60		23	2760	8.8	77	22	2850	8.5	77	19	3000	7.9	77
131.85		26	2660	9.4	77	24	2740	9.1	77	21	2880	8.3	77
116.92		29	2320	9.3	76	27	2550	9.5	77	24	2740	8.9	77
105.71		32	1980	8.9	75	30	2210	9.2	76	26	2630	9.5	77
89.60		38	1280	7.3	70	36	1670	8.5	74	31	2210	9.4	77
78.26		43	920	6.4	65	41	1040	6.7	67	36	1770	8.8	75
65.45	52	675	5.9	63	49	775	6.2	64	43	1030	6.8	68	
80.85	37/3	42	3150	15.5	89	40	3150	14.6	89	35	3150	12.8	89
71.43		48	3090	17.2	90	45	3150	16.5	89	39	3150	14.5	89
60.59		56	2910	19	90	53	2970	18.3	90	46	3120	16.9	90
55.79		61	2820	20	90	57	2880	19	90	50	3030	17.8	90
49.87		68	2710	22	90	64	2760	21	90	56	2910	19	90
44.89		76	2430	21	90	71	2630	22	90	62	2790	20	90
40.65		84	2170	21	90	79	2350	22	90	69	2680	21	90
36.05		94	1830	20	89	89	2020	21	89	78	2400	22	90
32.60		104	1560	19	89	98	1760	20	89	86	2150	22	90
27.63		123	1010	15.2	86	116	1320	18.2	88	101	1740	21	89
24.13		141	725	12.9	83	133	820	13.6	84	116	1390	19	88
26.39		129	1750	25 *	93	121	1750	24 *	93	106	1750	21	93
23.59	144	1750	28 *	93	136	1750	27 *	93	119	1750	23 *	93	
21.23	160	1750	32 *	93	151	1750	30 *	93	132	1750	26 *	93	
19.23	35/6	177	1550	31 *	93	166	1680	31 *	93	146	1750	29 *	93
17.05		199	1320	30 *	93	188	1450	31 *	93	164	1730	32 *	93
15.42		220	1110	28 *	92	208	1260	30 *	93	182	1540	31 *	93
13.07		260	725	22	90	245	940	26 *	92	214	1240	30 *	93
11.41		298	515	18.3	88	280	585	19	89	245	1000	28 *	92
9.55		356	375	16.2	87	335	435	17.5	87	293	580	20	89
8.26	412	290	14.7	85	387	335	15.8	86	339	455	18.4	88	

 * $P_{emax} = 22 \text{ kW}$

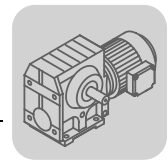


2200 - 1400 1/min

02 967 097

i _{ges}	i _{sch}	n _e = 2200 1/min				n _e = 1700 1/min				n _e = 1400 1/min			
		n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]	n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]	n _a [1/min]	M _{amax} [Nm]	P _e [kW]	η [%]
286.40		7.7	3920	4.2	74	5.9	4000	3.4	73	4.9	4000	2.9	72
262.22		8.4	3840	4.5	75	6.5	4000	3.7	73	5.3	4000	3.1	72
231.67		9.5	3770	5.0	75	7.3	3960	4.1	74	6.0	4000	3.5	73
196.52		11	3580	5.5	76	8.7	3840	4.7	75	7.1	4000	4.0	74
180.95		12	3510	5.9	76	9.4	3770	4.9	75	7.7	3920	4.3	74
161.74		14	3410	6.4	76	11	3650	5.3	76	8.7	3840	4.7	75
145.60	40/1	15	3270	6.8	77	12	3550	5.7	76	9.6	3730	5.0	75
131.85		17	3170	7.2	77	13	3440	6.1	76	11	3650	5.4	76
116.92		19	3020	7.7	77	15	3340	6.6	77	12	3510	5.8	76
105.71		21	2930	8.3	77	16	3210	7.0	77	13	3440	6.2	76
89.60		25	2730	9.1	77	19	3020	7.8	77	16	3240	6.9	77
78.26		28	2540	9.6	78	22	2870	8.4	78	18	3080	7.5	77
65.45		34	2120	9.7	77	26	2650	9.2	78	21	2900	8.3	78
80.85		27	3300	10.6	89	21	3270	8.2	88	17	3230	6.7	88
71.43		31	3300	12.0	89	24	3300	9.3	88	20	3300	7.7	88
60.59		36	3300	14.1	89	28	3300	10.9	89	23	3300	9.0	88
55.79		39	3270	15.1	89	30	3300	11.8	89	25	3300	9.8	88
49.87		44	3170	16.3	90	34	3300	13.2	89	28	3300	10.9	89
44.89	37/3	49	3050	17.5	90	38	3300	14.6	89	31	3300	12.1	89
40.65		54	2950	19	90	42	3230	15.8	90	34	3300	13.3	89
36.05		61	2810	20	90	47	3110	17.1	90	39	3300	15.0	89
32.60		67	2700	21	90	52	2980	18.1	90	43	3200	16.0	90
27.63		80	2390	22	90	62	2810	20	90	51	3010	17.8	90
24.13		91	2060	22	90	70	2670	22	90	58	2870	19	90
26.39		83	2550	24 *	93	64	2600	19	93	53	2600	15.6	92
23.59		93	2450	26 *	93	72	2600	21	93	59	2600	17.5	93
21.23		104	2380	28 *	93	80	2570	23 *	93	66	2600	19	93
19.23		114	2280	29 *	93	88	2500	25 *	93	73	2600	21	93
17.05		129	2170	31 *	93	100	2400	27 *	93	82	2570	24 *	93
15.42	35/6	143	2040	33 *	93	110	2300	28 *	93	91	2470	25 *	93
13.07		168	1720	32 *	93	130	2170	32 *	93	107	2330	28 *	93
11.41		193	1480	32 *	93	149	2000	33 *	93	123	2210	30 *	93
9.55		230	1200	31 *	93	178	1670	33 *	93	147	2040	33 *	94
8.26		266	980	30 *	93	206	1440	33 *	93	169	1770	34 *	94

* P_{emax} = 22 kW

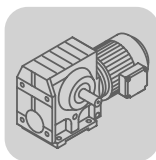


1100 - 700 1/min

02 968 097

i_{ges}	i_{sch}	$n_e = 1100 \text{ 1/min}$				$n_e = 900 \text{ 1/min}$				$n_e = 700 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
286.40		3.8	4200	2.4	70	3.1	4200	2.0	69	2.4	4200	1.6	68
262.22		4.2	4200	2.6	71	3.4	4200	2.2	70	2.7	4200	1.7	68
231.67		4.7	4200	2.9	72	3.9	4200	2.4	70	3.0	4200	1.9	69
196.52		5.6	4160	3.4	73	4.6	4200	2.8	71	3.6	4200	2.2	70
180.95		6.1	4120	3.6	73	5.0	4200	3.0	72	3.9	4200	2.4	70
161.74		6.8	4030	3.9	74	5.6	4160	3.3	73	4.3	4200	2.7	71
145.60	40/1	7.6	3950	4.2	74	6.2	4080	3.6	73	4.8	4200	2.9	72
131.85		8.3	3880	4.5	75	6.8	4030	3.9	74	5.3	4200	3.2	72
116.92		9.4	3760	4.9	75	7.7	3910	4.2	74	6.0	4120	3.5	73
105.71		10	3650	5.3	76	8.5	3840	4.6	75	6.6	4030	3.8	74
89.60		12	3500	5.9	76	10	3690	5.1	76	7.8	3910	4.3	75
78.26		14	3370	6.5	77	12	3580	5.7	76	8.9	3800	4.7	75
65.45		17	3170	7.2	77	14	3400	6.4	77	11	3650	5.4	76
80.85		14	3230	5.3	87	11	3200	4.3	86	8.7	3170	3.4	85
71.43		15	3600	6.7	87	13	3600	5.5	87	9.8	3600	4.3	86
60.59		18	3600	7.8	88	15	3600	6.4	87	12	3600	5.0	86
55.79		20	3600	8.5	88	16	3600	7.0	87	13	3600	5.5	87
49.87		22	3600	9.4	88	18	3600	7.8	88	14	3600	6.1	87
44.89	37/3	25	3600	10.4	88	20	3600	8.6	88	16	3600	6.7	87
40.65		27	3600	11.5	89	22	3600	9.5	88	17	3600	7.4	88
36.05		31	3530	12.7	89	25	3600	10.6	89	19	3600	8.3	88
32.60		34	3420	13.5	89	28	3600	11.7	89	21	3600	9.2	88
27.63		40	3260	15.2	90	33	3460	13.2	89	25	3600	10.8	89
24.13		46	3130	16.6	90	37	3320	14.5	89	29	3560	12.2	89
26.39		42	2650	12.6	92	34	2620	10.2	92	27	2620	8.0	91
23.59		47	2650	14.0	92	38	2650	11.5	92	30	2620	8.9	91
21.23		52	2650	15.6	92	42	2650	12.8	92	33	2620	9.9	92
19.23		57	2650	17.2	93	47	2650	14.1	92	36	2620	10.9	92
17.05		65	2670	19	93	53	2650	15.9	92	41	2650	12.4	92
15.42	35/6	71	2670	21	93	58	2650	17.5	93	45	2650	13.7	92
13.07		84	2540	24 *	93	69	2670	21	93	54	2650	16.1	92
11.41		96	2420	26 *	93	79	2590	23 *	93	61	2650	18.4	93
9.55		115	2280	29 *	93	94	2440	26 *	93	73	2650	22	93
8.26		133	2140	32 *	94	109	2320	28 *	93	85	2540	24 *	93

* $P_{emax} = 22 \text{ kW}$

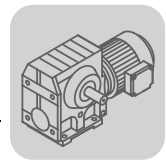

500 - 10 1/min

02 968 097

i_{ges}	i_{sch}	$n_e = 500 \text{ 1/min}$				$n_e = 250 \text{ 1/min}$				$n_e = 10 \text{ 1/min}$			
		n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]	n_a [1/min]	M_{amax} [Nm]	P_e [kW]	η [%]
286.40	40/1	1.7	4200	1.2	65	0.87	4200	0.62	62	0.03	4200	< 0.05	60
262.22		1.9	4200	1.3	66	0.95	4200	0.68	62	0.04	4200	< 0.05	60
231.67		2.2	4200	1.4	67	1.1	4200	0.76	63	0.04	4200	< 0.05	60
196.52		2.5	4200	1.6	68	1.3	4200	0.88	64	0.05	4200	< 0.05	60
180.95		2.8	4200	1.8	68	1.4	4200	0.95	64	0.06	4200	< 0.05	60
161.74		3.1	4200	2.0	69	1.5	4200	1.1	65	0.06	4200	< 0.05	60
145.60		3.4	4200	2.2	70	1.7	4200	1.2	65	0.07	4200	0.05	60
131.85		3.8	4200	2.4	70	1.9	4200	1.3	66	0.08	4200	0.06	60
116.92		4.3	4200	2.6	71	2.1	4200	1.4	67	0.09	4200	0.06	60
105.71		4.7	4200	2.9	72	2.4	4200	1.5	67	0.09	4200	0.07	60
89.60		5.6	4160	3.3	73	2.8	4200	1.8	69	0.11	4200	0.08	60
78.26		6.4	4080	3.7	74	3.2	4200	2.0	69	0.13	4200	0.09	60
65.45		7.6	3910	4.2	75	3.8	4200	2.4	70	0.15	4200	0.11	60
80.85		6.2	3110	2.4	84	3.1	3010	1.2	82	0.12	3010	< 0.05	80
71.43		7.0	4200	3.6	85	3.5	4160	1.9	82	0.14	4160	0.08	81
60.59		8.3	4200	4.3	85	4.1	4080	2.1	83	0.17	4080	0.09	81
55.79	9.0	4200	4.6	86	4.5	4200	2.4	83	0.18	4200	0.10	81	
49.87	10	4200	5.1	86	5.0	4200	2.6	83	0.20	4200	0.11	81	
44.89	37/3	11	4160	5.6	86	5.6	4200	2.9	84	0.22	4200	0.12	81
40.65		12	4120	6.1	87	6.2	4200	3.2	84	0.25	4200	0.13	81
36.05		14	4080	6.8	87	6.9	4200	3.6	85	0.28	4200	0.15	81
32.60		15	3990	7.3	87	7.7	4200	4.0	85	0.31	4200	0.17	81
27.63		18	3910	8.4	88	9.0	4200	4.7	86	0.36	4200	0.20	81
24.13		21	3800	9.3	88	10	4200	5.3	86	0.41	4200	0.23	81
26.39	19	2590	5.7	90	9.5	2540	2.8	89	0.38	2540	0.12	87	
23.59	21	2590	6.3	91	11	2540	3.2	89	0.42	2540	0.13	87	
21.23	24	2590	7.0	91	12	2570	3.6	89	0.47	2570	0.15	87	
19.23	26	2620	7.8	91	13	2570	3.9	89	0.52	2570	0.16	87	
17.05	35/6	29	2620	8.8	91	15	2570	4.4	90	0.59	2570	0.18	87
15.42		32	2620	9.7	92	16	2570	4.8	90	0.65	2570	0.20	87
13.07		38	2650	11.6	92	19	2590	5.7	90	0.77	2590	0.24	87
11.41		44	2650	13.2	92	22	2590	6.6	91	0.88	2590	0.27	87
9.55		52	2650	15.7	92	26	2620	7.9	91	1.0	2620	0.33	87
8.26	61	2650	18.1	93	30	2620	9.1	91	1.2	2620	0.38	87	

